HOTLINE FIX

Group: 54 – Chassis Electrical	**Original Date: 2nd February 2017**	**No. QE54-001**
Model: QE Pajero Sport	**Subject: Confirmation method and judgement of DRL brightness.**	
Revised on 11/02/2019..... (date) **Revised on** ..... (date) **Revised on** ..... (date)	Gary Van Gils National Service Manager Service Operations	
MMAL Ref TSL1612115	**Document consists of 4 pages.**	

1. **Subject:** Confirmation method and judgement of DRL brightness.

2. **Description:** As a result of some headlamp assemblies being returned for "yellowing" and "dulling", investigation has found a large portion of returned headlamps to be of normal condition. The purpose of this Hotline Fix is to provide a firm judgement criteria between servicable parts (OK) and defective parts (NG).

3. **Cause:** In some cases, during normal operation and due to a possible flaw in the application of resin inside the headlight during manufacture, the inner lens may partially melt, causing yellowness or uneven brightness.

4. **Improvement:** Quality control countermeasures have been implemented during production to ensure higher quality of the inner lense.
   (Production Improvement effective from Headlamp manufacture : Dec 16, 2015, after marking "H-FP16D")
   (Production Improvement from VIN MMTGUKS10GH000043)

5. **Field Fix:** On a customer complaint basis only**,** and as per the attached document, inspect the headlamp, and replace it ONLY if it has failed as per the below judgement criteria. Photos will be required for the relevant SCA.

   If it is judged that the part requires replacement, please replace it with a new item that carries a date identifying it AFTER H-FP16D (date marking translation table attached).

6. **Warranty:** Standard warranty terms and conditions apply.

Disclaimer: *The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.*


Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff

Copyright © Mitsubishi Motors Australia Limited
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer use only. It must not be provided to third parties.

Inspection Method

1. Turn on Daytime Running Light (DRL) on headlight.
2. To checking the DRL brightness follow direction as below picture and judgment by compare with criteria picture as table 1.



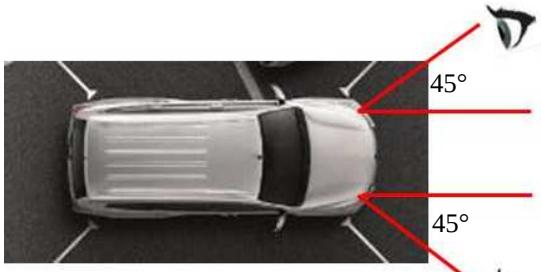

See direction at 45° from headlight





See direction at same level of headlight

Table 1: Judgment criteria of Daytime running Light brightness (1)

No.	Headlight		Brightness level	Judgement
	RH	LH		
1			Most to least	Normal part
2				Normal part
3				Normal part
4				Normal part
5 Limit				Normal part

Table 1: Judgment criteria of Daytime running Light brightness (2)

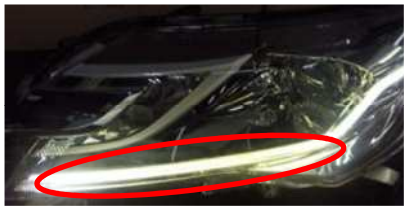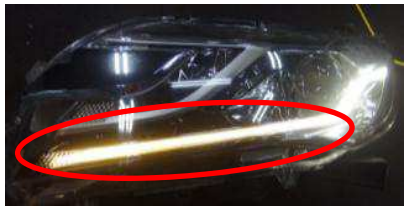
No.	Headlight		Brightness level	Judgment
	RH	LH		
6			Most to least	Defect part
7				Defect part
8				Defect part
9				Defect part
10				Defect part
11				Defect part

Start

< Remark : Red circle ( ) in picture are yellow shade and unbalance brightness >

Standard of part production lot

<Pattern of stamping production lot>

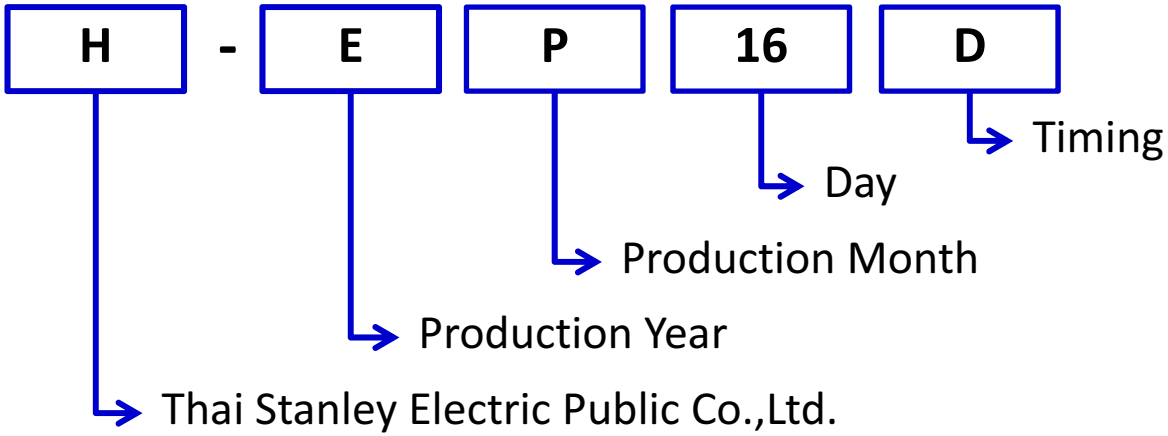



<Remark>

H : Thai Stanley Electric Public Co.,Ltd.

Year : Using English alphabet instead of the last digit of production year

Alphabet	A	B	C	D	E	F	G	H	K	M
Year	1	2	3	4	5	6	7	8	9	10

Month : Using English alphabet instead of production month

Alphabet	A	B	C	D	E	F	G	H	K	M	N	P
Month	1	2	3	4	5	6	7	8	9	10	11	12

Day : Using the actual date of production

Timing : Separated to 2 period < D – Day shift and N – Night shift

>*Please note : Effective at Headlamp unit on 15 Dec 2015 (Marking part : H-EP16D)