HOTLINE FIX


Group: 54 – Chassis Electrical	**Original Date:** 13/08/2019	**No.** QE54-002
Model: QE Pajero Sport	**Subject:** SDA in call receiver echo/grammatical error in start message/bluetooth volume level.	
Revised on 12/09/2019 **Revised on** ..... (date) **Revised on** ..... (date)	Neil Dunn Head of Service Service Operations	Neil M Dunn
MMAL Ref P4487(C)	Document consists of 11 pages.	

1. **Subject**: SDA in call receiver echo/grammatical error in start message/Bluetooth volume level.

2. **Possible Cause**: Due to settings for the microphone and echo cancellation within the SDA unit, some echo and distortion, and low voice volume may be experienced at the receiver's end during phone calls.

3. **Improvements**: In addition to the changes outlined in NX54-001/QE54-002, further improvements to volume level & bluetooth echo have been made. The "Agree" button is no longer required to be pressed and will go away automatically after approximately 5 seconds. Software is intended to be introduced from 19MY vehicle.

   Boot-up logo has also changed.

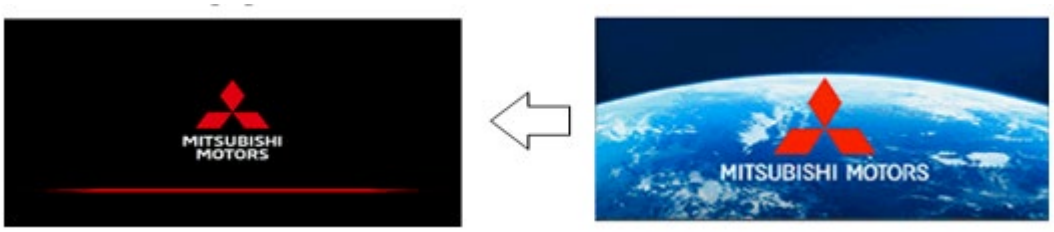

   Required Software: Pajero Sport Version 3 (as displayed on Getac Infotainment Update Tool).

   Software version (as found in SDA settings)

VERSION INFORMATION (SETTINGS)	
Revised <New>	Before revision <Old>
2.3.0006.0200	Below : 1.8.xxxx.xxxx

4. **Field Fix:** On a customer complaint basis only, please reflash SDA as per attached instructions.

5. **Warranty Information:** Standard terms and conditions apply.

   Warranty claim procedure listed on next page.

Disclaimer: The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff

Copyright © Mitsubishi Motors Australia Limited
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer use only. It must not be provided to third parties.

Hotline Fix QE54-002	**SDA in call receiver echo**		
Claim header tab	Claim Type	YC01	
	Item 1	Item Type	Miscellaneous Parts
		Part No.	Reflash
		Dealer Quantity	1
		Part Causing Damage	☑
		Claimed Amount	$0.00
		Position Code	545013
		Complaint	55
		Circumstance	As per customer complaint
		Diagnosis Code	5D
		Notes	Hotline Fix QE54-002
	Item 2	Item Type	Labour Value
		Labour Operation	545013 TK
		Labour Allowance	.3

Disclaimer: *The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.*

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff

Copyright © Mitsubishi Motors Australia Limited
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer use only. It must not be provided to third parties.


Notes:

- **Before beginning this process, you will need a USB storage device (flash memory) minimum 4GB, maximum 8GB, FAT32 format.**
- **This process involves resetting of system/user settings and information. Please obtain customer permission before beginning the update procedure.**
- **The Re-flash process takes approximately 15 minutes, so it is suggested that a secondary (jump) battery or battery charger is connected to the vehicle, to prevent excessive discharge of the vehicle battery.**


Step 1. Ensure your Getac scan tool is up to date. Check this by going to the "Additional Software" tab, shown below.




Step 2. Then ensure you have the icon shown below, "Infotainment Update".

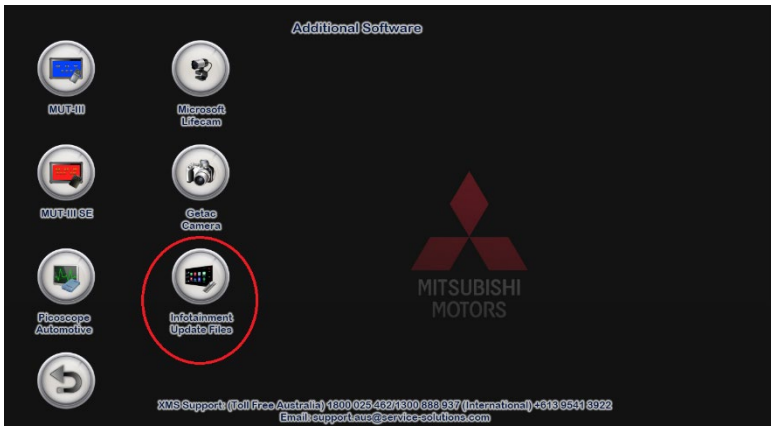


Step 3. Click on "Infotainment Update", this should launch the screen shown below. (If this icon is not shown, please ensure your tablet is connected to the WI-FI and updates are carried out. If you have any issues, please contact Bosch for support). Then insert the USB into your Getac. (Please ensure you have saved any data off of the USB that you would like to keep, as performing the procedure will format the USB.)

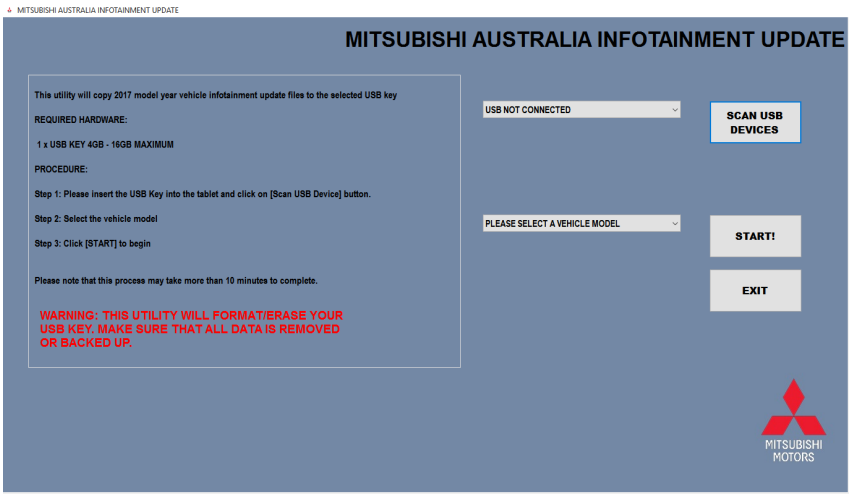


Step 4. Click on "Scan USB Devices"

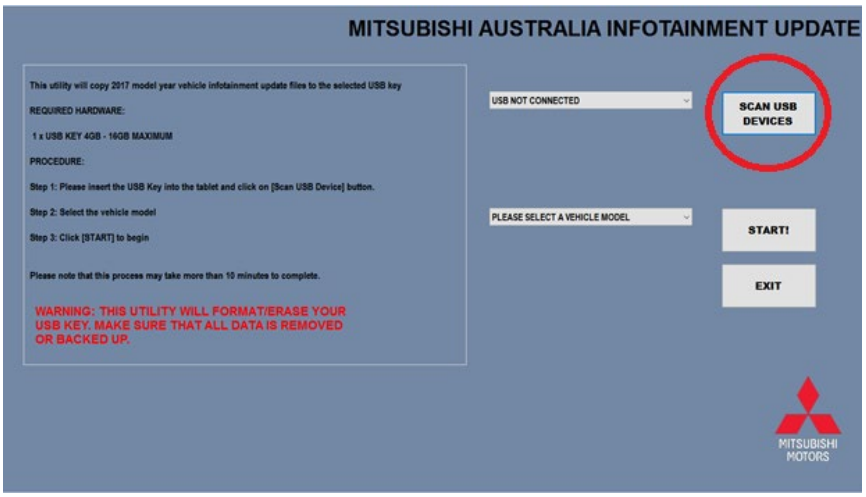


Step 5. Select your USB from the dropdown menu.

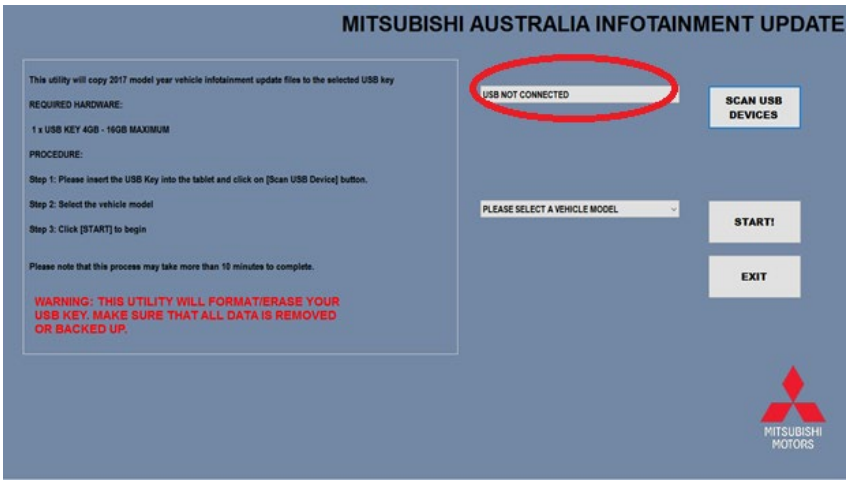

Step 6. Select the vehicle you wish to update from the drop down menu shown (Note: You can use the same USB more than once, as it will format every time). – Refer to Hotline Fix "Required Software" to confirm correct software is available.

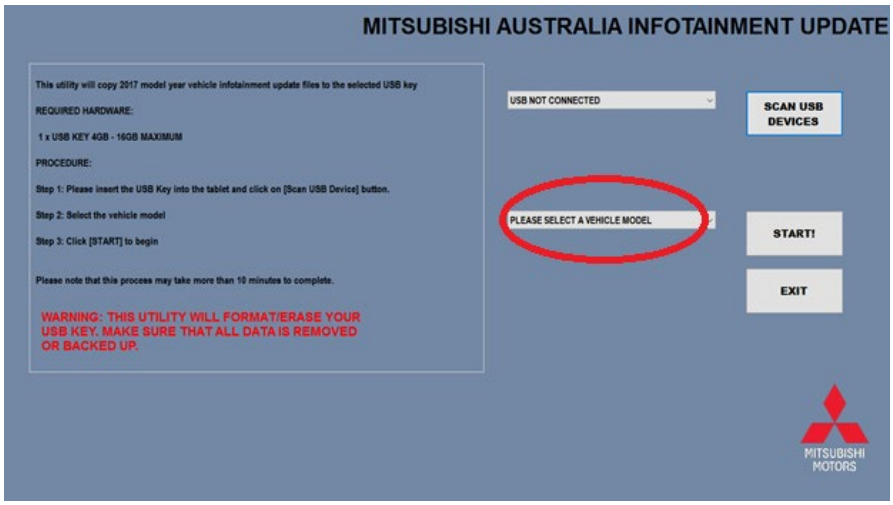

Step 7. Click “Start” and then let the update run.

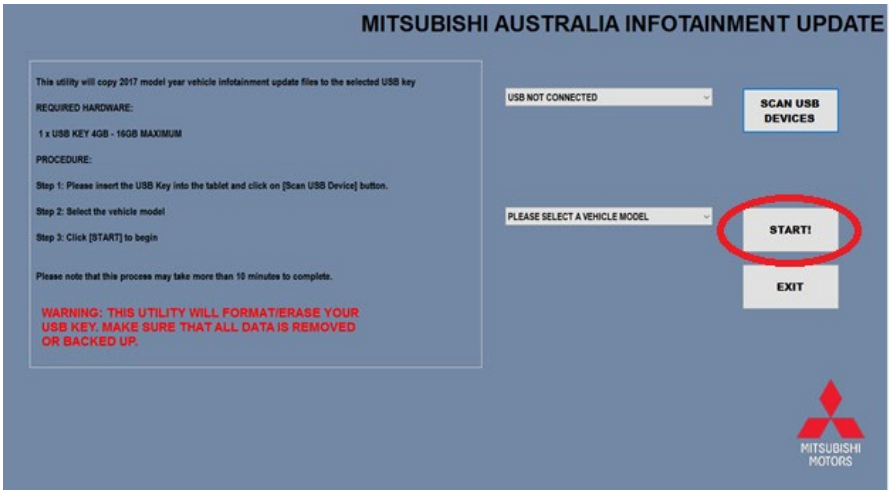

Step 8. Once the update is complete, remove the USB from the tablet and click exit.

Step 9. Insert the USB device into one of the vehicle USB ports.

Press the power switch once (with foot off the brake pedal) to put the vehicle in “ACC”.

Step 10. Inspect the current software of the SDA unit.

If the home screen is not shown, press the power button once. Press the settings button, the SDA will then display the “settings” screen.



Switch pages with the [<< / >>] button on the “settings” screen, and push the [information] tab. The SDA will display the “information” screen.



Step 10. (Continued)

Check the contents of the "Version Information".


- If the latest software version is shown there is no need to update the software
- If the software version is not showing as the latest version, complete the software update.




New Software Version
2.3.0006.0200

Step 11. Enter "Diagnosis Mode" by pressing the screen power button for 1-2 seconds (until screen goes black) and release, then hold the top left corner of the screen for 3-5 seconds (or until a double beep is heard), release and then press the lower right section of the screen briefly. **If a beep is not heard, please check the "Operating Sound" setting is on in the "System > Settings" menu.**



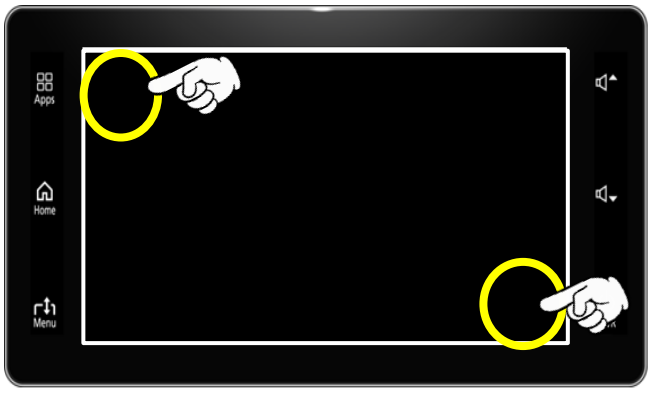

Step 12. Once in the service menu, click “Next” in the bottom RH corner of the screen.

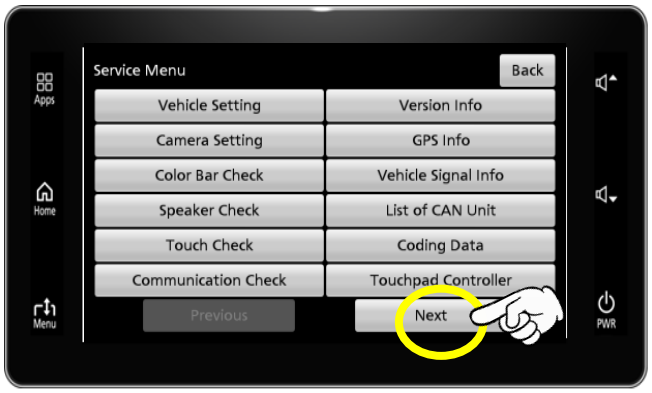

Notice: Please ensure the USB device is connected before this operation.

Once on the next screen, select “SW update” and follow the prompts to initiate the update process. Several update screens will appear, updating different sections of the SDA. Please follow the prompts to complete the update (DO NOT switch the power off, start the vehicle or remove the USB at any stage during the update process).





After the update has completed, the SDA unit will restart.

Step 13. Once the SDA restart is complete, eject the USB device (press "agree"). The SDA will then display the "Home" screen.


Press the "settings" icon, the SDA will then display the "Settings" screen.



Push the "System" tab.



Press the "Reset all" button. This will delete all customer settings. Please obtain customer consent prior to performing the update.

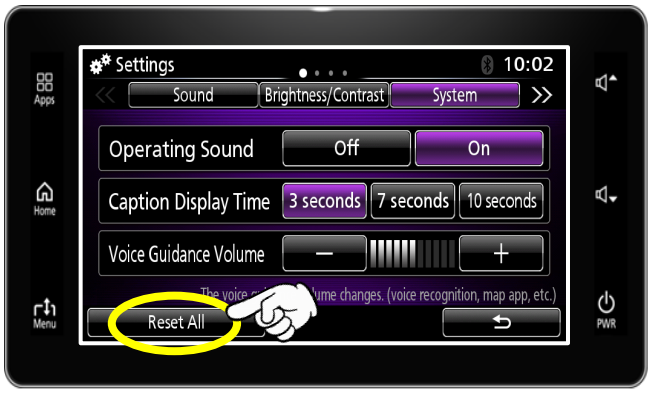

Step 13. (Continued)


The SDA will display the “reset the system” prompt, press “YES”.



Step 14. Once the reset is complete, navigate to the “home” screen and navigate to the “information” tab in the “settings” screen and confirm the software update is complete.





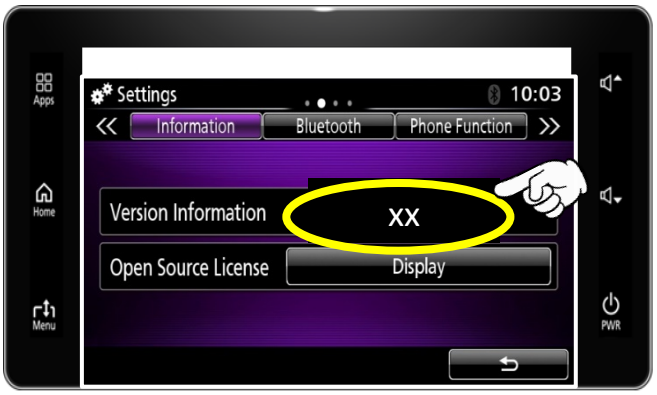

New Software Version
2.3.0006.0200

Return the unit to the “Home” screen and ensure the USB is removed from the vehicle.



The software update is complete.