Alpine Infotainment in Triton MR Troubleshooting Guide

If you encounter a problem, please turn the ignition accessory power off, then on again. If the unit is still not functioning normally, please review the relevant items in this document. This guide will help you isolate the problem if the unit is at fault. Otherwise, make sure the rest of your system is properly connected and all external factors have been considered.

If issues cannot be rectified by following the advice in this guide, please email the Alpine Service Department with the relevant case information, and a service team member will assist*: service@alpine.com.au

- SERVICE TICKET/JOB REFERENCE NUMBER:
- HEAD UNIT MODEL: (iLX-507Ai)
- HEAD UNIT SERIAL NUMBER:
- HEAD UNIT FIRMWARE VERSION:
- VEHICLE MODEL, TRIM LEVEL:
- DETAILED FAULT DESCRIPTON:
- CONTACT PHONE NUMBER:

**These contact details are provided for dealer support and should not be advised for direct customer communication.*

Contents

BASIC 2
No Function or Display. 2
No Sound or Unnatural Sound. 2
Screen Not Displayed. 2
Movement of Displayed Picture is Abnormal. 2
INSTALLATION 3
Diagnostics 3
Main Power 3
GPS Antenna 3
DAB Antenna 4
USB Cable 4
HDMI Cable 4
Reverse Camera 4
Microphone 4
Steering Wheel Controls 5
OPERATION 5
Radio 5
USB Audio 5
Handsfree Phone 6
If A Message Appears 6
CONNECTIVITY 7
Android Auto Connection 7
Apple CarPlay Connection 8
FACTORY RESET 9
UNIT UPDATE 9

BASIC

No Function or Display.

Vehicle's ignition is off;

- If connected according to the instructions, the unit will not operate with the vehicle's ignition off.

Improper power lead connections;

- Check power lead connections.

Blown fuse;

- Check the fuse on the power lead of the unit; replace with the proper value if necessary.

No Sound or Unnatural Sound.

Incorrect setting of volume/balance/fader controls;

- Readjust the controls, reselect Preset 1 as the Alpine|Triton EQ Setting.

Connections are not properly or securely made;

- Check the unit connections and all plugs are correctly seated.

Screen Not Displayed.

Brightness/Contrast control is set at the minimum position;

- Adjust the Brightness/Contrast control.

Temperature in the vehicle is too low;

- Increase the vehicle's interior temperature to within operating temperature range.

Movement of Displayed Picture is Abnormal.

Temperature in the vehicle is too high;

- Allow the vehicle's interior temperature to cool.


INSTALLATION

Closely follow the provided installation manual (EG100162).

For missing, lost or damaged parts, please contact service@alpine.com.au, noting the part numbers on the accompanying parts diagram document.

Diagnostics

There is some diagnostics information available to the user on the device. This can be useful for showing connectivity and settings issues without disassembling the vehicle dashboard. Access this information following the below steps:

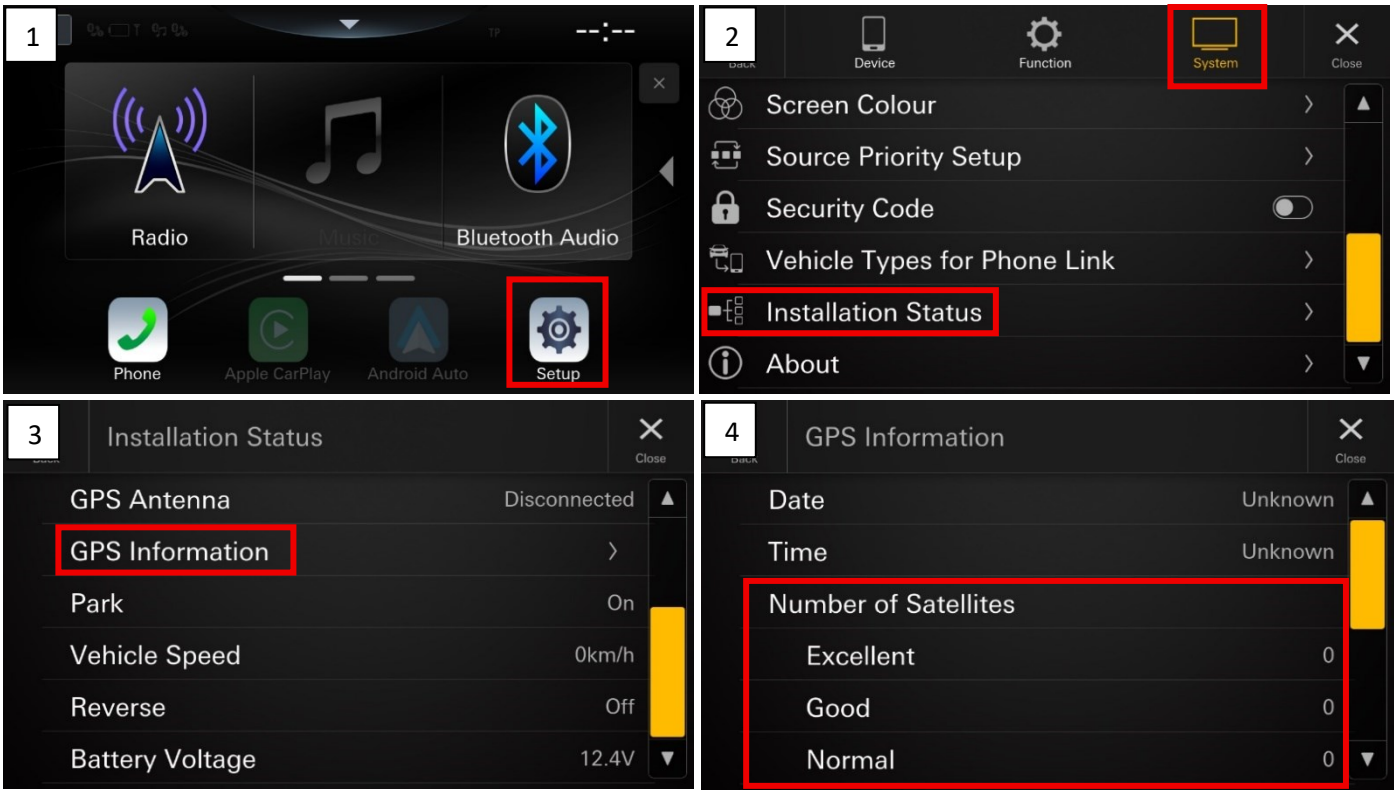

Main Power

If the unit does not power on after install, confirm the following;

- Confirm the battery has been reconnected after install.
- Confirm that the 16-Pin power connector is connected to the head-unit and the 20-Pin power connector is connected to the factory harness. Confirm the connectors are seated correctly.
- Confirm the fuse on the main power harness is seated correctly and intact.

GPS Antenna

No GPS connection;

- GPS Antennas can take some time to initialise on first boot, especially when indoors.
- Confirm that the GPS interconnect is installed and both connectors are seated correctly.
- Confirm the GPS cable is free from kinks, and not pinched by any brackets or dashboard parts.
- In Mi-Display vehicles, there is no factory installed GPS antenna. In this vehicle type, ensure that the additional GPS antenna part number EG100164 is fitted and connected directly to the GPS port on the head-unit.
- Check in the diagnostics menu described above to confirm satellite connectivity.

DAB Antenna

No DAB connection;

- DAB Antennas can take some time to initialise on first boot, especially when indoors.
- Confirm that the DAB interconnect is installed and both connectors are seated correctly.
- Confirm the DAB cable is free from kinks, and not pinched by any brackets or dashboard parts.

USB Cable

No USB connection;

- Confirm that both USB interconnects are connected to the factory media port cables and both connectors are seated correctly.
- Confirm the USB cables are free from kinks, and not pinched by any brackets or dashboard parts.
- Confirm that an appropriate USB cable is being used for the device connected to the head-unit, preferably made by the device manufacturer.
- For device connectivity issues, please see the CONNECTIVITY section.

HDMI Cable

No HDMI connection;

- Confirm that the HDMI interconnect is connected to the factory media port cable and both connectors are seated correctly.
- Confirm the HDMI cable is free from kinks, and not pinched by any brackets or dashboard parts.
- Confirm that the HDMI Device output is compatible with the head-unit specifications found in the owner's manual (EG100163).
- For other issues related to HDMI, see HDMI in OPERATION section.

Reverse Camera

No camera image;

- Confirm that the 22-Pin camera connector is connected to the head-unit and the 8-Pin camera connector is connected to the factory harness. Confirm the connectors are seated correctly.
- Confirm the camera harness is free from kinks, and not pinched by any brackets or dashboard parts.
- Reverse camera is only powered in key position 2 or when the engine is running.

Microphone

No microphone connection;

- Confirm that the 12-Pin microphone connector is connected to the head-unit and the 16-Pin microphone connector is connected to the factory harness. Confirm the connectors are seated correctly.
- Confirm the microphone harness is free from kinks, and not pinched by any brackets or dashboard parts.
- Confirm the original microphone has been replaced by the Alpine microphone part (EG100160). This can be differentiated from the original as it is black and the original is grey.

Poor microphone sound quality;

- In the Setup -> System -> Microphone EC/NR Menu, call quality can be tuned.
- Confirm that the connectors are seated correctly, and no aftermarket power wiring is routed near the harnessing.

Quiet or muffled calls;

- Adjust the microphone volume settings in the below locations:
  Setup -> Function -> Phone
  Setup -> Function -> Apple CarPlay
  Setup -> Function -> Android Auto
- For call issues related to Android Auto and Apple CarPlay, see the CONNECTIVITY section.

Steering Wheel Controls

No steering wheel controls;

- Steering wheel controls can take a short time to initialise. Reboot the unit and confirm lack of function.
- Confirm that the 12-Pin SWC connector is connected to the head-unit and both connectors are connected to the CAN interface module. Confirm the connectors are seated correctly.
- Confirm the SWC harness is free from kinks, and not pinched by any brackets or dashboard parts.
- SWC interface is only powered in key position 2 or when the engine is running.

OPERATION

Radio

Unable to receive stations;

No antenna, or open connection in the antenna cable.

- Make sure the antenna is properly connected; replace the antenna if necessary.

Unable to tune stations in the seek mode;

You are in a weak signal area.

- Make sure the tuner is in Seek mode.

If the area you are in is a primary signal area, the antenna may not be grounded and connected properly.

- Check your antenna connections; make sure the antenna is properly grounded at its mounting location.

Broadcast is noisy;

The station signal is weak and noisy.

- If selected station does not work, tune into another station.

USB Audio

Unit does not operate;

Condensation.

- Wait a while (about 1 hour) for the condensation to dry.

Picture is unclear or noisy;

Vehicle's battery power is weak.

- Check the battery power (The unit may malfunction if the battery power is under 11 volts with a load applied.)

Handsfree Phone

Ringtone is low;

Depending on your phone, the ringtone volume may be low, it is not a failure.

If A Message Appears

Various messages are displayed on the screen during operation. In addition to the messages telling you the current status or providing guidance for the next operation, there are also the following error messages. If one of these error messages is displayed, carefully follow the instructions suggested.

System;

Unable to operate while driving.

A setup operation, etc., was carried out while the vehicle was running.

- Move the vehicle to a safe location, stop, and engage the parking brake, then carry out this operation.

USB Hub is not supported.

A USB flash drive with a hub is connected.

- You cannot play back from a USB flash drive with a hub. USB hub connections are also not supported.

Audio/Visual;

Connected USB Device is not supported.

An iPhone that is not supported by the unit is connected.

- Connect an iPhone that is supported by the unit.

A USB device that is not supported by the unit is connected.

- Attempt to connect another USB flash drive.

Communication error.

- Turn the ignition key off, and then set to ON again.
- Check the display by reconnecting between the iPhone and the unit, using the iPhone cable.
- Check the display by reconnecting between the USB flash drive and the unit.

Caused by the iPod/iPhone Software Version not being compatible with this unit.

- Update the iPhone Software Version to be compatible with this unit.

The iPhone is not verified.

- Change to another iPhone.

DAB Antenna error

The DAB antenna cable is either damaged or not connected correctly to the product.

- Check that the antenna cable is not kinked or otherwise damaged. Replace the antenna if necessary.

Abnormal current is run to the DAB Antenna.

- Connect the antenna properly to a car with a 12-volt negative ground.

HDMI;

HDMI communication error.

Please check your device and operate it again.

The HDMI devices are not connected properly.

- Remove the HDMI devices from the unit, and then reconnect them. Enable the output setting on the HDMI devices.

HDMI monitor communication error.

Please check the connection or ACC off / on.

Connection error

- Turn OFF/ON the engine (ACC), or check the HDMI connection cable of the HDMI compatible monitor.

CONNECTIVITY

The bulk of the support tickets we receive regarding product issues are actually related to connectivity with Android Auto and on occasion Apple CarPlay, and not related to the product itself. Follow the below set of procedures to assist with troubleshooting and note the recommendations regarding regular resetting of devices. Just like a computer, these devices require cycling and updating regularly.

The vast majority of the time, the issue is the customers phone, USB lead or USB pass-through device being used in the vehicle.

After every major Android or IOS update, we receive an influx of connectivity related support tickets. Often, after a week or two, an additional fix will be released by Google/Apple to rectify the connectivity issues caused by the most recent update. If there is a known connection issue or software update for a head unit, we will share this with you. If there are multiple support requests with similar connection symptoms, please inform us and we will address this with a software update as quickly as possible.

Please try the below processes first to get your customer back on the road and enjoying their product quickly.

Android Auto Connection

- Make sure the phone has been restarted and advise customer to do this as a weekly practice.
- Make sure the phone has the latest software updates and that a full restart on their phone is done after every update (critical).
- After every major phone update, we highly recommend a new pairing to the head unit: delete the pairing in the head unit, delete the pairing on the phone, open the settings on the phone and search for Android Auto. Select **Previously Connected Cars** and then **3 dots top right**, select **Forget All Cars** and then perform a new connection to the head unit. Sometimes after a major update, the connection protocols don't transfer across fully and can have connection glitches.
- Select **Google Play Store** and open top right circle (customers profile). Select **Manage Apps and Games** then **Updates** – make sure all apps are up to date especially anything Google or Android related. Once all apps are updated, restart the phone again.
- Once all of the above has been completed, open the head unit settings and delete pairing in the Bluetooth menu.
-

- It is also possible to do a head unit reset – open the Settings -> System -> About Menu and select **Clear All Settings**. IMPORTANT: Customer's settings will be lost, so take a photo or note of all relevant changes.
- Now that the phone and head unit are reset, try connection process with either wired or wireless.

If you cannot get a connection via Wired USB, please try the following;

- Try a new USB lead – preferably the genuine one that came with the phone.
- Check the charge port of the phone for lint, dust, damage or loose connection. One piece of dust can stop data transfer but allow charging as normal.
- Some less common or older Android phones may require USB debugging to be activated. On Android phones this is a Developer Option setting in a hidden menu. Open "Developer options" of the particular phone model and then activate USB Debugging. Some devices do not recognise they are connected to an Android Auto compatible head unit and thinks it is a charger only and won't allow data through.

Apple CarPlay Connection

- Confirm the iPhone has been restarted and advise customer to do this as a weekly practice.
- Try a soft reset on the iPhone (no settings will be lost). A quick google search will show how to soft reset different models. Usually this involves holding down a set combination of buttons until the iPhone reboots.
- Confirm all apps are up to date on App Store.
- Confirm the iPhone has latest version of IOS software. If not, complete updates and then restart iPhone.
- If using a wired connection, try a different USB lead. It is highly recommended to use genuine Apple lead.
- Confirm SIRI is enabled; Settings -> Siri -> toggle "listen for hey Siri" to ON. Set "Press side button for Siri" to ON and also turn "Voice feedback" to Always On.
- Open Settings -> Screen Time -> Content & Privacy Restrictions. If content & privacy restrictions is ON, select "Allowed Apps" and make sure CarPlay is enabled.
- Open Settings -> General -> CarPlay. Select the vehicle and select "Forget this car and try the set up process again.

If using wireless CarPlay;

- Confirm Bluetooth is turned on.
- Confirm WIFI is turned on.
- Select CarPlay network and confirm that "Auto Join" is turned on.

FACTORY RESET

It can help to reset the head-unit as part of troubleshooting, and to isolate any issues. Setup -> System -> About -> Clear All Settings.

After a factory reset, some changes should be made manually to the unit to ensure compatibility with the vehicle in this application:

1. Setup -> Function -> Radio -> DAB Power ON
2. Setup -> Function -> Auxiliary -> Name -> OFF
3. Setup -> System -> Key Sound -> 1
4. Setup -> System -> Time Adjust -> 12h
5. Setup -> System -> Home Screen Type -> Enhanced Text
6. Setup -> System -> Source Priority Setup:
   - Radio
   - Music
   - Bluetooth
   - HDMI
   - USB1
   - USB2
   - Tidal
7. Home -> Tune -> Equaliser -> Hold down Preset 1 until tune is saved to it.
8. Home -> Tune -> Base = 1 and Treble = 2

UNIT UPDATE

From time to time, Alpine will release software updates. Load the unzipped Update folder to a formatted USB drive and follow the below process to apply these updates to the head unit.

Setup -> System -> About -> Firmware Version -> Update.

