MITSUBISHI MOTORS Drive your Ambition	# HOTLINE FIX	
Group: 54 - Chassis Electrical	**Original Date: 27/06/2018**	**No. ZK54-004, YA54-002, MQ54-002**
Model: ZK Outlander/YA Eclipse Cross/MQ Triton	**Subject: Hands free volume level is too low (SDA units only)**	
Revised on 26/07/2018..... (date) **Revised on** ..... (date) **Revised on** ..... (date)	Michael Miller Manager Field Services	
MMAL Ref TSL1806040	**Document consists of 6 page/s**	

(1) **Subject:** Hands free volume level is too low (SDA units only).

(2) **Possible Cause:** Due to a programming setting for echo reduction countermeasure, the maximum speaker output level of hands free functions may be too low to hear clearly in all situations. Also, some voice commands may not be interpreted correctly due to changed microphone gain settings.

(3) Other Improvements:

- Removal of necessity to press "Agree" every time SDA is started (Triton only).
- Update to the Mitsubishi Motors Corporate logo on opening screen (Triton only).

(4) **Production Fix:** The SDA unit software has been improved in production as below.

Vehicle	Improvement Date
ZK Outlander/Outlander PHEV	11/05/2018
YA Eclipse Cross	15/05/2018
MQ Triton	From 19 MY (Planned)

(5) **Field Fix/Action:** On a customer complaint basis only, reprogram the SDA software with the revised version as per the attached procedure.

Applicable Model	Software Version	
	Revised	**Previous**
ZK Outlander PHEV 17/18MY	**1G**	B, D, E, I, L N, O, Q, 1E
YA Eclipse Cross	**O**	B, J, K, L
MQ Triton	**3.1.0006.0400**	Below 3.0.XXXX.XXXX

Note: The update procedures and software are model specific. Please ensure the correct software is selected from the MUTIII tablet and the correct update attachment instruction is followed.

Note: As the software update may take up to 30 minutes to complete, it is suggested that an external power source is connected to the vehicle battery during reprogramming.

(6) **Warranty Information:** Standard warranty terms and conditions apply.

Continued Page 2.

Disclaimer: *The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty*.

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff

Copyright © Mitsubishi Motors Australia Limited
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer use only. It must not be provided to third parties.

Hotline Fix ZK54-004/YA54-001/MQ54-002	Hands free volume level is too low (SDA units Only)		
Claim header tab	Claim Type	YC01	
	Item 1	Item Type	Miscellaneous Parts
		Part No.	Reflash
		Dealer Quantity	1
		Part Causing Damage	☑
		Claimed Amount	$0.00
		Position Code	545013
		Complaint Code	55
		Circumstance Code	As per customer complaint
		Diagnosis Code	5D
		Notes	Hotline Fix ZK54-004/YA54-001/MQ54-002
	Item 2	Item Type	Labour Value
		Dealer Quantity	1
		Labour Operation	545013 TK
Labour Allowance	As per LOTS time.		

Update Procedure:

Notes: Before beginning this process, you will need a USB storage device (flash memory) minimum 4GB, maximum 8GB, FAT32 format.

This process involves resetting of system/user settings and information. <u>Please obtain customer permission before beginning the update procedure.</u>


The reflash process takes approximately 30 minutes, so it is suggested that a secondary (jump) battery or battery charger is connected to the vehicle, to prevent excessive discharge of the vehicle battery.

The reflash file attached to this Hotline Fix is for ZK Outlander, YA Eclipse Cross and MQ Triton vehicles with SDA units only – Do not use for any other vehicle models.


Step 1. Ensure your Getac scan tool is up to date. Check this by going to the “Additional Software” tab, shown below.




Step 2. Then ensure you have the icon shown below, “Infotainment Update”.

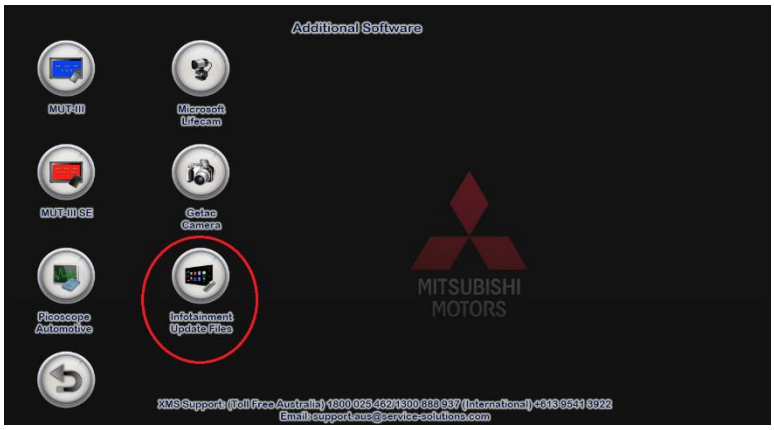


Step 3. Click on “Infotainment Update”, this should launch the screen shown below. (If this icon is not shown, please ensure your tablet is connected to the wifi and updates are carried out. If you have any issues, please contact Bosch for support). Then insert the USB into your Getac. (Please ensure you have saved any data off of the USB that you would like to keep, as performing the procedure will format the USB).

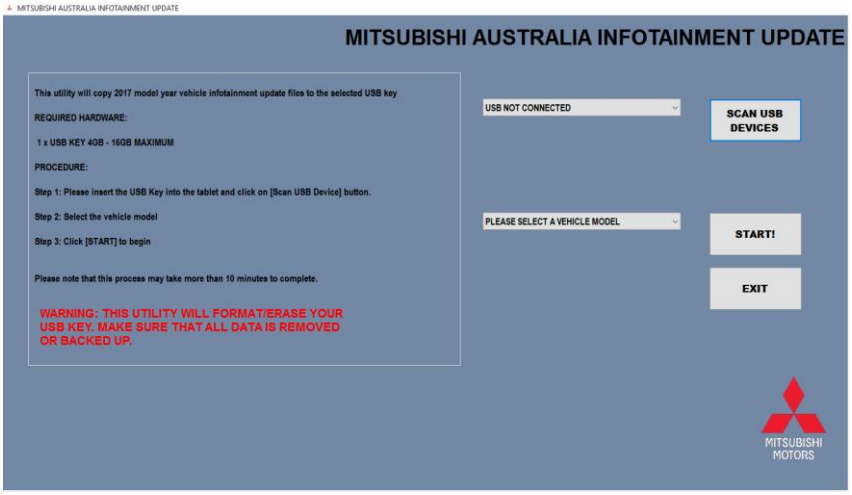


Step 4. Click on “Scan USB Devices”.

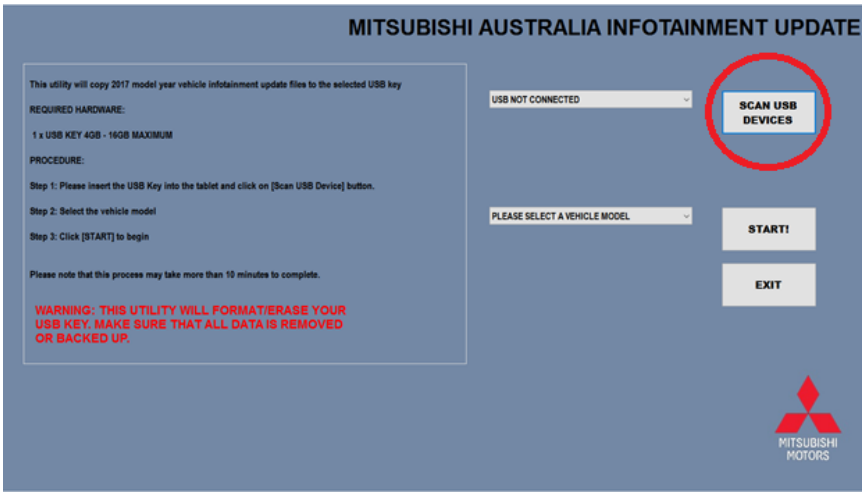


Step 5. Select your USB from the dropdown menu.

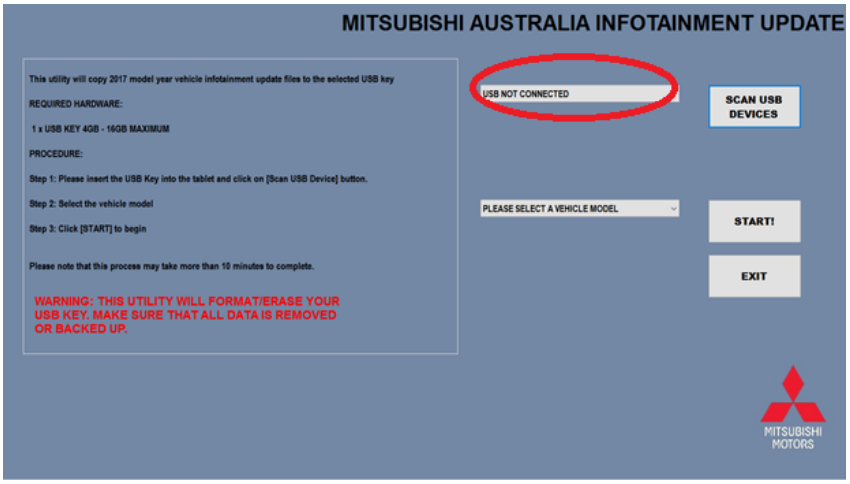

Step 6. Select the applicable vehicle from the drop down menu shown (Note: You can use the same USB more than once, as it will format every time).

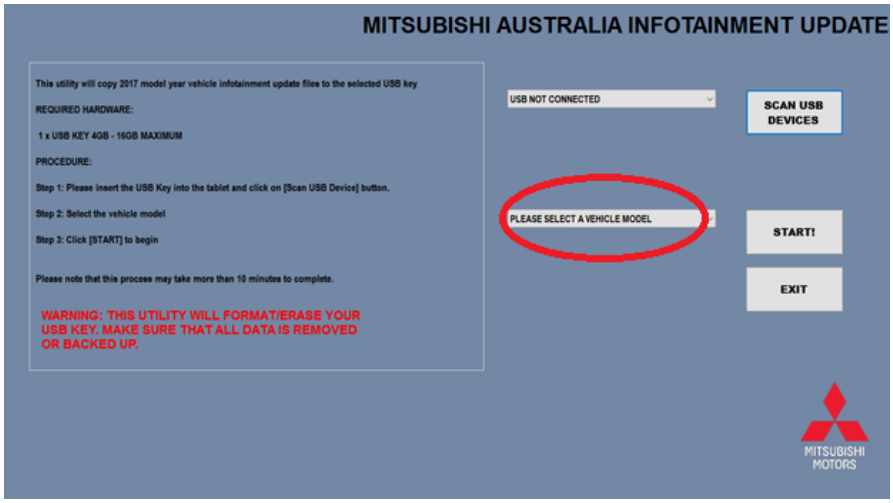

Step 7. Click “Start” and then let the update run.

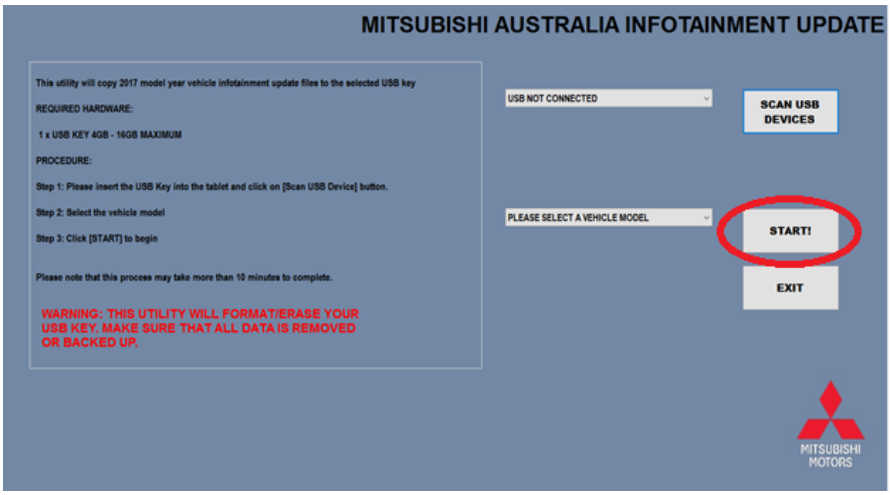

Step 8. Once the update is complete, remove the USB from the tablet and click exit.

Step 9. Insert the USB device into one of the vehicle USB ports.
Press the power switch once (with foot off the brake pedal) to put the vehicle in “ACC”.

Step 10. Refer to **vehicle specific instruction attachment,** attached to this Hotline Fix, for the correct update procedure.