Hotline Fix – ZM35-001

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.

Printed versions of this document may be out of date, check the online version.

Subject

Noise from front brake caliper when turning or braking.

Issued

22/03/2024

Previous Versions

Nil

Group

35 – Basic Brake

MMAL Reference

TSL240005

Applicable Vehicles

Outlander and Outlander PHEV. (7 seat models only – 5 seat models have a different caliper.)

Phenomenon

Noise from brake caliper when turning or braking.

Cause

The front brake caliper pad retainers have insufficient rigidity and in some instances, may deform and contact the brake disc during braking.

Production Fix

The shape and rigidity of the brake pad retainer was improved from January 2024 production (date and cut-off VIN TBC).

Disclaimer: The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer internal use only. It must not be provided or supplied to third parties.
Copyright © Mitsubishi Motors Australia Limited

Hotline Fix – ZM35-001

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.

Printed versions of this document may be out of date, check the online version.

Field Fix/Action

On a customer complaint basis only, replace the brake pad retainers with the improved parts. Refer to the parts information section below.

Due to damage as a result of the brake pad retainer contacting the brake disc. The brake discs may require either machining or replacement.

For claims where brake disc machining or replacement is required. The brake disc measurements must be recorded. Using a suitable brake disc measuring tool, measure the brake disc at its narrowest section and complete the judgement worksheet on the attached sheet (last page).

NOTE: This Hotline Fix includes a requirement for supporting documentation - Please refer to the Warranty Information section for further details.

Parts Information

Model	Part Name	Part Number		Quantity
		New	Old	
Outlander / Outlander PHEV	Clip Set, FR Brake	41097W020P	4605C332	1 set per vehicle (Contains 4 pcs)
	Brake Disc, FR	4615A289		Refer to worksheet

*NOTE: Parts information will not be updated, refer to ASA-CAPS for the latest part number refer information.

Disclaimer: The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer internal use only. It must not be provided or supplied to third parties.
Copyright © Mitsubishi Motors Australia Limited

Hotline Fix – ZM35-001

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.

Printed versions of this document may be out of date, check the online version.

Warranty Information

Claim Details								
Claim Type	Warranty							
Position Code	352251							
Complaint Code	81							
Circumstance Code	As Advised by Customer							
Diagnosis Code	5D							
Claim Items								
Main Labour Operation	Replace Clip Set		Replace Clip Set + Machine Brake Disc(s)		Replace Clip Set + Replace Brake Disc(s)		Replace Clip Set + Remove and Install Brake Disc(s) (Sublet Disc Machine)	
	1 side	2 sides	1 side	2 sides	1 side	2 sides	1 side	2 sides
	N/A	352251MP	352251NG	352251NB	352251NF	352251NA	352251NH	352251NK
External Activity	N/A		N/A		N/A		SUBLET*	
Labour Qty	1							
Labour Time	As per LOTS time							
Spare Parts - Causal Part -	41097W020P							
Quantity	1							
Spare Part	N/A		N/A		4615A289		N/A	
Quantity	N/A		N/A		1	2	N/A	

*NOTE: Sublet invoice must be attached to the warranty claim. Enter the sublet amount less GST on the warranty claim SUBLET line. Refer to the Service Procedure Manual section "19.2.7 GST".

NOTE: The Brake Disc Photo(s) and Brake Disc Photo Identification and Judgement Worksheet must be completed and attached to the warranty claim.

Disclaimer: The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer internal use only. It must not be provided or supplied to third parties.
Copyright © Mitsubishi Motors Australia Limited

Hotline Fix – ZM35-001

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.

Printed versions of this document may be out of date, check the online version.

Brake Disc Judgement Flow and Worksheet

Perform the "Brake Disc Judgement Flow" and photograph the condition of each affected front Brake Disc surface with the "Brake Disc Photo Identification worksheet" VIN and ODOMETER information visible in the photo. Refer example below:



Notes:

- If the surface of the Brake Disc is consistent with normal wear and tear, no action is required regarding brake disc resurfacing or replacement.
- If the Brake Clip interference has caused damage to the Brake Disc, assess the depth of the resulting groove and determine the appropriate repair as per the work flow on Page 5.
- Photos need to be taken of **both** sides of each disc that is assessed to have damage requiring either machining or replacement.


Disclaimer: The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer internal use only. It must not be provided or supplied to third parties.
Copyright © Mitsubishi Motors Australia Limited

Hotline Fix – ZM35-001

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.

Printed versions of this document may be out of date, check the online version.

Brake Disc Judgement Work Flow

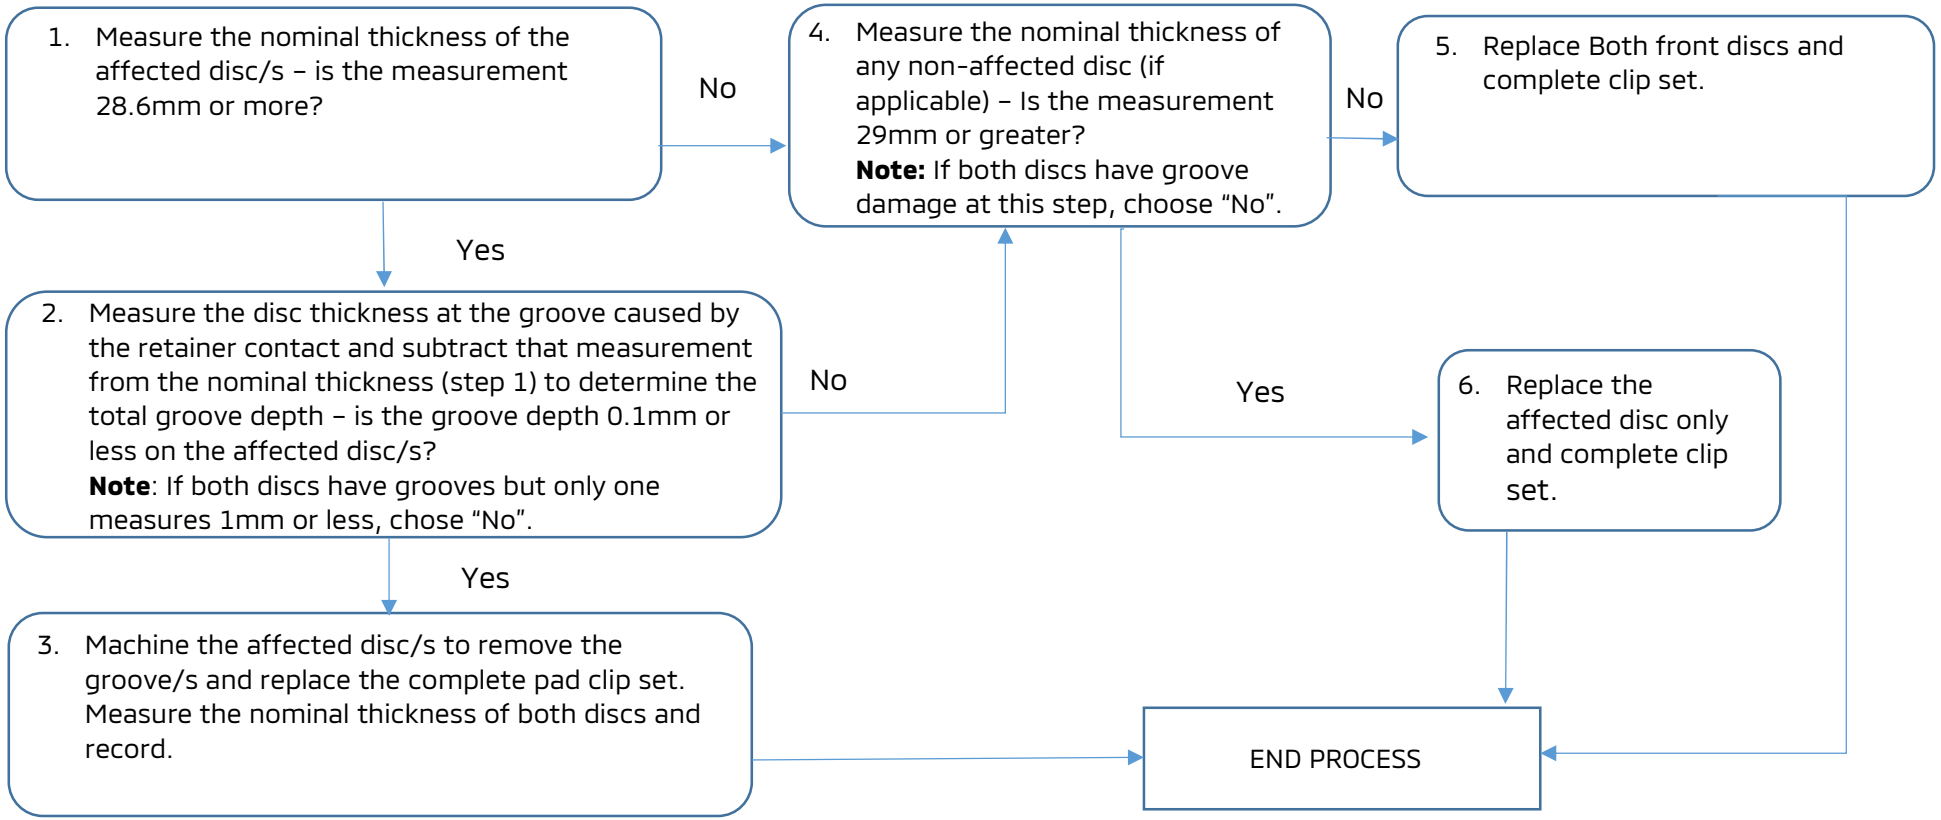

Disclaimer: The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.

Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer internal use only. It must not be provided or supplied to third parties.

Copyright © Mitsubishi Motors Australia Limited

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.

⚠ **Printed versions of this document may be out of date, check the online version.**

Brake Disc Photo Identification and Judgement Worksheet.					
VIN					
Odometer					
Front Brake Disc	**Item**	**Brake Disc nominal thickness** **(Before – As measured in Instruction 1 or 1&4)**	**Brake Disc thickness at groove and calculated Depth of Groove** **(As measured in Instruction 2 – If no groove, write N/A)**		**Brake Disc Thickness** **(After – As measured in Instruction 3 or 4. If the disc/s were replaced write "replaced". If disc was not machined or replaced write "N/A")**
Left (Passenger side)	**Wear thickness**		**Disc**		
			Groove		
Right (Drivers side)			**Disc**		
			Groove		

NOTE: The Brake Disc Photo(s) and Brake Disc Photo Identification and Judgement Worksheet must be completed and attached to the warranty claim.

Disclaimer: The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer internal use only. It must not be provided or supplied to third parties.
Copyright © Mitsubishi Motors Australia Limited