Hotline Fix – ZM37-001

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.

Printed versions of this document may be out of date, check the online version.

Subject

Clunk/click noise occurs from steering rack on Outlander / Outlander PHEV.

Issued

30/09/2026

Previous Versions

19/03/2024

Group

37 – Power Steering

MMAL Reference

TSL2402006-D

Applicable Vehicles


ZM Outlander and ZM Outlander PHEV.

Phenomenon

Complaint 1: Clunk noise from near the driver's feet when starting to turn the steering wheel.

Complaint 2: Click noise near full steering lock on sealed roads.

Cause

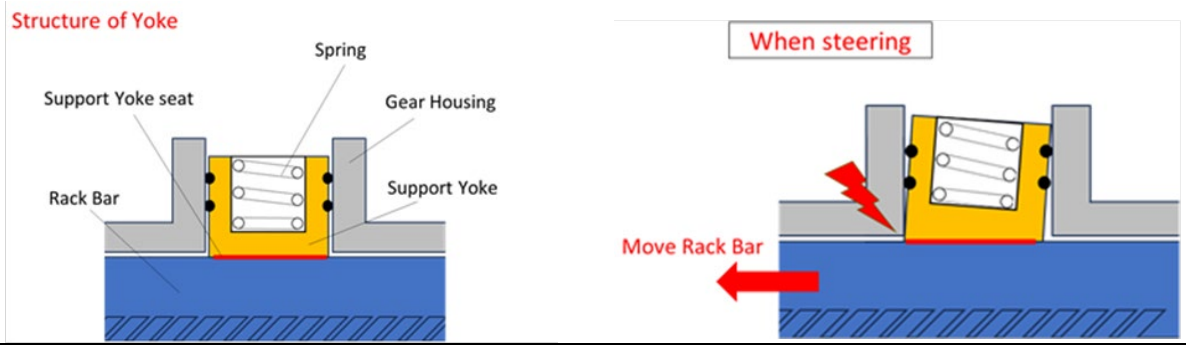Complaint 1
If the grease between the rack and the support yoke seat becomes too thin, friction increases. When the steering wheel is turned, the support yoke may move and contact the rack housing. This may cause a clunk noise and vibration. Due to the design, the noise may not be completely eliminated.


Disclaimer: The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer internal use only. It must not be provided or supplied to third parties.
Copyright © Mitsubishi Motors Australia Limited

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.

Printed versions of this document may be out of date, check the online version.

Complaint 2
The crimping load of the assist side yoke plug may be insufficient.. As the steering components move during steering, the plug can also move slightly and create a clicking noise.


Production Fix

The grease between the rack bar and support yoke has been changed from:

Vehicle	Cutoff DATE	Cutoff VIN
Outlander	Complaint 1: 29/11/2023 Complaint 2: 26/6/2026	JMFXTGM4WRZ008446 JMFXTGM4WTZ005483
Outlander PHEV	Complaint 1: 17/01/2024 Complaint 2: Start of 26MY Production	JMFXDGNOWRZ001907 Start of 26MY Production

Field Fix/Action

On a customer complaint basis, replace the steering rack with the new one according to the workshop manual procedure.

The steering rack includes the EPS-ECU. Therefore, it is necessary to perform the programming then auto configuration of the EPS-ECU and the calibration of the steering torque sensor, according to the workshop manual.

For vehicles with multi-around, it is necessary to confirm the conformity of the image and re-calibrate the camera if required.

Disclaimer: The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer internal use only. It must not be provided or supplied to third parties.
Copyright © Mitsubishi Motors Australia Limited

Hotline Fix – ZM37-001

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.

Printed versions of this document may be out of date, check the online version.

NOTE: This Hotline includes a requirement for photos, refer to the Warranty Information section.

Software – EPS / DAST

Refer to **Programming File Reference Table**

Procedure can be found in **ZM Outlander MUT3 Procedures**

ICE and PHEV are listed separately on this chart – ensure you pick the correct file or you will not be able to complete Automatic Configuration (usually gets stuck at 52% and wont finish).

Parts Information

	Model	Part Name	Part Number		Quantity
			New	Old	
Up to and including 24MY	Outlander Outlander PHEV	GEAR & LINK ASSY-PS	48002W120P	49001W060P 49001W140P	1
25MY and onwards up to c/measure	Outlander Outlander PHEV	GEAR & LINK ASSY-PS	48002W140P	48002W040P	1
All		NUT,STEERING GEAR	AX000233		2 (non reusable part)
		WASHER,STEERING GEAR	AX000220		2 (non reusable part)
		NUT,STEERING GEAR	AX000270		3 (non reusable part)

*NOTE: Parts information will not be updated, refer to ASA-CAPS for the latest part number information.

Disclaimer: The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer internal use only. It must not be provided or supplied to third parties.
Copyright © Mitsubishi Motors Australia Limited

Hotline Fix – ZM37-001

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.

Printed versions of this document may be out of date, check the online version.

Warranty Information

Claim Details		
Claim Type	Warranty	
Position Code	374110	
Complaint Code	8M	
Circumstance Code	As Advised by Customer	
Diagnosis Code	5A	
Claim Items		
Main Labour Operation	Outlander	Outlander PHEV
Replacement and confirmation (Multi Around Monitor display)	374110CV	374110CX
Replacement, confirmation (Multi Around Monitor display) and Calibration (Multi Around Monitor) – **PHOTO REQUIRED SEE NOTE***	374110CW	374110CY
Labour Qty	1	
Labour Time	As per LOTS time	
Miscellaneous Parts - Causal Part -	49001W140P	
Dealer Quantity	1	

This repair has PHOTO requirements. *

*NOTE: For claims using labour operations ending CW or CY, a photo is required showing the Multi Around Monitor display before calibration to support the work requirement.
Claims received without a photo in the attachments tab will not be accepted.
Photos will require the Repair Order showing the VIN number to be displayed and be visible in the bottom left hand corner of the photo.
The Repair Order must not block vision of the screen, therefore it is recommended that the photo be taken from far enough back that the screen and VIN are visible without holding the paper in front of the screen itself – example on next page.


NOTE: The warranty labour operation includes all work required to perform the repair. For dealers who require a sublet (third party) to complete the wheel alignment portion of the work, please be advised that the cost of the wheel alignment is included in the main labour operation provided.
No additional costs resulting from subletting any part of the work will be reimbursed.
Sublet handling allowance is not applicable to this repair.
There is no requirement for the Hotline Fix Claim to reflect the use of a sublet repairer for the wheel alignment, however all sublet document requirements are applicable in addition to the dealer responsibility to ensure that third parties comply with the relevant sections of MMAL policy and procedure and are further responsible for quality checking and the workmanship of the third party.


Disclaimer: The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer internal use only. It must not be provided or supplied to third parties.
Copyright © Mitsubishi Motors Australia Limited

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.


⚠ **Printed versions of this document may be out of date, check the online version.**

Example: Multi Around Monitor display requires calibration

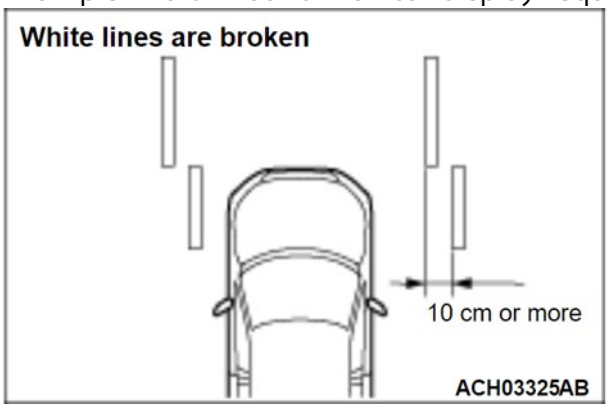

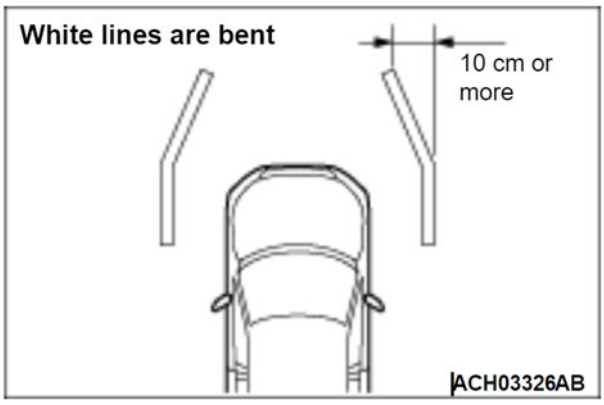

Example: Photo for claim.
Photo clearly shows the VIN and the image.
(Image is of a normal MAM display and is for illustration purposes only.)

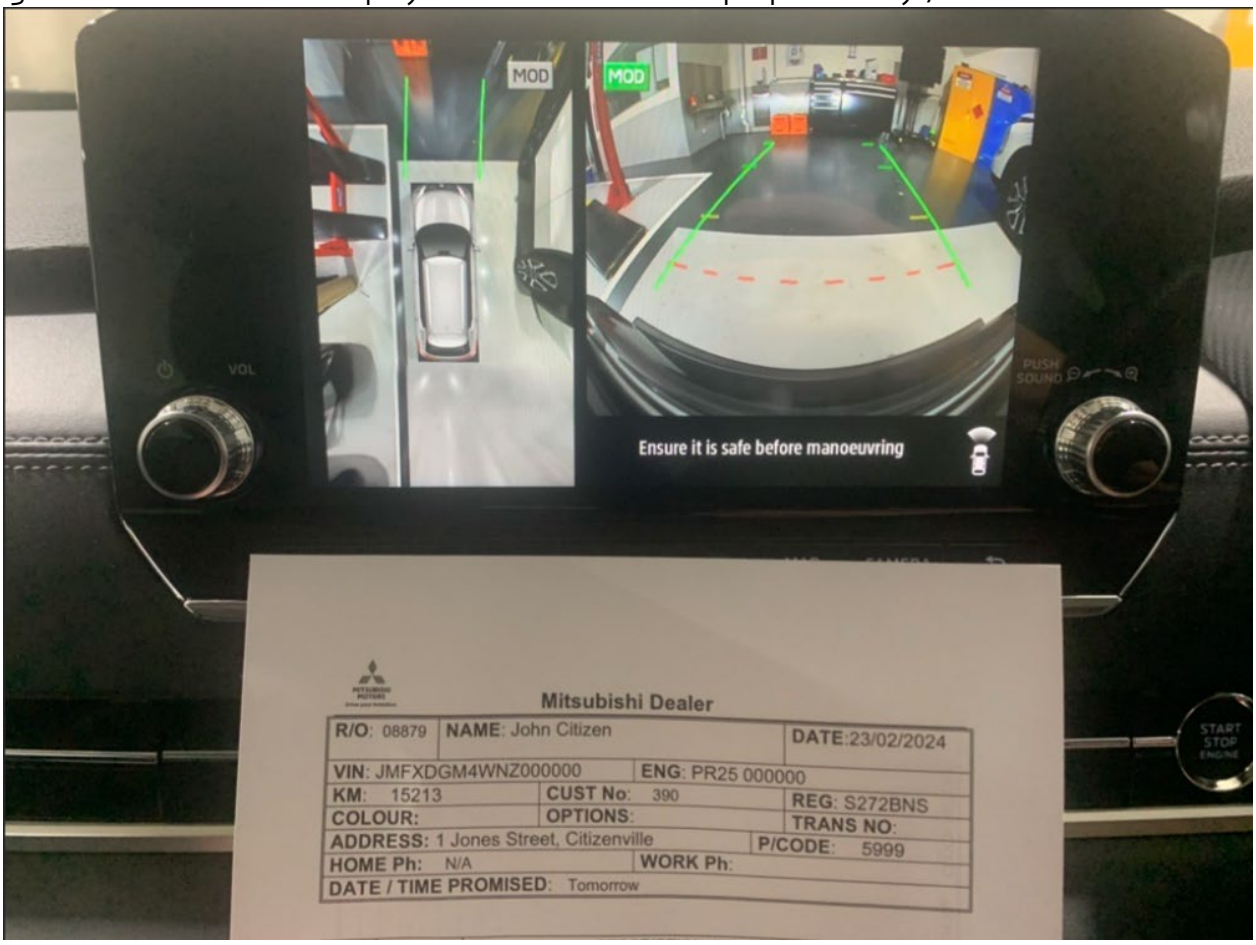

Disclaimer: The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer internal use only. It must not be provided or supplied to third parties.
Copyright © Mitsubishi Motors Australia Limited

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.

Printed versions of this document may be out of date, check the online version.

WHEEL ALIGNMENT

Outlander (Not PHEV)

ITEM			STANDARD
FRONT			
Camber Degree minute (Decimal degree)		Minimum	−1° 15′ (−1.25°)
		Nominal	−0° 30′ (−0.5°)
		Maximum	0° 15′ (0.25°)
		Left and right difference*1	[−0°33′ (−0.55°)] - [0° 33′ (0.55°)]
Caster Degree minute (Decimal degree)		Minimum	4° 58′ (4.97°)
		Nominal	5° 43′ (5.72°)
		Maximum	6° 28′ (6.47°)
		Left and right difference*1	[−0° 30′ (−0.50°)] - [0° 30′ (0.50°)]
Kingpin inclination Degree minute (Decimal degree)		Minimum	10° 42′ (10.70°)
		Nominal	11° 27′ (11.45°)
		Maximum	12° 12′ (12.20°)
Toe-in	Total toe-in Distance	Minimum	In −0.8 mm (In −0.03 in)
		Nominal	In 1.7 mm (In 0.07 in)
		Maximum	In 4.2 mm (In 0.17 in)
	Total toe-angle Degree minute Decimal degree)	Minimum	In 0° 4′ (In 0.07°)
		Nominal	In 0° 8′ (In 0.13°)
		Maximum	In 0° 12′ (In 0.20°)

Measure value under unladen*2 conditions.
***1: A difference when assuming the left side as standard.**
***2: Fuel, engine coolant and lubricant are full. Spare tire, jack, hand tools and mats are in designated positions.**

Disclaimer: The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer internal use only. It must not be provided or supplied to third parties.
Copyright © Mitsubishi Motors Australia Limited

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.

Printed versions of this document may be out of date, check the online version.

WHEEL ALIGNMENT (Continued)

Outlander PHEV

ITEM		STANDARD
FRONT		
Camber Degree minute (Decimal degree)		−0°30′ ± 0°50' (−0.5° ± 0.83°) [0°33' (0.55°) or less]*1
Caster Degree minute (Decimal degree)		5°40′ ± 0°54' (5.67° ± 0.9°) [0°30′ (0.50°) or less]*1
Kingpin inclination Degree minute (Decimal degree)		11°22′ ± 0°45' (11.37° ± 0.75°)
Toe-in	Total toe-in Distance	2.2 ± 2.5 mm (0.09 ± 0.1 in)
	Total toe-angle Degree minute Decimal degree)	0°10′ ± 0°12' (0.17° ± 0.2°)
Sideslip (per 1 m)		5 mm [In] – 5 mm [Out] (0.2 in [In] – 0.2 in [Out])

Measure value under unladen*2 conditions.
***1: A difference when assuming the left side as standard.**
***2: Fuel, engine coolant and lubricant are full. Spare tire, jack, hand tools and mats are in designated positions.**

Disclaimer: The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer internal use only. It must not be provided or supplied to third parties.
Copyright © Mitsubishi Motors Australia Limited