Hotline Fix – ZM55-006

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.

Printed versions of this document may be out of date, check the online version.

Subject

A/C Output temperature rises after brake application

Issued

17/11/2025

Previous Versions

13/09/2024

Group

55 – HVAC

MMAL Reference

TSL2408040

Applicable Vehicles

ZM Outlander Petrol with PR25 engine MY22-MY24

Cut-off date and VIN with applicable A/C auto amplifier:
【27760W027P】: 28/03/2024 / JMFXTGM4WRZ015543
【27760W028P】: 27/03/2024 / JMFXTGM4WRZ015522
【27760W029P】: 27/03/2024 / JMFXTGM4WRZ015509

Phenomenon

After applying the brake, A/C (air conditioner) outlet temperature rises for a short period. (up to 60 seconds)

Cause

Under some circumstances when applying the brake pedal frequently or over long durations, if the measured vacuum in the intake manifold is below the target value, the Engine ECU will signal the IPDM E/R to turn the A/C compressor relay off to reduce engine load and ensure sufficient vacuum is available to provide brake booster assistance.

Once the AC compressor relay is turned back on, the A/C auto amplifier controls the position of the Electric Control Valve (ECV) in the A/C compressor from its start point, to the point at which the compressor discharge capacity returns to normal. This process can cause the A/C outlet temperature in the cabin to rise for a short period until the correct ECV operating position is reached.

Disclaimer: The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer internal use only. It must not be provided or supplied to third parties.
Copyright © Mitsubishi Motors Australia Limited

Hotline Fix – ZM55-006

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.

Printed versions of this document may be out of date, check the online version.

Production Fix

The control program for the A/C Auto Amplifier has been modified to restore compressor capacity earlier in the event the A/C compressor relay is switched off.

Field Fix/Action

On a customer complaint basis, update the control program or replace the A/C Auto Amplifier as indicated by the ECU part number (refer below tables for required action):

ECU part number	Work Required	Associated Main Labour Operation Code
27760W000P,27760W001P,27760W002P 27760W006P,27760W007P,27760W008P 27531W003P,27531W004P 27531W007P,27531W008P	(A) Replace A/C auto amplifier *Replace the A/C auto amplifier according to workshop manual. After replacement, use the MUT-III SE and perform configuration and self-diagnosis of the A/C auto amplifier (as HVAC on the MUT-III SE).	558500TL
27760W018P,27760W019P,27760W020P	(B) Update control program	558500TM

6.Parts Information:

(A) Replacement parts

Model	Part Name	AMPLIFIER Part No.		Quantity	A/C system	Remarks
		<New>	<Old>			
Outlander	AMPLIFIER, HVAC	27760W024P	27760W000P ※1 27760W006P ※2	1	DUAL A/C Without seat heater	Check the part number on the label of the ECU installed in the vehicle and replace it with the corresponding <NEW> part number.
		27760W025P	27760W001P ※3 27760W007P ※4	1	DUAL A/C With seat heater	
		27760W026P	27760W002P ※5 27760W008P ※6	1	TRIPLE A/C	

※1:(ECU P/N: 27760W000P/27531W003P/27531W007P)
※2:(ECU P/N: 27760W006P/27531W003P/27531W007P)
※3:(ECU P/N: 27760W001P/27531W003P/27531W007P)
※4:(ECU P/N: 27760W007P/27531W003P/27531W007P)
※5:(ECU P/N: 27760W002P/27531W004P/27531W008P)
※6:(ECU P/N: 27760W008P/27531W004P/27531W008P)


(Ref. Location of part number on ECU label)

Disclaimer: The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer internal use only. It must not be provided or supplied to third parties.
Copyright © Mitsubishi Motors Australia Limited

Hotline Fix – ZM55-006

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.

Printed versions of this document may be out of date, check the online version.

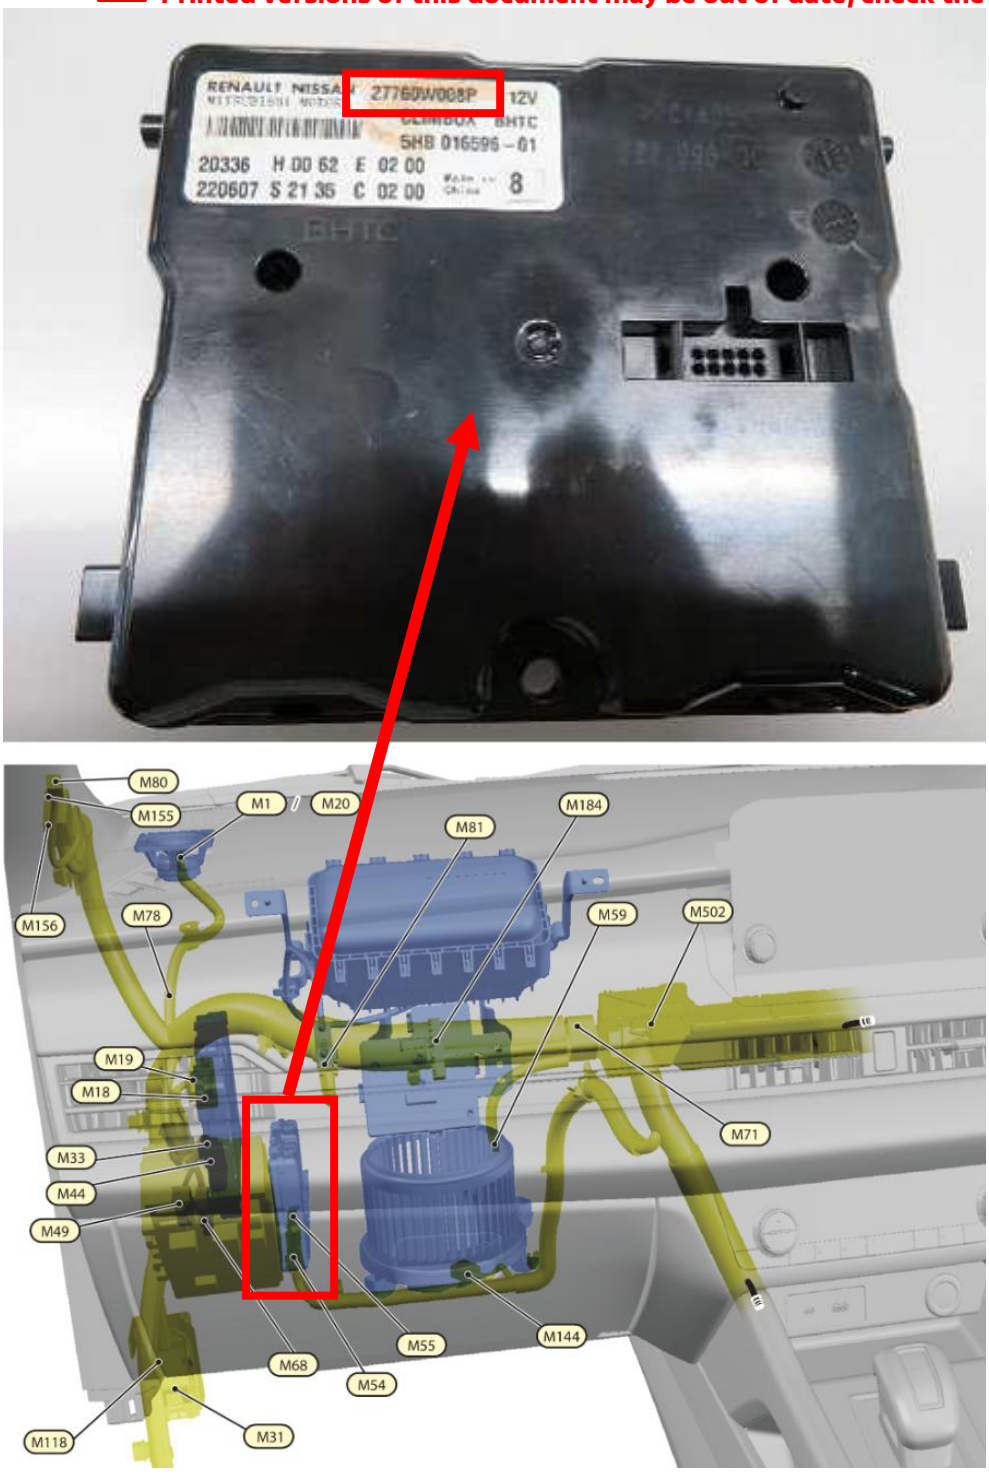

Disclaimer: The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer internal use only. It must not be provided or supplied to third parties.
Copyright © Mitsubishi Motors Australia Limited

Hotline Fix – ZM55-006

Note: This document should be forwarded direct to the Service Manager for action and distribution to all affected staff.

Printed versions of this document may be out of date, check the online version.

(B) Program update

Model	Data No. (PDX File Name)	New HW Part No.	New SW Part No./Ver.	Target HW Part No.	Target ECU Part No.
GM4W	27531W02.3PN	-	27531W023P	-	27760W018P 27760W019P
	27531W02.4PN	-	27531W024P	-	27760W020P

Warranty Information

Claim Details				
Claim Type	Warranty			
Position Code	558500			
Complaint Code	30			
Circumstance Code	As Advised by Customer			
Diagnosis Code	5D			
Claim Items				
Main Labour Operation	558500TM	558500TL		
		Dual A/C W/O Seat Heater	Dual A/C with Seat Heater	Triple A/C
Labour Qty	1	1	1	1
Labour Time	As per LOTS time			
Miscellaneous Parts - Causal Part -	REFLASH			
Spare Part Material – Causal Part -		27760W024P	27760W025P	27760W026P
Dealer Quantity	1	1	1	1

Disclaimer: The fact that a Hotline Fix has been issued does not express or imply that Mitsubishi Motors will apply or has any obligations to apply any product improvement or field fix to a vehicle that is out of warranty.
Please note: The information contained in this document is CONFIDENTIAL and intended for Mitsubishi Dealer internal use only. It must not be provided or supplied to third parties.
Copyright © Mitsubishi Motors Australia Limited