

How To Bleed The Cooling System - Stark VARG MX 1.2

Video link: <https://www.youtube.com/watch?v=iltNWwhdmEQ>

Source video: How To Bleed The Cooling System - Stark VARG MX 1.2 by Stark Future Official

Scope

This guide converts the official Stark Future tutorial video into a step-by-step workshop procedure. It documents each action shown in the video in sequence and pairs every step with a dedicated screenshot.

Preparation

- Place the bike on a stable stand or work area before starting the procedure.
- Prepare the correct tools for the fasteners, clips, brackets, and components shown in the video.
- Keep removed hardware organized in sequence so reassembly follows the same order as the video.
- Have a torque wrench ready for any tightening steps that specify a torque value.

Procedure

1. Unscrew the side plate bolts

Unscrew the side plate bolts.



2. Unscrew the subframe to seat base bolt under the rear fender

Unscrew the subframe to seat base bolt under the rear fender.



3. Unscrew the four front bolts on the side spoilers

Unscrew the four front bolts on the side spoilers.



4. Carefully remove the spoiler assembly by sliding it backwards

Carefully remove the spoiler assembly by sliding it backwards.



5. Remove the four skid plate screws

Remove the four skid plate screws



6. Carefully remove the skid plate from the battery

Carefully remove the skid plate from the battery.



7. Place a container underneath the bike to collect the drained coolant


Place a container underneath the bike to collect the drained coolant.



8. Loosen and remove the coolant drain bolt

Loosen and remove the coolant drain bolt.

Carefully remove and properly dispose of the copper washer.

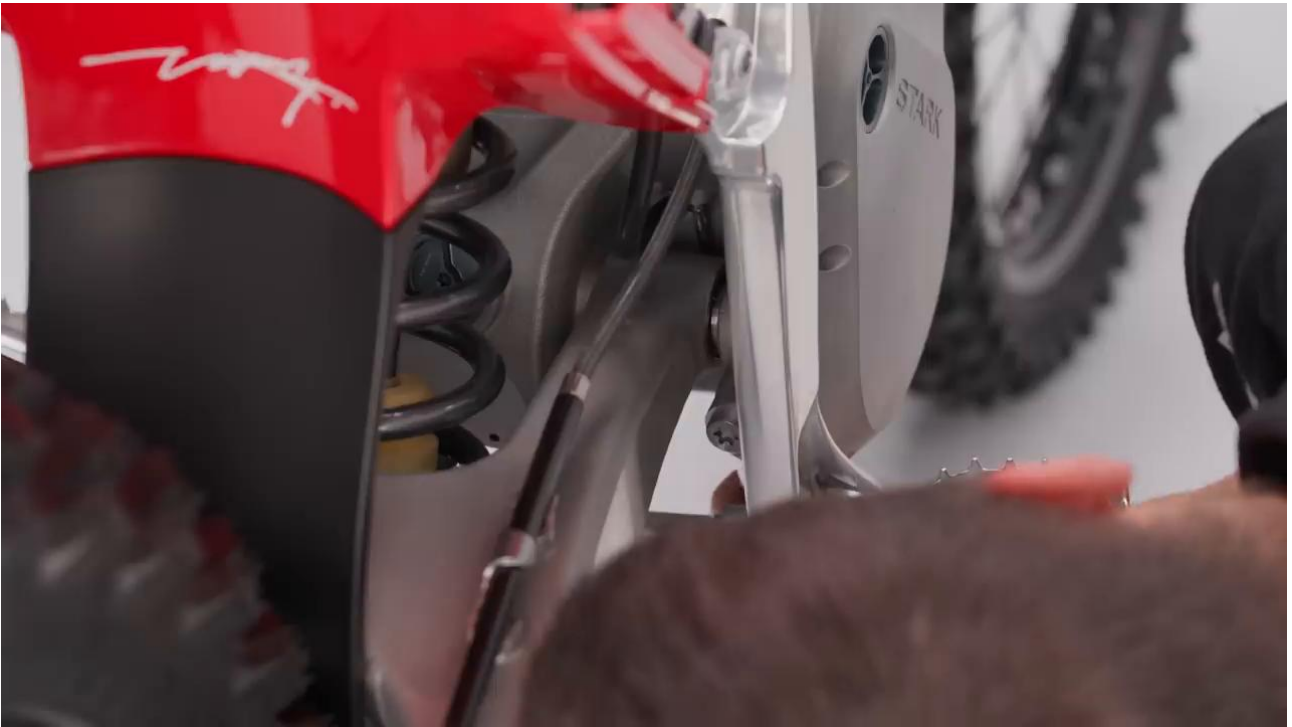

9. Loosen the radiator cap to allow the coolant to drain

Loosen the radiator cap to allow the coolant to drain.



10. Install a new copper washer on the coolant drain bolt, then tighten it to 5 Nm

Install a new copper washer on the coolant drain bolt, then tighten it to **5 Nm**.



11. Fill the cooling system to the top with glycol-based coolant

Fill the cooling system to the top with glycol-based coolant.



12. Switch the bike ON and OFF as needed to allow the water pump to circulate the coolant and purge any air from the system

Switch the bike ON and OFF as needed to allow the water pump to circulate the coolant and purge any air from the system.



13. Tighten the radiator cap to 7 Nm

Tighten the radiator cap to 7 Nm.



14. Place the skid plate into its position

Place the skid plate into its position.



15. Tighten the four skid plate bolts to 15 Nm

Tighten the four skid plate bolts to **15 Nm**.



16. Position the spoiler assembly on top of the bike and slide it forward and downward

Position the spoiler assembly on top of the bike and slide it forward and downward.



17. Tighten the four front bolts to 5 Nm

Tighten the four front bolts to **5 Nm**.



18. Tighten the subframe to seat base bolt to 10 Nm

Tighten the subframe to seat base bolt to **10 Nm**.



19. Tighten the side plate bolts to 20 Nm

Tighten the side plate bolts to **20 Nm**.



Torque Summary

Component	Torque
Install a new copper washer on the coolant drain bolt, then tighten it	5 Nm
Tighten the radiator cap	7 Nm
Tighten the four skid plate bolts	15 Nm
Tighten the four front bolts	5 Nm
Tighten the subframe to seat base bolt	10 Nm
Tighten the side plate bolts	20 Nm

Video-sourced torque items:

- Install a new copper washer on the coolant drain bolt, then tighten it: **5 Nm** from the official Stark tutorial video.
- Tighten the radiator cap: **7 Nm** from the official Stark tutorial video.
- Tighten the four skid plate bolts: **15 Nm** from the official Stark tutorial video.
- Tighten the four front bolts: **5 Nm** from the official Stark tutorial video.
- Tighten the subframe to seat base bolt: **10 Nm** from the official Stark tutorial video.
- Tighten the side plate bolts: **20 Nm** from the official Stark tutorial video.

Critical Checks Before Riding

- Confirm the serviced component is fully seated and all fasteners are tightened in the correct order.
- Recheck all torque-critical hardware before riding.
- Make sure all routed cables, clips, brackets, and surrounding parts are returned to their original positions.
- Inspect the bike visually for any missing hardware before returning it to service.