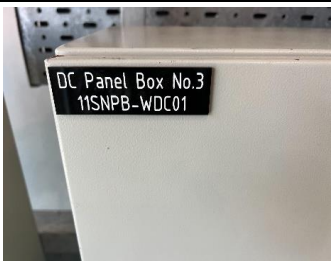


PV Solar System

Report

Customer : RATCH GROUP PCL.
Place : EGAT (Sai Noi Office) /T.0011
Equipment/Device/System : DC Panel Box No.3 / 11SNPB-WDC01

Report by : Energy Conversion and Management Co.,Ltd.
Date : 9-Dec-2024

Item	Photo	Cause	Solution
1	     	The equipment is damaged by heat as listed below. - SPD2 : Surge Protection Device Model:SUP2H1-PV = 1 ea. - CB3 : MCB Model:SL7N-63 = 1 ea. - SPD3 : Surge Protection Device Model:SUP2H1-PV = 1 ea. - CB4 : MCB Model:SL7N-63 = 1 ea. - SPD9 : Surge Protection Device Model:SUP2H1-PV = 1 ea. - CB10 : MCB Model:SL7N-63 = 1 ea. - SPD10 : Surge Protection Device Model:SUP2H1-PV = 1 ea. - CB11 : MCB Model:SL7N-63 = 1 ea. - F12 : Fuse Holder Model:SRD-30 = 1 ea. - Fuse Model:SRF-30 = 1ea. - F13 : Fuse Holder Model:SRD-30 = 1 ea. - Fuse Model:SRF-30 = 1ea.	- Replace equipment as list below - SPD2 : Surge Protection Device Model:SUP2H1-PV = 1 ea. - CB3 : MCB Model:SL7N-63 = 1 ea. - SPD3 : Surge Protection Device Model:SUP2H1-PV = 1 ea. - CB4 : MCB Model:SL7N-63 = 1 ea. - SPD9 : Surge Protection Device Model:SUP2H1-PV = 1 ea. - CB10 : MCB Model:SL7N-63 = 1 ea. - SPD10 : Surge Protection Device Model:SUP2H1-PV = 1 ea. - CB11 : MCB Model:SL7N-63 = 1 ea. - F12 : Fuse Holder Model:SRD-30 = 1 ea. - Fuse Model:SRF-30 = 1ea. - F13 : Fuse Holder Model:SRD-30 = 1 ea. - Fuse Model:SRF-30 = 1ea. - Replace new cable lugs as list below - At SPD2 - At CB3 - At SPD3 - At CB4 - At SPD9 - At CB10 - At SPD10

Item	Photo	Cause	Solution
1			- At CB11 - At F12 - At F13 3. Cable continuous test 4. Cabinet cleaning

☐ Confirm as solution
☐ Confirm as solution with comments
☐ Do as comments

Comments : _____

Inspection by:

RATCH GROUP PCL.