# E350

## U1200, U3300 and U3350

RELEASE NOTES FOR F/W VERSION 6.1

Date: 8/12/2020
Filename: E350 U1200 U3300 and U3350 Release Notes
Public
© Landis+Gyr

## Revision history

| Version | Date | Comments |
|---|---|---|
| 1 | 8/12/2020 | Initial Release |

**Important Information**
This document provides information relating to E350 U1200, U3300 and U3350 meter firmware (the "Product")

Landis & Gyr Pty Ltd (ABN 78 002 894 224) trading as Landis+Gyr.

Copyright ©, Landis+Gyr. All rights reserved. No part of this document may be reproduced, stored in a retrieval system or transmitted in any form or by any means without the prior written permission of Landis+Gyr. Product specifications and operating details are subject to change without notice.

This document is prepared for engineers, installers and technicians by Landis+Gyr in good faith and as far as possible is based on data or sources which are believed to be reliable. Landis+Gyr accepts no liability for errors in this material. Before using any information contained in this document, the user must evaluate and determine if it is suitable for the intended application and shall assume all risks and liabilities associated with such use. Products must be used and installed by a qualified person in accordance with all applicable laws, regulations, industry standards, codes and rules.

Whilst Landis+Gyr has taken all reasonable care in reviewing the information in this document, Landis+Gyr makes no representations in respect of, gives no guarantees or undertakings in relation to, and to the maximum extent permitted by law, excludes all warranties in relation to, the accuracy or completeness of the information in this document. Prospective users of this information should make their own enquiries as to its accuracy and reliability.

All Landis+Gyr products and solutions have been designed and developed for the best possible performance. Functionality of the Product may vary depending on the system environment. You must use solutions and products recommended or approved by Landis+Gyr and are expressly prohibited from modifying, changing or otherwise altering a Product or solution.

Landis+Gyr, its officers, employees, directors, contractors and any representative excludes all liability whatsoever for any loss or damage, however arising out of: (a) the use of non-recommended or approved solutions or the use of a modified, altered or changed Product or Product Solution; or (b) a user's reliance, in whole or in part on any information in this document.

Any brand or product names mentioned in this manual may be trademarks or registered trademarks of their respective owners used here for identification only. Information on third party products are provided for information purposes. Landis+Gyr does not accept any liability for change, accuracy and completeness of this material provided for third party products.

**Support**

For any further product questions and support, please contact sales.au@landisgyr.com or alternatively call 1 300 252 634. For international callers, contact number is +61 2 9690 7333.

**Landis+Gyr**
Australia
+61 2 9690 7333
sales.au@landisgyr.com
www.landisgyr.com

# Table of contents

**1 About this document ..... 4**
1.1 Purpose & Scope ..... 4
1.2 Definitions, Acronyms, and Abbreviations ..... 4
1.3 References ..... 4
**2 About the release, compatible products, and Summary ..... 5**
2.1 New Features for Supported Meters ..... 6
2.1.1 General New Features ..... 6
2.1.2 Firmware Upgrade ..... 6
2.1.3 Firmware Downgrade ..... 6
2.1.4 Last SSN Antenna Switch Request Display Item. ..... 6
2.1.5 Tamper Event Grace Period. ..... 6
2.1.6 Smart Time Synchronisation improvement when using SSN/Itron Modules. ..... 7
2.1.7 Firmware Revision and Firmware Build Number Display Items. ..... 7
2.2 Command Center ..... 7
2.3 Bug fixes in this release ..... 7
2.4 Known Issues in this release ..... 8

 © Landis+Gyr

# 1 About this document

## 1.1 Purpose & Scope

The purpose of this ***6.1 Firmware Release Note*** is to communicate new features, limitations, and changes in meter functionality.

The 6.1 firmware release is for the E350 U1200, U3300 and U3350 meter.

## 1.2 Definitions, Acronyms, and Abbreviations

| | |
|---|---|
| RSM: | Relay State Machine for the load control relay |
| LC: | Load Control |
| LP: | Load Profile |
| CLC/R: | Controlled Load Contactor or Relay |
| CSM: | Customer Supply Monitoring including Neutral Integrity |
| QoS: | Quality of Supply |
| AMI: | Advanced Metering Infrastructure |
| AD: | Auto Disconnect |
| SCC: | Supply Capacity Control |
| STS: | Smart Time Synchronisation |
| HES: | Head End Systems |
| E350: | Family name of Landis+Gyr modular meter including the types U1200, U1300, U3300, U3400 and U3350 |

## 1.3 References

E350 U1200 User Manual

E350 U3300/U3350 User Manual

EMPWin+ User Manual

# 2 About the release, compatible products, and Summary

This firmware package provides upgrade to the following meter/firmware:

Previously Released firmware version:

- R5.0 (U1200 & U3300)
- R6.0 (U3350)

This Released Version: 6.1

Build Version: 004

| U1200 | | U3300 | | U3350 | |
|---|---|---|---|---|---|
| **Firmware Upgrade*** | **Firmware Downgrade*** | **Firmware Upgrade*** | **Firmware Downgrade*** | **Firmware Upgrade*** | **Firmware Downgrade*** |
| 2.1<br>↓<br>2.5<br>↓<br>2.6<br>↓<br>2.7<br>↓<br>2.8<br>↓<br>2.9<br>↓<br>3.1<br>↓<br>4.0 → 5.0<br>↓<br>4.3 → 5.0<br>↓<br>4.4 → 5.0<br>↓<br>4.8 → 5.0<br>↓<br>5.0 → 6.1 | 6.1<br>↓<br>5.0 | 2.1<br>↓<br>2.5<br>↓<br>2.6<br>↓<br>2.7<br>↓<br>3.1<br>↓<br>4.0 → 5.0<br>↓<br>4.3 → 5.0<br>↓<br>4.4 → 5.0<br>↓<br>4.8 → 5.0<br>↓<br>5.0 → 6.1 | 6.1<br>↓<br>5.0 | 2.7<br>↓<br>2.8<br>↓<br>2.9<br>↓<br>3.1<br>↓<br>4.0 → 5.0<br>↓<br>4.3 → 5.0<br>↓<br>4.4 → 5.0<br>↓<br>4.8 → 5.0<br>↓<br>5.0 → 6.1<br>↓<br>6.0 → 6.1 | 6.1<br>↓<br>6.0<br>↓<br>5.0 |

**Important Note:** *customer will be required to refer to the release notes for the particular firmware version to understand the limitations of the upgrade/downgrade. Please also refer to the intermediary firmware release notes when skipping meter firmware versions.

This firmware has been tested on the following platforms:

- E350 U3350 meters
- E350 U3350 meters
- E350 U3350 meters
- EMPWin+ 4.0.38

---

The FT100 release 5.5 or earlier must not be used with 6.1 meter firmware.

EMPWin+ 4.0 or greater must be used with 6.1 meter firmware.

---


© Landis+Gyr

## 2.1 New Features for Supported Meters

### 2.1.1 General New Features

- The E350 U1200 and U3300 and with 6.1 firmware now supports:
  - Tamper Event Grace Period
  - Smart Time Synchronisation improvement when using SSN/Itron Modules.
  - Last SSN/Itron Antenna Switch Request Display Item
  - The display list now includes **Firmware Revision** and **Firmware Build Number** as separate display items.

- The E350 U3350 and with 6.1 firmware now supports:
  - Tamper Event Grace Period
  - Smart Time Synchronisation improvement when using SSN/Itron Modules.

### 2.1.2 Firmware Upgrade

U1200, U3300 and U3350 Meters can be F/W upgraded from R5.0 to 6.1.
U3350 Meters can be F/W upgraded from 6.0 to 6.1
Note: If the new Tamper Grace period feature is required, then the meter must be fully programmed. However, there is no advantage in enabling Tamper Grace Period in a meter that is already installed in the field with its terminal cover secured in place.

### 2.1.3 Firmware Downgrade

U1200, U3300 and U3350 Meters can be downgraded back from 06.01.004 to R5.0.
U3350 Meters can be downgraded back from 06.01.004 to 6.0.

### 2.1.4 Last SSN Antenna Switch Request Display Item.

The display list for the U1200 and U3300 now includes the Last SSN Antenna Switch Request performed by the FT100.

### 2.1.5 Tamper Event Grace Period. (Licenced Feature)

If the Tamper Event Grace Period is enabled, then after full programming a grace period will be observed when any terminal cover tamper events will be suppressed for the user selected time of 0 to 60 minutes (0 = no Grace period) in Table 25. If the meter is power cycled during the grace period, then the grace period will be suspended during the power down time and will resume on power up. This is accurate to the nearest minute. Table 2131 was added to store the internally used count down value. The Tamper Event Grace Period starts as soon as Full Programming is completed.

Tamper Event Grace Period is a licenced feature. Please contact L+G if you are interested in enabling this feature.

### 2.1.6 Smart Time Synchronisation improvement when using SSN/Itron Modules.

The Smart Time Synchronisation feature will no longer check if an SSN comms module is connected before allowing the Smart Time Synchronisation (STS) feature to be used to slowly adjust a meter's time backwards without stopping Load Profile (by crossing back into a previously completed LP interval). Earlier F/W versions would block the STS method if an SSN module was detected because SSN had their own time adjustment logic.

### 2.1.7 Firmware Revision and Firmware Build Number Display Items.

The display list now includes **Firmware Revision** and **Firmware Build Number** as separate display items.

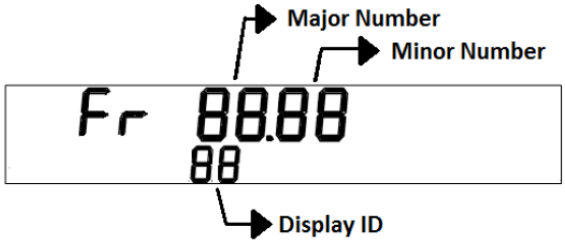


Major and Minor Number

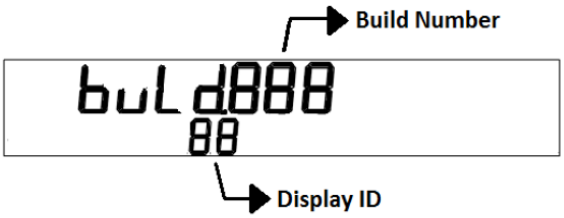


Build Number

## 2.2 Command Center

Command Center (CC) version 7.6 supports 6.1 F/W.

- The 06.01.004 F/W has been tested in Command Center (CC) version 7.6
- The new firmware 06.01.004 can be sent Over the Air (OTA) using CC.
- The 06.01.004 F/W can be downloaded over the air using Cellular comms devices in CC 7.6 using comms F/W 14.19.001.
- Meter will continue to push LP, Billing Reads and Events to CC as 06.01.004.

## 2.3 Bug fixes in this release

| *Item No.* | *Description* |
|---|---|
| **TFS-1052780** | In all previous F/W versions if the test LED was programmed to flash for VARh energy and then the optical port was used to perform long reads then the VARh LED would turn on and stay on making the counting of VARH energy via the LED impossible. If the LED were used for Wh testing it would pulse correctly regardless of the optical port usage. The bug has now been fixed in Firmware 6.1. |
| **Mantis-3163**<br>**TFS 857077** | If there is a long power outage across a Season change date, then the Billing report might incorrectly label the season number as 0. The date logged, and energy/demand values are correct. This is an existing bug from previous firmware versions. The bug has now been fixed in Firmware 6.1. |


© Landis+Gyr

## 2.4 Known Issues in this release

| *Item No.* | *Description* |
|---|---|
| **TFS-1066340** | It has been noticed during Transparent Mode testing with latest L+G E35C comms module and F/W 14.69, the LP reads can fail if the amount of data that needs to be read is large (more than 60 days but varies).<br>New comms F/W 14.70 has been created to improve the reading reliability of Transparent mode reads when using MV90 and large amount of LP data. |