

Windows 10 supported models

SERVICE MANUAL ANNEX

SUBJECT (主題) Procedure for enabling computer "SMBv1" for Windows 10		DATE July 25, 2019
		XMC50*RDA002 XGYC5*RDA/002 GC006-P752 XCV9**RDA002 XUS10*RDA002 XRKT2*RDA002 XRKT3*RDA002 XNT5P*RDA002 XSM1**RDA002 XAL3**RDA002 XAR17ARDA001E XAR18*RDA002 XAR19*RDA002 XLM26*RDA002 31035-P752 34093-P752 LCE10ARDA002 LLE15ARDA002 LLE7D*RDA002 LHU5A*RDA002 LLE19ARDA002 XRK10*RDA002 XMP3**RDA002 XFC11*RDA002 30741-P752 RT015-P752
CATEGORY (指示区分) Information (補足情報) / Standard (標準作業) Priority (優先作業) / Field correction (改修作業)		ORIGINAL DOCUMENT No.
To distributor : When the symptom described in the SERVICE MANUAL ANNEX occurs in the specified products, take actions.		Serial No. SB No.
Region / Country (地域/国) ☒ All regions (全地域) ☐ Japan (日本) ☐ USA ☐ EU ☐ Canada (カナダ) ☐ China (中国) ☐ Singapore (シンガポール) ☐ Brazil (ブラジル) ☐ Other (その他) ()		
PREPARED BY <i>F. Mizuno</i>	REVIEWED BY <i>N. Suzuki</i>	APPROVED BY <i>K. T. Yamamoto</i>
DATE <i>2019.7.25</i>	DATE <i>2019.7.25</i>	DATE <i>2019.7.29</i>

Windows 10 supported models

SERVICE MANUAL ANNEX

Service Manual Annex 10000-AN006E is no longer to be used upon issue of this annex.

Reason for revision:

- The Windows Features screen has been changed.
- “1903” has been added to the Windows 10 version table.

Windows 10 supported models**SERVICE MANUAL ANNEX****[Outline]**

The communication protocol “SMBv1” has not been enabled at initial setup of a computer since Windows 10 major upgrade “Windows 10 Fall Creators Update”.

“SMBv1” is used for communication when data is transferred via LAN connection between Nidek or other companies’ measuring equipment and a computer.

If “SMBv1” is disabled on the computer, a communication error occurs.

This Service Manual Annex provides the procedure for enabling “SMBv1” on the computer.

[Applicable products]

MC-500	AR-1/ARK-1 series
GYC-500	HandyRef/HandyRef-K
YLC-500	LM-1800PD, LM-1800P
CV-9000	LM-7, LM-7P
US-4000	MEM-200
TONOREF II	Ice 900
TONOREF III	Me 1200
NT-500 series	SE-9090 Supra
CEM-530	RHU-2200
AL-Scan	Xtrimmer SE-1
AR-300/ARK-500 series	OPD-Scan III
MP-3	AFC-330
RT-6100	AR-F/ARK-F

* For products placed on the market after this Service Manual Annex is released, refer to each Service Manual.

[Prerequisite conditions]

SMBv1 is enabled as Windows 10 specifications when a computer is turned on for the first time after shipped from its manufacturer.

However, the OS automatically disables SMBv1 if the SMBv1 communication is not performed for a total of 15 days (cumulative total of 360 hours) after the computer is turned on.

SMBv1 can be manually enabled after it becomes disabled. Once it is enabled, it will not become automatically disabled.

Windows 10 supported models

SERVICE MANUAL ANNEX

[Environment requiring setting]

SMBv1 will be disabled if the SMBv1 communication is not performed for a total of 15 days (cumulative total of 360 hours) after the computer is turned on. Therefore, setting is required.

Ex.)

- When terminal A that has been used to import the data of the measuring equipment is changed to terminal B that has not been used to import data.
- When the terminal was used to import the data of the measuring equipment communicated by the communication protocol SMBv2 or later and is now used to import the data of the measuring equipment communicated by the communication protocol SMBv1.

Also, even if SMBv1 is enabled by using the OS of the computer terminal with "Windows 10 Fall Creators Update", resetting is required because SMBv1 is disabled when the OS is upgraded to "Windows 10 April 2018 Update" or later.


[Note for setting]

Depending on the policy of the user's facility, the SMBv1 communication may not be permitted. Be sure to inform the user that setting is required before performing tasks.

The computer needs to be restarted for the procedure. Work in a time zone that does not interfere with the user's work (working time approx. 15 minutes).

[Procedure]


1. Log in to the Windows 10 terminal and close all currently running applications.
2. Click the magnifying glass icon on the lower left of the desktop.

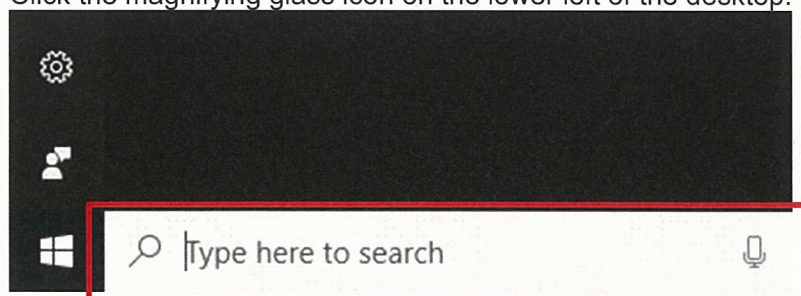

Windows 10 supported models

SERVICE MANUAL ANNEX


3. Type "con" using the keyboard to display the Control Panel, then click it.

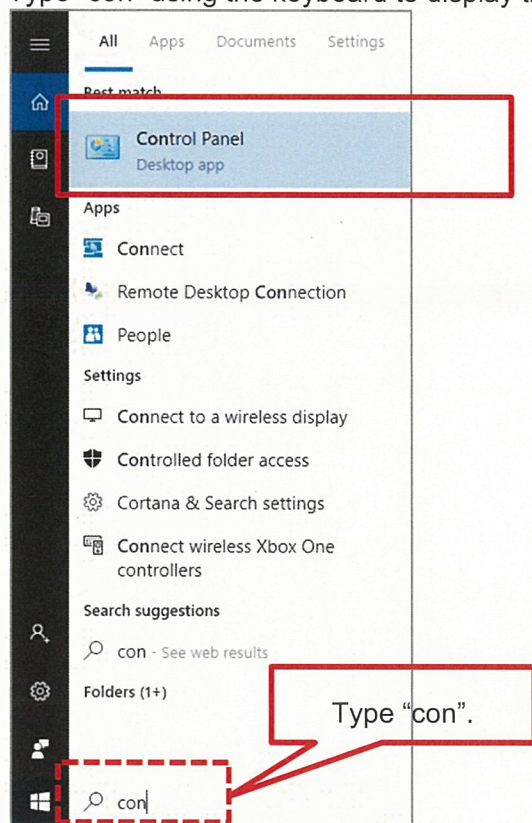


Windows 10 supported models

SERVICE MANUAL ANNEX

4. The Control Panel will appear. Click [Programs and Features].

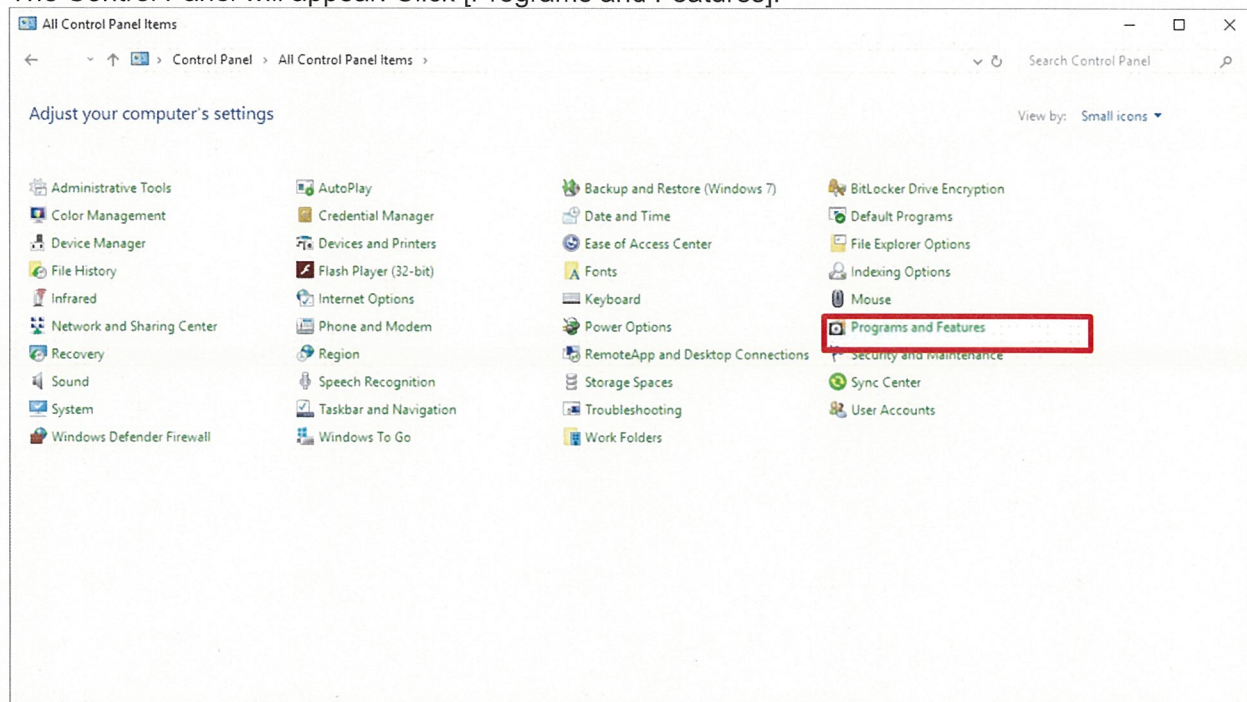

5. Click [Turn Windows features on or off] on the left.

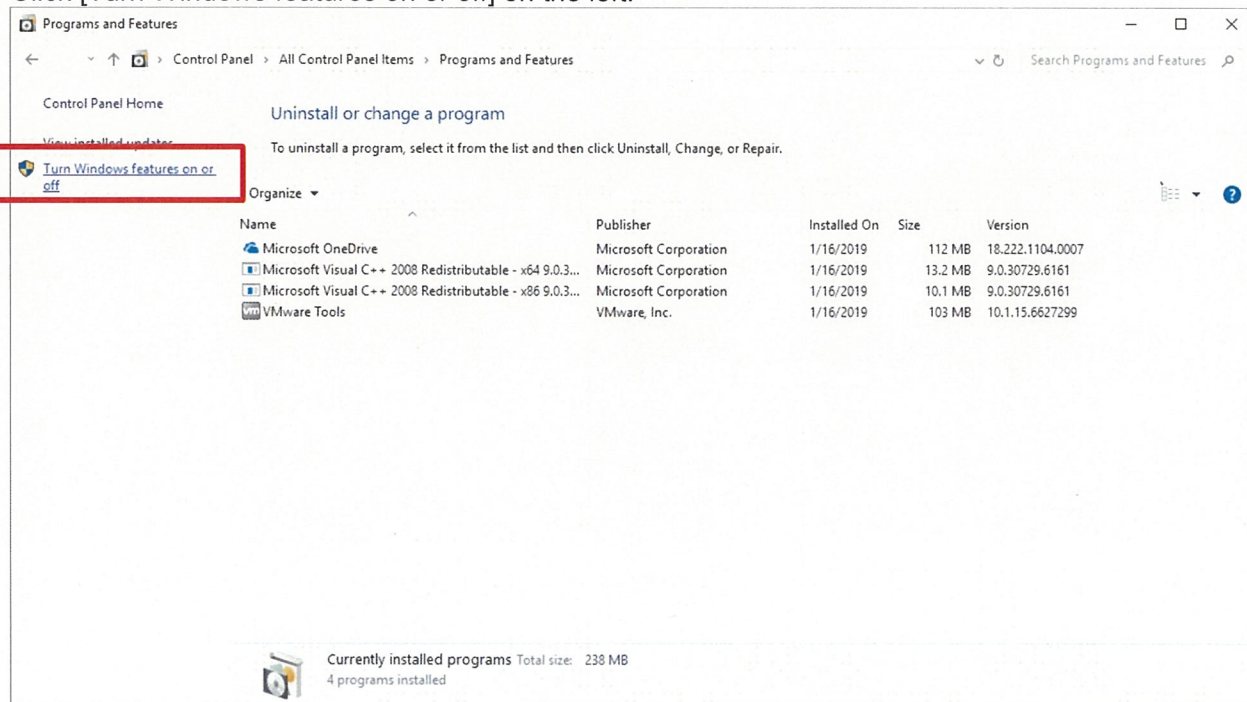

Windows 10 supported models


SERVICE MANUAL ANNEX

6. Find [SMB 1.0/CIFS File Sharing Support]. There are two patterns for the screen as shown below.

When [+] is on the left of the character


Click [+] and check [SMB 1.0/CIFS Client] only.

Cancel the selection if other SMB boxes are selected, then click [OK].

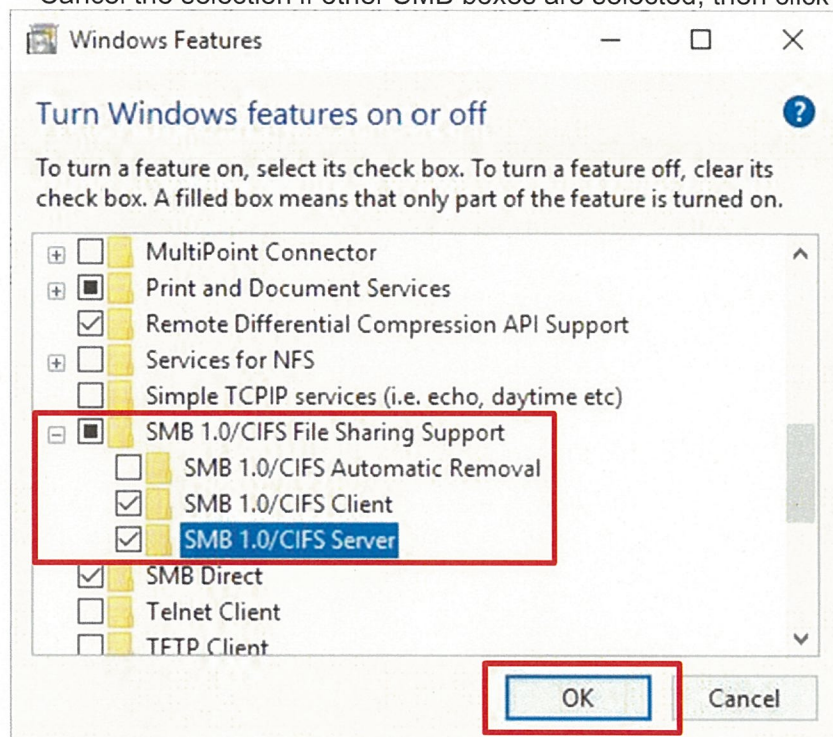

When [+] is not on the left of the character


Check [SMB 1.0/CIFS File Sharing Support], then click [OK].

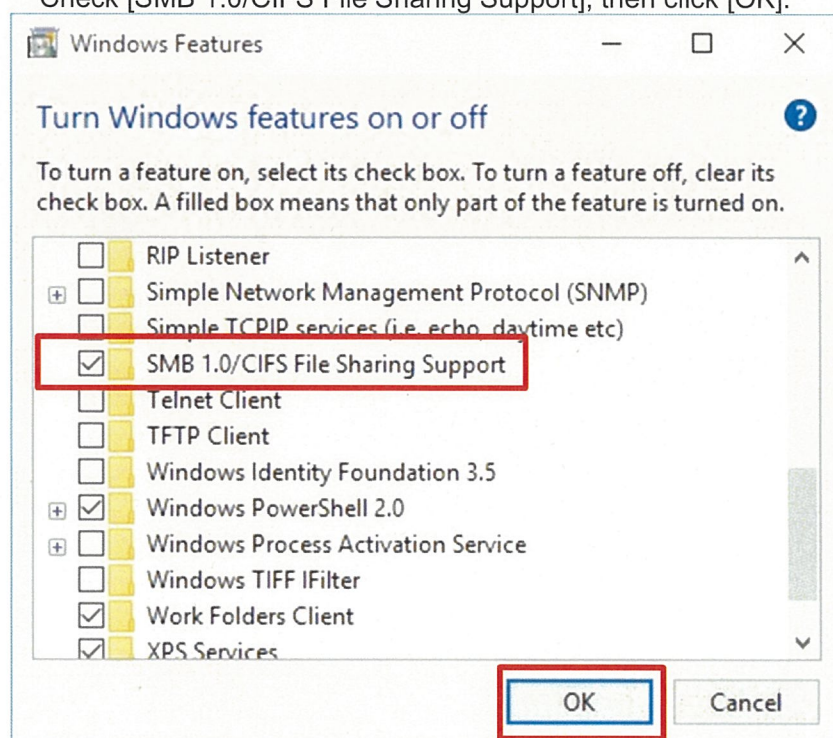

Windows 10 supported models


SERVICE MANUAL ANNEX

7. The SMB installation is complete. The screen shown below appears. Click [Restart now].

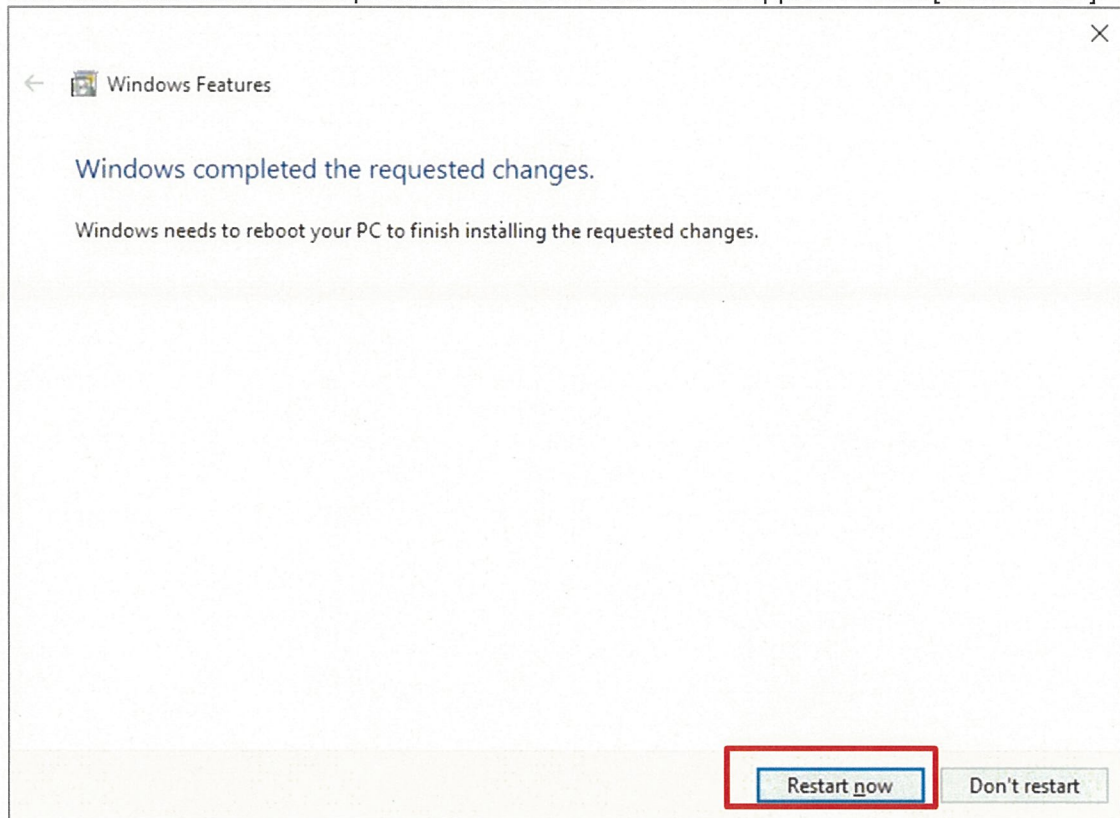

8. Log in again and start the computer in the same manner as above in the order of [Control Panel] -> [Program and Features] -> [Turn Windows features on or off].

Check that the SMB1.0 setting is properly reflected, then click [OK].

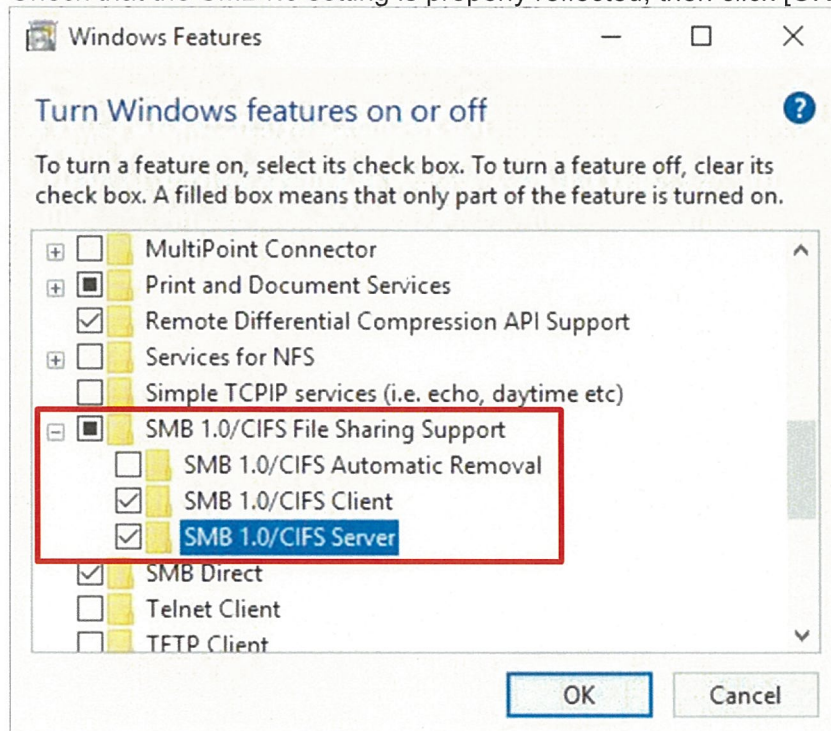

Windows 10 supported models

SERVICE MANUAL ANNEX


9. Close all windows and check whether data communication with the measuring equipment can be properly performed. The procedure is complete.

[Reference]

How to check Windows 10 version

Press the [Windows] key and [R] key simultaneously to open the Run window.

Type "winver", then click [OK].

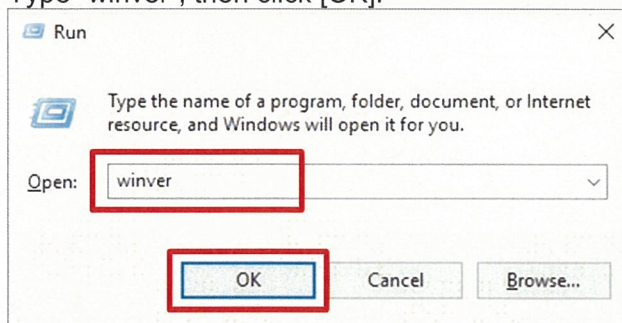

The number after "Version" indicates the OS version. Click [OK] to close the window.



Windows 10 version table

Version	Name
1511	Windows 10 November Update
1607	Windows 10 Anniversary Update
1703	Windows 10 Creators Update
1709	Windows 10 Fall Creators Update
1803	Windows 10 April 2018 Update
1809	Windows 10 October 2018 Update
1903	Windows 10 May 2019 Update