

GIZMO Ground-Reference Monitoring Operations Guide

Connection, commissioning, and monitoring during construction and operation
DUNE Far Detector

Manuel Arroyave

Full guide: installation, contractor coordination, and operation

Public review update of October 5, 2026

This guide explains how the deployed Kria GIZMO is connected, checked, and used during construction. It is for the contractor work lead, FNAL I&I/GIZMO, the electrical lead, and the Slow Controls/Detector Protection System (SC/DPS) team.

Use it with the current SOP004, grounding drawings, rack Operational Readiness Clearance (ORC), and work plan. Those documents set the electrical work controls, including lockout/tagout (LOTO). This is a public review draft. Section 13 records the deployed instrument settings and identifies the work-plan details to complete before field use.

STOP / SAFETY: Keep the required safety-ground path intact. Only authorized electrical personnel may change grounding connections. Never lift a safety ground to clear a GIZMO alarm.

Contents

1	Grounding and measurement: the terms used here	3
1.1	Why the metal structure must stay grounded	3
1.2	Why GIZMO tests must be repeated	3
2	How the measurement works	4
3	Who does what	5
4	Working with the contractor	5
4.1	Agree the work and test windows	5
4.2	At shift start and handover	6
4.3	During a FNAL test window	6
4.4	Before the contractor resumes work	6
5	Before installation or a connection change	6
6	Connection sequence	7
6.1	Independent connection verification	8
7	Power-up	8
8	Commissioning and baseline	9
8.1	Measurements to make	9

8.2	Frequency and threshold	9
9	Routine monitoring	9
9.1	What the operator needs on the display	10
9.2	What to record	10
10	Welding and other planned bonds	10
10.1	Before work	10
10.2	During work	10
10.3	After work	11
11	What the conditions mean and what to do	11
11.1	When remote measurements are unavailable	12
11.2	Finding an unwanted connection	12
12	Shutdown and maintenance	12
13	Site settings and responsibilities	13
13.1	Recorded instrument configuration	13
13.2	Work-plan details to complete	14
14	Shift record	14
A	Instrument and controls reference	15
A.1	Reading the data	15
A.2	Rates and storage	15
A.3	Backup and recovery	16
B	ZedBoard spare reference	16
C	Source documents	17

1 Grounding and measurement: the terms used here

Detector Ground The cryostat steel vessel and the metal structures bonded to it. It is the electrical reference for detector electronics.

Building Ground The bonded cavern and building infrastructure, including the protective grounding used by conventional electrical equipment.

Bond A deliberate electrical connection between metal parts. The *construction bond* is the Building Ground connection required while the contractor works on the cryostat and beam structure.

Safety-ground path The connection designed to carry fault current so electrical protection can operate. The detector arrangement includes an approved saturable-inductor assembly. Its inductance limits small AC noise currents; under a large fault current, saturation reduces its impedance. The released drawing defines the complete protective path.

Isolation The absence of unwanted connections between Detector Ground and Building Ground, while the approved safety-ground path remains intact.

Impedance Opposition to AC current at a stated frequency. GIZMO uses an AC measurement to detect changes in resistive connections and capacitive coupling between the grounds.

Baseline The accepted measurement for a known grounding arrangement, frequency, and calibration. Compare results only when those conditions match.

Handback The point at which testing is finished, the required work grounding is restored and verified, and the contractor lead is told that the area is released for work.

1.1 Why the metal structure must stay grounded

Friction during material handling, moving belts, or dust flow can generate static charge. An isolated metal structure can retain that charge until it discharges through a person or electronics. Grounding drains the charge and reduces the risk of electrostatic discharge (ESD).

There is also a separate electrical hazard: a damaged powered tool or cable can energize the structure. The safety-ground path must carry the resulting fault current so protective devices can operate. A connection that drains static charge is not, by that fact alone, adequate fault protection.

Keep the required Building Ground bond connected during contractor work. Corrosion, loose clamps, and damaged conductors can weaken that connection, so inspect and verify it at shift start and handover.

1.2 Why GIZMO tests must be repeated

Construction changes the electrical arrangement. Cables, scaffolding, temporary leads, piping, and new metalwork can introduce unwanted connections or change capacitance. These changes can affect detector noise performance and become harder to find after later work covers the area.

Repeat the GIZMO tests at agreed intervals and after work that could change the arrangement. A safety-bond check verifies the required protective connection. A GIZMO isolation test looks for unwanted paths and changes in coupling. One does not replace the other.

2 How the measurement works

GIZMO injects a small AC signal between the two grounds. A Pearson current transformer (CT) measures the portion returning through the intended safety-ground conductor. Another conductive path can divert current around that route and change the reported impedance.

The reading does not locate the connection. Its meaning depends on the actual grounding arrangement. The figure shows the measurement principle; use the released drawing for installation and connection changes.

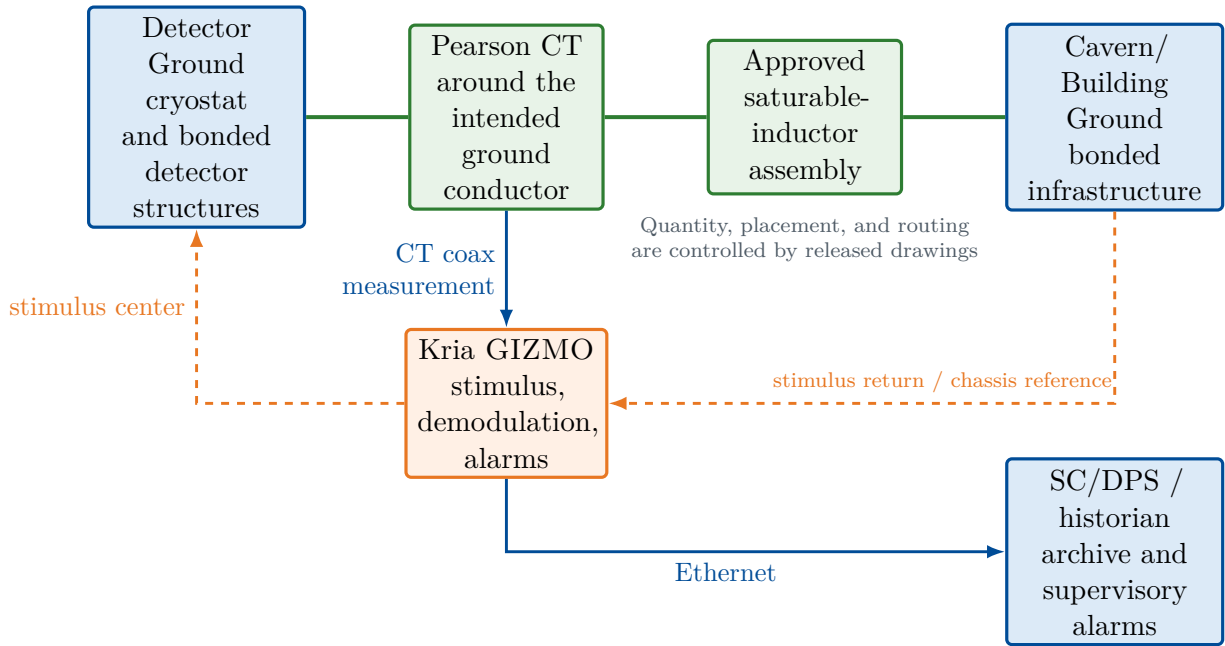


Figure 1: Conceptual measurement topology. The CT must observe the intended return path; any parallel detector-to-infrastructure connection changes the measured signal.

The planned initial installation uses one saturable inductor. Verify its protection, CT routing, and connection between Detector Ground and Cavern/Building Ground against the released installation drawing. The required construction bond and permitted grounding connections are defined by that drawing; the conceptual figure does not authorize changing those connections.

3 Who does what

Role	Responsibility
Contractor work lead	Describes the planned work and recent changes, arranges shift bond checks, clears the agreed test area, and acknowledges handback.
Electrical lead	Controls grounding work and connection changes. Assigns authorized electrical personnel to verify the safety path, establish the test arrangement, and verify restoration.
FNAL I&I/GIZMO	Takes and interprets GIZMO measurements, checks the instrument and dashboard, runs isolation tests, provides local fallback measurements, and records results.
Activity coordinator	Agrees work and test windows with the contractor and FNAL, tracks the work package, and coordinates release of the area.
SC/DPS team	Maintains the controls connection, display, timestamps, history, and alarms for missing or invalid data.
Facility support	Maintains the instrument and mine-network support needed for remote measurements and the approved local alternative.

Name the people filling these roles for each shift. The contractor’s bond checker must be trained for the specified method. GIZMO readings, calibration, and settings remain with FNAL I&I/GIZMO.

4 Working with the contractor

4.1 Agree the work and test windows

Before the shift, the contractor lead, electrical lead, activity coordinator, and FNAL I&I/GIZMO agree what work is planned, which bonds must be connected, and when FNAL can test. Set recurring windows before, after, or between shifts. Add a test after work that could change grounding or coupling, and before new work covers an area that may need inspection.

The work plan must state the test interval, settling time, limits, named contacts, and response to a failed or missed test. Record the next test time. These values depend on the installation and must be assigned by the responsible site leads.

Arrangement	What the reading can tell you
Contractor work	The required Building Ground bond is connected and verified. A low reading or active alarm may be expected, and that bond can hide a second unwanted connection.
FNAL isolation test	Authorized personnel set the approved grounding arrangement and tagout status while keeping the permanent safety path intact. FNAL compares the result with the baseline for this arrangement.
Welding or another planned bond	The added connection may change the reading. Record which bonds are present and use the welding procedure in Section 10 .

The grounding connections must be identified by their function in the released drawing. This guide does not assume which connection may be opened. If the safe test arrangement is unclear, resolve it with the electrical lead before changing connections.

4.2 At shift start and handover

1. The contractor lead arranges an inspection of the accessible grounding cables, clamps, and connections. Report damage, looseness, corrosion, or paint obstructing contact.
2. The designated checker verifies the required Building Ground bond using the specified instrument, test points, method, and acceptance limit. Never use resistance mode on an energized circuit. A continuity beep alone is not a pass.
3. Confirm the grounding connections and tagout status against the work plan. Report any mismatch to the electrical lead.
4. Tell FNAL what changed since the previous test: new metalwork, cables, temporary bonds, welding returns, or moved equipment. Confirm the next test window.
5. Record the checker, time, bond result, grounding arrangement, and open issues in Procore Daily Log > GIZMO.

4.3 During a FNAL test window

1. The contractor lead confirms that the agreed area is available and affected work is paused. Clear tools and cords that could bridge the grounds during the test.
2. Authorized electrical personnel establish and record the grounding arrangement and tagout status. The permanent safety path, including the approved inductor assembly, stays effective throughout the test.
3. FNAL waits the specified settling time, then checks data age, quality, calibration, frequency, and alarm status. Record resistance or HIGH Z, valid capacitance, and coupling diagnostics. Compare with the limits and the previous test under the same conditions.
4. If the result is unexpected, FNAL and the electrical lead investigate with the contractor lead. Start with the work done since the last good test. Record the finding and retest after correction.

4.4 Before the contractor resumes work

Restore the required Building Ground connection and have it verified by the electrical lead's designated person. Complete tagout closeout, record the FNAL test result, and obtain release from the person named in the work plan. The contractor lead acknowledges the restored arrangement and the next test time before work resumes.

A failed or missed isolation test needs a recorded decision from the responsible lead under the work plan; it cannot be entered as a pass. A safety-ground defect must be corrected and verified before affected work restarts. Use [Section 11](#) when the grounding or measurement is uncertain.

5 Before installation or a connection change

Use this check after installation or a change to the rack, grounding, CT, inductor, stimulus connection, or firmware.

1. Check the current SOP004, work plan, grounding drawing, cable schedule, CT orientation, inductor/protection drawing, and rack ORC. Record the equipment and configuration identifiers in [Section 13](#).

2. Identify and label Detector Ground, Building Ground, the conductor through the CT, both sides of the inductor, and the stimulus and return points. Follow the drawing and text labels; wire color alone does not establish a connection's function.
3. With the circuits in the safe state specified by the work plan, inspect enclosures, connectors, strain relief, and conductor clearances. Verify the rack and chassis bonds and the detector safety-ground path.
4. Check that the CT surrounds the intended conductor and that any parallel construction or welding bond is documented. Check tools, temporary leads, shields, pipes, and jumpers against the declared arrangement.
5. Check that the beacon is visible and the audible alarm is suitable for the work area.

Do not energize or inject the test signal if a conductor is unidentified, a required bond is missing or unverified, the installation differs from the drawing, or the software/configuration cannot be identified. Resolve the discrepancy with the electrical lead and FNAL before proceeding.

Post a short reference on the rack door with the rack and ORC identifiers, labeled ground points, expected alarm indications, current contacts, and a link to the work procedure and Procore log. Include the safety-ground instruction from the first page.

6 Connection sequence

Make these connections with the equipment de-energized. Verify the GIZMO power-supply connections against the site electrical procedure. Authorized electrical personnel handle fixed grounding conductors and protection devices.

1. **Safety-ground assembly.** The authorized electrical worker installs or verifies the approved Detector Ground–CT–saturable-inductor/protection–Cavern/Building Ground path. Do not open this path as part of routine GIZMO work.
2. **CT signal.** Connect the approved coaxial cable from the Pearson CT output to the GIZMO connector designated CT INPUT. Verify both endpoint labels and cable ID.
3. **Stimulus.** Connect the stimulus output using the approved custom cable:
 - the center conductor goes to the designated Detector Ground-side injection point;
 - the outer conductor/return is bonded to the designated rack or Cavern/Building Ground point.

Do not improvise this cable or move the injection point without repeating characterization.

4. **Alarm outputs.** Connect the warning beacon and audible alarm to the labeled GIZMO outputs. Do not use an alarm-power connector as a general auxiliary supply.
5. **Network.** Connect the Kria GIZMO Ethernet port to the assigned detector controls network switch port.
6. **DC power.** Connect the approved NRTL-listed AC/DC converter to the Kria chassis. Verify supply voltage and current rating against the installed chassis label before connection.

7. **AC input.** Connect the GIZMO power supply to the assigned AC supply point using the approved cable. Verify the required protective-earth connections before energizing.

Work that changes or temporarily bypasses the safety-ground conductor needs a separate electrical procedure. The sequence above does not cover that operation.

6.1 Independent connection verification

Before power-up, have a second qualified person check each connection against the drawing and record initials:

Connection	Installed by	Verified by
CT output → GIZMO CT input		
Stimulus center → approved Detector Ground-side point		
Stimulus return/chassis → approved Cavern/Building Ground		
Beacon and audible alarm outputs		
Kria network connection		
GIZMO DC supply rating, cable, and AC supply point		
Safety path and CT routing match released drawing		

7 Power-up

Before applying power, confirm that the connection check is signed, the actual grounding arrangement is recorded, and the software, configuration, and calibration match the site record. Have storage and the required remote copies of the data ready. Keep the stimulus disabled until the electrical lead authorizes it.

1. Energize the installed GIZMO power supply as specified in the site procedure. Check the normal power indications. Stop and de-energize safely if there is abnormal heat, sound, odor, or smoke.
2. Wait the specified boot time. Check that `gizmo.target` and its required services are healthy, and record the runtime and model versions.
3. From the controls host, connect to the assigned OPC UA endpoint and verify the device identity and certificate. Check that source timestamps advance, the clock is correct, and data age is within the site limit.
4. Confirm the waveform, frequency, amplitude limit, and calibration. Use the site startup procedure to start acquisition and enable the stimulus when the electrical lead authorizes it.
5. Check that measurements and alarm status have Good quality, sequences advance, and the historian is writing data. Check that required remote copies are receiving updates.
6. Compare the reading and alarm with the baseline for the actual grounding arrangement. A reading taken with the construction bond connected must be compared with that state, not with the isolation-test baseline.

The instrument is ready when these checks pass. Release of the contractor's work area is a separate step, described in Section 4. The site record must supply the exact startup, stimulus-control, and recovery

commands; the public software interface alone does not define the field sequence.

8 Commissioning and baseline

Commissioning establishes the response of the installed cryostat, safety path, CT, stimulus cable, and instrument. Keep the resulting baseline with its grounding arrangement, frequency, and calibration so later readings can be compared with it.

8.1 Measurements to make

Use the test fixture and electrical controls specified in the commissioning plan. Measure:

- the reference response and its normal variation;
- known resistances spanning the isolation and alarm conditions;
- known capacitances representative of the installation;
- response over the permitted frequency range;
- response with representative construction equipment on and off;
- operation of the beacon, audible alarm, controls alarm, and event logging.

A reference or “open” measurement is a test-fixture condition; it does not instruct anyone to disconnect the permanent safety ground.

8.2 Frequency and threshold

Choose a frequency that avoids installation resonances and strong equipment-noise lines, separates the reference response from known shorts, and gives stable measurements within the permitted stimulus and touch-voltage limits. Record the scan, chosen frequency, waveform, amplitude, uncertainty, calibration identifier, and approver.

Confirm the operating frequency against the configuration and calibration recorded in Section 13. A different frequency, stimulus amplitude, CT, cable route, inductor, or major bonding change needs review and may require a new baseline.

Set the alarm threshold from these measurements. Document the separation from normal variation and the margin for the highest-resistance unwanted connection that must be detected. A threshold change is an engineering decision; it is not a way to clear an unexplained alarm.

9 Routine monitoring

FNAL I&I/GIZMO checks the instrument at shift start and handover. Exchange the results with the contractor lead and review the contractor checks in Section 4.

1. Confirm that the work record matches the bonds and activities actually present, and that the next test window is agreed.
2. Check source time, data age, quality, alarm, and range. Interpret the result using Section 11.
3. Compare the frequency, calibration, threshold, and configuration with the shift reference.

4. Review the previous 12 hours for changes, drift, gaps, or work windows that were not closed.
5. Check the historian, storage space, remote copies, and archive status. Record the result and any action needed in Procore Daily Log > GIZMO.

9.1 What the operator needs on the display

Show the reading or HIGH Z, alarm and reason, source time, data age, quality, and recent trend together. Make the frequency, threshold, calibration/configuration identifiers, and instrument/network status accessible. FNAL should also be able to inspect the in-phase and quadrature (I/Q) signals used to calculate the result.

Show the actual work and bond arrangement alongside the measurements, with the person or system that supplied it and the time it was recorded. GIZMO does not know which contractor is working or whether a bond was authorized. Appendix A lists the instrument fields and the information supplied by other systems.

9.2 What to record

Use Procore for the human record: shift checks, changes in work or bonding, test times and results, problems, corrective action, and handback. Attach measurement plot captures to the Procore entry and link the before/after plots and data archive. Keep raw measurements in the historian; the storage and backup details are in Appendix A.

10 Welding and other planned bonds

A welding return or temporary bond may intentionally connect the grounds. That connection can produce a low reading or an alarm and hide another unwanted path. Record when the connection is made, which work requires it, and when it is removed or left in its required final state.

10.1 Before work

1. The contractor lead and activity coordinator confirm the work package, location, responsible crew, grounding arrangement, and start/end window. The electrical lead verifies the welding return and temporary bonds against the plan.
2. FNAL records the pre-work reading and alarm after the required settling interval. If the construction bond must remain connected, record that condition and arrange a separate window for any required isolation test.
3. Confirm that measurements and history will continue during the work. If annunciation must be inhibited, use the site's alarm-management procedure. Record who authorized it and its duration; preserve the raw alarm, quality, and timestamps.

GIZMO does not verify welding-current routing. Do not disconnect the CT, stimulus, or monitor to silence an expected alarm.

10.2 During work

Record the actual time the bond becomes effective. Check for the response expected from that arrangement; an existing construction bond may hide the effect of the new connection. If a predicted change is absent, pause that step and have FNAL and the electrical lead check the measurement path.

Continue checking data freshness, instrument health, and logging. Record additional bonds, cable changes, moves, and pauses. Apply Section 11.1 if valid measurements are lost.

10.3 After work

1. The contractor lead confirms the activity has stopped. Authorized personnel remove temporary welding leads or put them in their specified final state. Retain the required construction bond and permanent safety path.
2. FNAL checks the response against the required post-work arrangement for the specified settling and recovery intervals. If the construction bond remains, isolation must be checked in a separate authorized test window.
3. If the reading does not recover as expected, inspect the recent work with the electrical lead and FNAL. Check temporary leads, cable shields, piping, scaffolding, and other new connections.
4. Record the result, any pending test and the responsible lead's decision, and the before/after plot. Close the work window after the electrical lead and activity coordinator accept the arrangement and the contractor lead acknowledges handback.

11 What the conditions mean and what to do

Read the measurement with its source time, quality, and actual bond arrangement. **Good** means the instrument reports valid data; it does not certify personnel safety. **Alarm.Active** is the device's alarm decision, based on its resistance and phase logic. The beacon follows that decision and does not diagnose an open safety ground.

Condition	Meaning and action
Safety bond missing, damaged, or unverified	Stop affected work, keep clear, and notify the electrical and contractor leads. Correct the defect and verify the bond before authorized handback. Neither a GIZMO reading nor a dark beacon establishes that this connection is sound.
Low reading or active alarm with a documented construction/welding bond	This may be the expected response to that bond. Confirm the work package, connections, and time window with the contractor lead. Continue monitoring and the scheduled isolation tests; another unwanted path may be hidden.
Unexpected alarm during an isolation test or isolated operation	A new path or another configured alarm condition may be present. Pause further work that could change the connections. Record the time and alarm reason; ask FNAL and the electrical lead to investigate with the contractor work lead.
Good-quality HIGH Z	This is a valid range indication, not an exact resistance. Record HIGH Z without substituting a number. Accept it only where it meets the test criteria for that arrangement; it does not prove the safety bond is intact.
Reading changes but no alarm appears	A connection or capacitive coupling may have changed without triggering the alarm. Record the time and simultaneous work. FNAL compares the signals and baseline before deciding whether correction or a new characterization is needed.

Condition	Meaning and action
Stale timestamp, missing samples, or Uncertain/Bad quality	There is no reliable current result. Retain the last sample with its timestamp and status, record the gap, and use the coverage response below. Do not mark a required check passed.
Invalid range, clipping, implausible readings, or frequency mismatch	The measurement setup or instrument may be wrong. FNAL checks the CT, stimulus, configuration, and calibration. Do not interpret an invalid result as good isolation.
No alarm during a test that should trigger it	The alarm chain has not passed its check. FNAL verifies the fixture, settings, CT/stimulus connections, beacon, audible output, and controls reporting before releasing the instrument for routine use.

11.1 When remote measurements are unavailable

Facility support must maintain remote service and an approved local alternative so monitoring outages do not unnecessarily delay the contractor. FNAL performs and records the local measurements; the contractor is not responsible for instrument or network recovery.

The response depends on the work in progress:

- If no activity depends on the missing measurements, record the outage and begin recovery. Unrelated work does not stop solely because the remote report is stale.
- If the activity needs monitoring, use the approved alternative only if it provides the coverage required by the work plan. Otherwise pause that activity until coverage is restored.
- If a scheduled test or handback check is missed, tell the contractor lead, electrical lead, and activity coordinator. Arrange a local test. If that is unavailable, the responsible lead must decide under the work plan whether the affected work can proceed, and record that decision.

Log the last valid sample, missed window, fallback method and results, recovery owner, and next test time. Escalate persistent or repeated outages to facility support and SC/DPS. An unsafe or unverified safety bond always follows the first row of the table above, regardless of monitoring availability.

11.2 Finding an unwanted connection

Start with what changed before the reading changed. The contractor lead identifies the work and arranges access; FNAL takes the measurements; the electrical lead controls any grounding changes. Disconnect candidate paths only through the responsible system owner and the electrical work procedure. Record the cause, correction, repeat-test result, and handback together.

12 Shutdown and maintenance

1. Agree the outage with the contractor lead and activity coordinator. Arrange local measurements or pause affected activity as described in [Section 11.1](#).
2. Record the reason, time, grounding arrangement, last valid sample, alarm, and configuration. Verify that the historian has saved the data and required remote copies are current. Make a consistent backup if the work requires one.

3. Disable the stimulus with the site-approved control and verify that it is off using the specified independent indication. Then stop acquisition. The exact commands and indication belong in the site record.
4. De-energize the GIZMO chassis and its power supply as specified in the site procedure. Disconnect signal, network, or DC cables only after power is off and the work has been released.
5. Leave the permanent safety-ground and inductor path in its required state. Apply the separate electrical procedure to any work on that path.

13 Site settings and responsibilities

13.1 Recorded instrument configuration

These entries come from the Kria deployment record of August 17, 2026, the July 24 calibration report, and retained historian data through September 13. The calibration report was revised on July 29. Check the installed settings against this record before a test.

Item	Recorded value or reference
Software	<code>gizmo-runtime</code> 0.5.1, ARM64; OPC UA model 1.4.0. Deployed August 17 and present in the September 13 historian record.
Operating system	Ubuntu 22.04.4 LTS; kernel 5.15.0-1027-xilinx-zynqmp.
FPGA	Application <code>GIZMo_Kria_3_7_25</code> ; loaded overlay <code>GIZMo_Kria_3_7_25_image_1</code> , recorded as operating on August 17.
Configuration and state	Configuration: <code>/etc/gizmo/</code> . Calibration and device state: <code>/var/lib/gizmo/</code> . The August 17 deployment backup retains the configuration checksums and rollback record.
Startup and checks	<code>gizmo.target</code> enabled at boot. Service status: <code>systemctl status gizmo.target</code> . Diagnostic check: <code>sudo gizmo-doctor</code> .
Excitation frequency	1436 Hz in the retained measurement record.
Alarm threshold	100 Ω in the calibration and retained measurement records. This is the configured alarm setting; the electrical lead and FNAL define the acceptance limits for each site test.
Calibration run	July 24, 2026, CAL 1000; external resistance box set to 9 M Ω and external capacitance set to zero. Four calibration tables: <code>Rcalibration.csv</code> , <code>Rcalibration_ph.csv</code> , <code>Ccalibration.csv</code> , and <code>Ccalibration_ph.csv</code> . Their checksums are in the July 27 deployment record.
Calibration coverage	Resistance: 65 records, with finite points through 499.56 Ω and a 1 M Ω open reference. Capacitance: 128 records spanning 0–9.1078 μF . The runtime displays HIGH Z above its 500 Ω numeric presentation boundary.
Validation	Nominal 200 Ω shunt: 12 readings, mean 192.53 Ω , range 192.3–192.7 Ω . A brief short asserted the latch at 11:58:21 MDT on July 24. The report leaves resolution and repeatability characterization open; these results do not establish measurement uncertainty across the range.

Item	Recorded value or reference
Historian	SQLite schema 2; local file <code>/var/lib/gizmo/history/gizmo-history.sqlite3</code> . A facility replica retains the copied records without age-based pruning. Capture intervals and local retention are listed in Appendix A .

13.2 Work-plan details to complete

Enter the following in the site work package and link it from the shift record. The named leads agree the limits, responsibilities, and test windows before work starts.

Responsible lead	Details to record
Electrical lead	SOP004 revision, hazard analysis, rack ID/ORC, grounding drawing and cable schedule; required construction bond, grounding connection functions, and permitted test arrangement; inductor and CT identification, protection, routing, and CT transfer factor.
Electrical lead and FNAL	Bond-check instrument, method, test points, acceptance limit, and trained checker; stimulus injection/return points, waveform, amplitude and tolerances; stimulus controls, independent off indication, boot time, shutdown, and recovery sequence.
FNAL and electrical lead	Accepted installed baseline and calibration uncertainty; isolation, capacitance, and coupling limits; settling and recovery intervals; response to failed tests.
Contractor lead and coordinator	Work package, named leads and release authority, emergency contacts, recurring test windows, pre/post-work checks, and treatment of missed tests; work-state and planned-bond records, handback, rack-door revision, and Procore log location.
SC/DPS and facility support	Data-age limit, approved local alternative, support contact and recovery target; endpoint, device identity, certificates, access roles and network owner; alarm-inhibit procedure; archive locations, backup owner, schedule, and restore check.

14 Shift record

Keep one record that links the contractor’s bond checks, FNAL measurements, and the release back to work. Use timestamps for changes rather than relying on a shift summary alone.

Entry	What to include
Shift and people	Date, shift, contractor lead/crew, work area/package, FNAL operator, electrical lead, and release authority.
Starting condition	Actual bonds and tagout status; bond-check time, checker, method, and result. Link the rack, configuration, calibration, and applicable site record.
Instrument check	Source time, quality, range/reading, alarm/reason, frequency, threshold, and historian/network status.

Entry	What to include
Test	Planned and actual window, arrangement, settling time, readings, applicable limits, result, recent work, and corrective action. Attach the before/after trend and repeat-test result.
Outage or exception	Last valid sample, missed check, local fallback and results, affected activity, responsible lead's decision, recovery owner, and next action.
Handback	Restored Building Ground bond, verifier and time, tagout closeout, release authority, contractor acknowledgment, and next test time.
End of shift	Current arrangement, unresolved issues and owners, next crew's acknowledgment, and links to the Procore entry and data archive.

A Instrument and controls reference

The generated schema for the model recorded in Section 13 defines the data interface; the companion ICD explains it. Site addresses, certificates, permissions, and field commands are maintained in the site configuration.

A.1 Reading the data

Resolve the namespace `urn:fnal:gizmo` when connecting, rather than assuming its numeric namespace index. Each reported value carries a source timestamp and a quality/status code.

Field	Use
<code>ResistanceRange</code> and <code>ResistanceOhm</code>	Use the numeric resistance only when the range is <code>InRange</code> . Good <code>OutOfRange</code> is displayed as HIGH Z; do not turn it into an invented number.
<code>Alarm.Active</code> and <code>Alarm.Reason</code>	Use the alarm decision from the instrument. Recalculating it from a resistance threshold in SC/DPS can disagree with the instrument's phase and resistance logic.
Alarm latch and time	Retain the alarm history separately from the current active condition. Acknowledgment does not clear a physical fault.
Source time and quality	Use them to distinguish current valid data from a retained or invalid result. Missing numeric values must not appear as a plausible zero.

The current interface does not supply the work arrangement, bond permit/window, alarm-inhibit state, stimulus-enabled state, waveform, or stimulus amplitude. If these appear on the display, identify their separate source and timestamp. They must not be presented as GIZMO measurements.

A.2 Rates and storage

The excitation frequency is the frequency of the injected sine wave, not the rate at which readings are logged. ADC/DAC waveform rates come from the deployed hardware configuration.

The Kria historian uses SQLite schema version 2 with these recorded defaults:

Record	Interval / retention	Contents
Fast snapshot	1 second / 14 days	Measurements, alarm, I/Q and phase, temperatures, uptime, and sequence.
Platform snapshot	10 seconds / 30 days	Operating-system, storage, process, filesystem, and network counters.
Minute summary	1 minute / 365 days	First, last, minimum, maximum, mean, count, and worst quality.
Transition event	On change / 1825 days	Alarm, quality, clock, boot, network, service, and historian changes.

Stored values retain their status and source time. Fast records also carry sequence and stream identifiers. Raw SDR/ADC frames are excluded. Earlier replay measurements gave about 1.48 GB per month of continuous raw collection and about 1.26 GB for the bounded local policy; use actual usage to plan storage.

Remote copies use cursors to transfer new records and updated summaries without duplicating them. Deletions are not replicated. A permanent remote copy may retain data without age-based pruning, but still needs free-space checks and backups. The board buffer, independent remote copies, and the Ignition historian have separate retention and restore requirements. Slow Controls’ long-term historian follows its PostgreSQL/site-computing plan.

A.3 Backup and recovery

Use SQLite’s online-backup API or a properly checkpointed export. Copying the live database file alone while its write-ahead log is active can miss data. Record the archive checksum, schema and runtime versions, model digest, capture-path digest, and storage reference.

Check that local writes and remote-copy cursors advance before and after recovery. Keep the last valid data and the outage interval visible; do not fill a gap with invented measurements. The site plan defines backup ownership, recovery targets, and restore checks.

B ZedBoard spare reference

This is the spare status recorded in the recovered long guide, not a new acceptance test. Check the current acceptance record before using the ZedBoard. Its separate OPC UA server reports its own device identity and does not control or proxy the Kria.

Item	Recorded condition
Interface	Model 1.4.0 with the same namespace and field definitions; unavailable functions report non-good status.
Measurements	Installed-loop calibration had not been accepted. Resistance was Uncertain; capacitance and phase were unsupported.
Alarm	Alarm.Active reported BadDataUnavailable pending recovery of the actual controller/display alarm bit. Its Boolean value could not establish a clear alarm.
Controls	Anonymous access was read-only. The gated threshold write accepted 0–1023 ohms; other writes and operations were unsupported.
Security	The maintenance endpoint used SecurityPolicy None, including for password control. It was restricted to an isolated maintenance network.
Acceptance needed	Calibration, alarm recovery, identity, non-interference, restart, network loss, security, display comparison, and end-to-end delivery.

Do not select the spare as a monitoring or DPS source until those checks are accepted and recorded.

C Source documents

1. Current approved SOP004 GIZMO and activity-specific work plan.
2. Released installation grounding drawing, cable schedule, and rack ORC.
3. Deployed GIZMO configuration, software manual, and accepted calibration record.
4. Kria records used for Section 13: *GIZMo model 1.4 deployment result*, August 17, 2026; *GIZMo Kria Calibration Curves and Runtime Interpretation*, July 24, revised July 29, 2026; July 27 post-deployment board summary; and the retained historian record through September 13, 2026.
5. Public GIZMO Kria runtime, generated OPC UA contract, reference implementation, historian, dashboard, and ZedBoard-spare status. The generated schema is the machine-interface authority.
<https://github.com/marroyav/GIZMo>
6. Public GIZMO–SC/DPS ICD and Kria DCS intake package; the ICD explains the generated contract for human review.
<https://github.com/marroyav/gizmo-icd>
7. Public GIZMO historian archive schema and verification tools.
<https://github.com/marroyav/gizmo-data-archive>
8. Public GIZMO Ignition project and history-migration tooling.
<https://github.com/marroyav/gizmo-ignition>
9. Grounding safety background: [CCOHS: Static Electricity](#) and [OSHA: Equipment Grounding](#). Site drawings and approved work controls govern the installation.