




ASSEMBLE YOUR CONTROLLER

MODEL-ACCURATE WORKBENCH ASSEMBLY

1 / 8

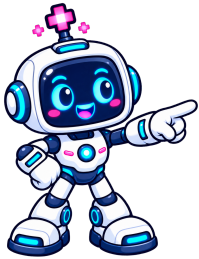

Pick the enclosure you printed, gather its parts, then follow that path without page hopping.



UNO Q CASE

PAGE 3

Compact base and lid. The Arduino hub remains outside.



DOCK V1

PAGES 4-5

Original low-profile base with an open rear hub bay.



DOCK V2

PAGES 6-7

Closed enclosure with the UNO Q and hub hidden inside.





PARTS, TOOLS + POWER OFF

MODEL-ACCURATE WORKBENCH ASSEMBLY

2 / 8

Print the fit coupons first. Assemble only with power disconnected.

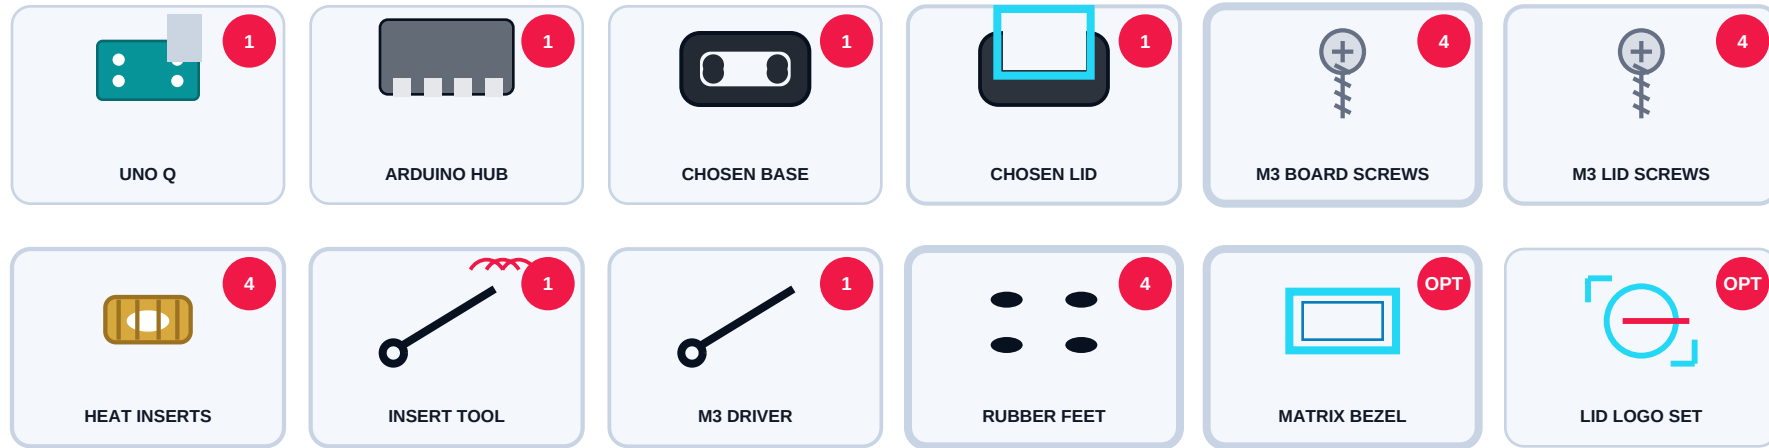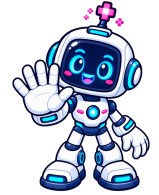

HOT INSERT TOOL

Seat inserts square and flush. Stop before softened PLA deforms.



NO FORCING


A plug, hub, board, or lid that resists needs a fit check - not more pressure.



OPTIONAL PARTS


Foam, TPU, Ethernet, adhesive, bezel, and logo pieces are not structural.

x4

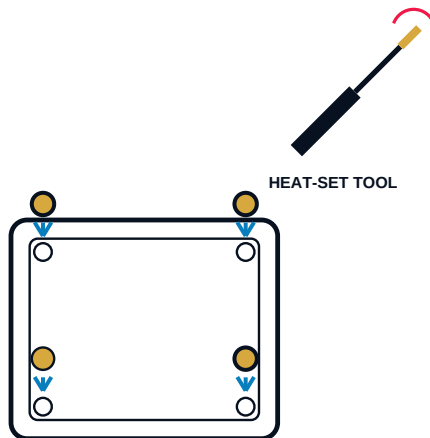

1 Seat the four inserts


Keep each M3 insert square and stop when it is flush.

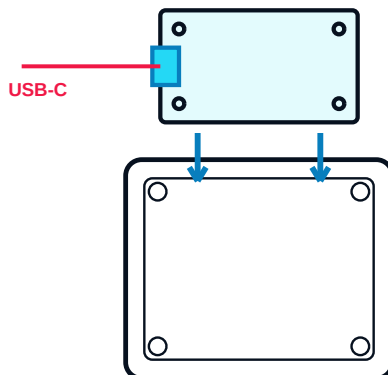

2 Place the UNO Q


USB-C faces the broad case opening; the board lies flat.

M3 x 8 / x4

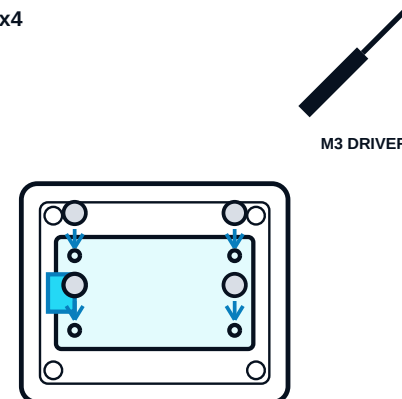

3 Fasten the board

Use four M3 x 8 mm screws. Snug, never bend the board.

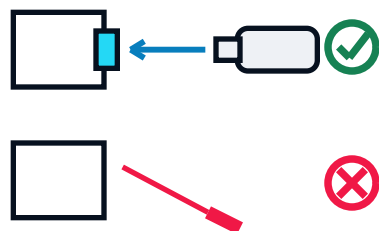


4 Check USB-C clearance

Connect the external hub; the plug must not push sideways.



5 Choose and dry-fit branding


Use one matching compact-case logo set. Dry-fit backing, cyan, and red pieces before glue.

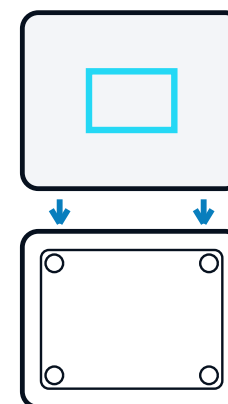

6 Close and add feet

Fasten the lid, add four rubber feet, then inspect on page 8.

x4

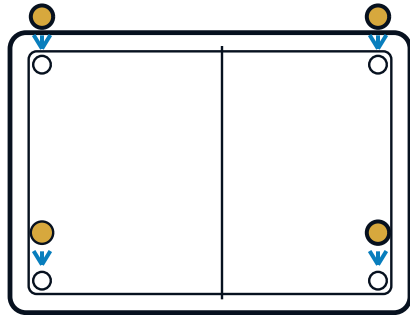


HEAT-SET TOOL

1

Seat the four inserts

Keep each M3 insert square and flush with the boss.

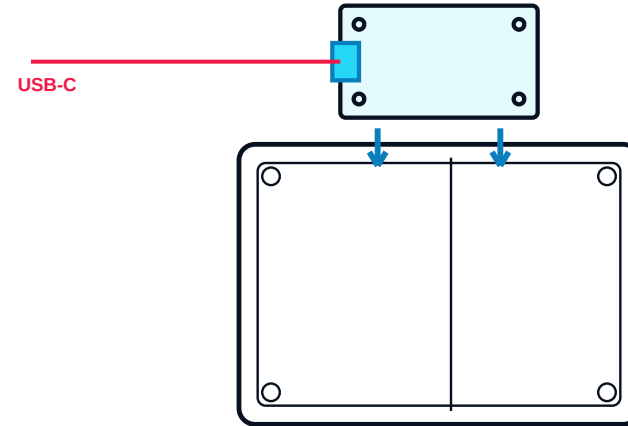


2

Place the UNO Q

USB-C faces its broad opening and every mounting hole aligns.

M3 x 8 / x4

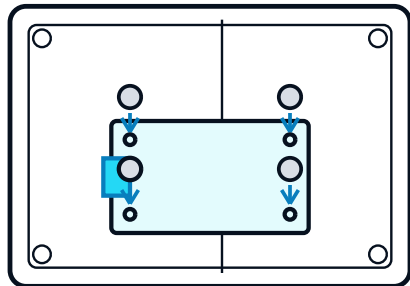


M3 DRIVER

3

Fasten the board

Use four M3 x 8 mm screws without twisting the board.

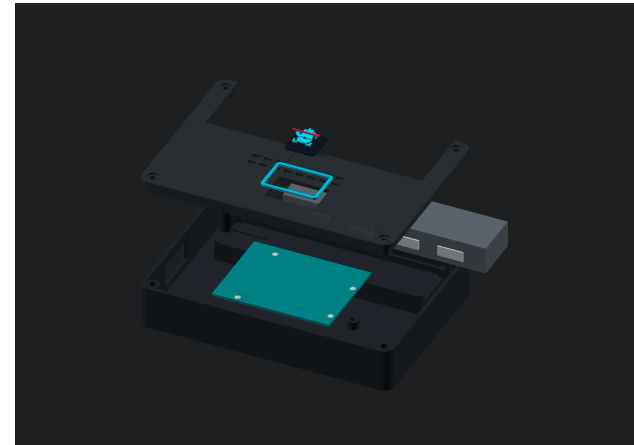

4

Add optional cradle padding

Use only a thin foam or TPU strip beneath the hub.

ROUTE THROUGH CHANNEL




NO TWIST OR SHARP BEND



5

Connect the captive cable

Route it through the channel and into the UNO Q without a twist.

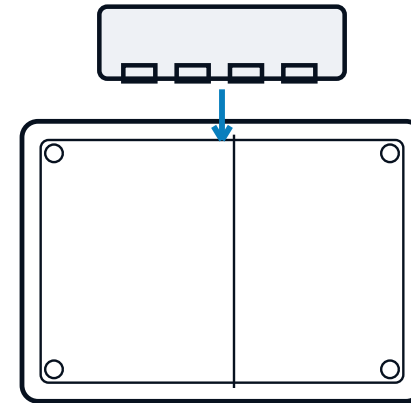

PORTS OUT

6

Seat the hub


Lower it into the open rear bay; do not trap the captive lead.



7

Connect the fixed cable set

Camera to USB-A 3.0, power to USB-C PD, Ethernet if used.

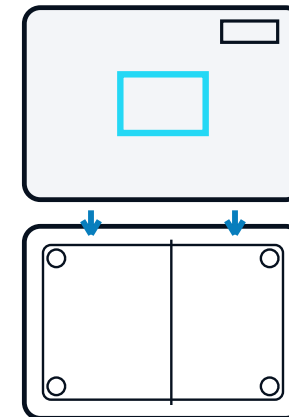


8

Close and finish

Fit the lid, Matrix bezel, one matching logo set, and four rubber feet.

x4

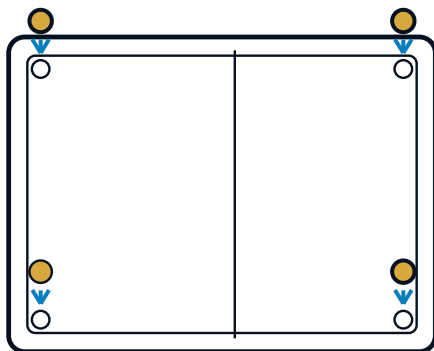


HEAT-SET TOOL

1

Seat the four inserts

Keep each M3 insert square and flush with the corner boss.

M3 x 8 / x4

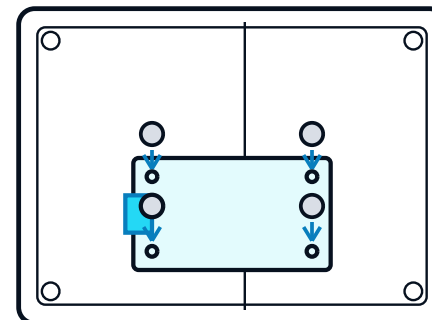


M3 DRIVER

2

Mount the UNO Q


USB-C faces its broad opening; fasten with four M3 x 8 mm screws.

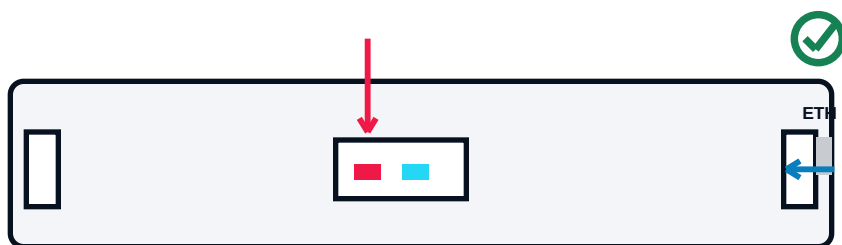

3

Orient the hidden hub


USB-C bank faces rear; Ethernet faces the right-side opening.

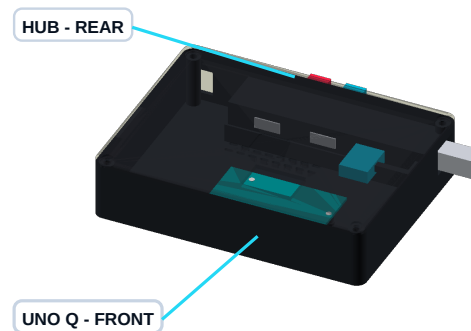

4

Connect the captive cable


The OpenSCAD layout puts the hub behind the UNO Q. Route its lead without socket strain.

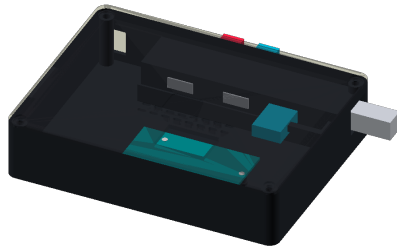

5

Choose the camera route


Plug USB-A inside and route its cable out, or use rear USB-C data.

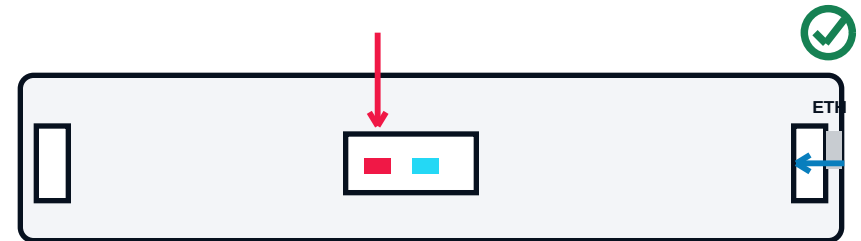

6

Keep power and Ethernet clear


Power uses rear USB-C PD; Ethernet reaches the right-side opening.

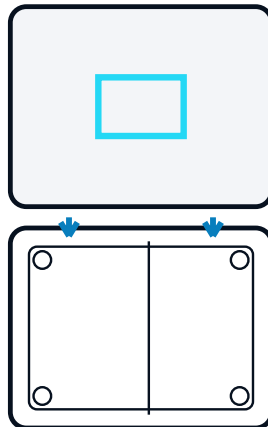

7

Dry-fit the lid

It must close freely without touching hub, plugs, cables, or board.

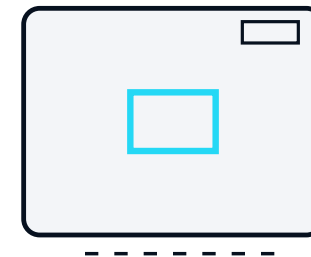

8

Close and finish

Fasten the lid, fit the Matrix bezel and matching logo set, then add four feet.




INSPECT, POWER ON + PROVE IT

MODEL-ACCURATE WORKBENCH ASSEMBLY

8 / 8

The lid closes by itself. Screws hold it down - they do not force it down.

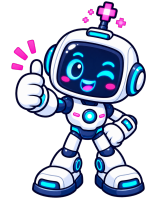

BOARD FLAT

All four standoffs support the UNO Q; no screw twists it.



NOTHING LOOSE

Remove spare screws, wire strands, and printed debris.



PORTS CLEAR

Check Matrix window, vents, USB-C, cable routes, and Ethernet.



NO SIDE LOAD

The hub cable must not push sideways on the UNO Q socket.



LID CLOSURES FREELY

Stop if the lid touches a cable, plug, hub, or board.




30-MINUTE TEST

Run the camera. Stop for soft PLA, excess heat, or USB drops.



CHOOSE ONE LID LOGO

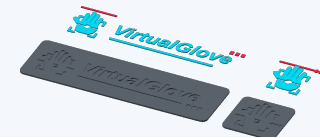

BACKING + CYAN + RED; DRY-FIT BEFORE GLUE