RD Procedure 2015_001

April 17

2015

The Amplitude and Offset of the sensor signal can be checked easily on CNC diagnosis screen
“This feature is available iE series onwards model machines”]”.

[_Checking of DDR Sensor Output Signal]

Checking of DDR Sensor Output Signal [This feature is available iE series onwards model machines" and applicable Servo software details in note].

"The Amplitude and Offset of the sensor signal can be checked easily on CNC diagnosis screen".

1. **Make PWE =1 in setting screen**

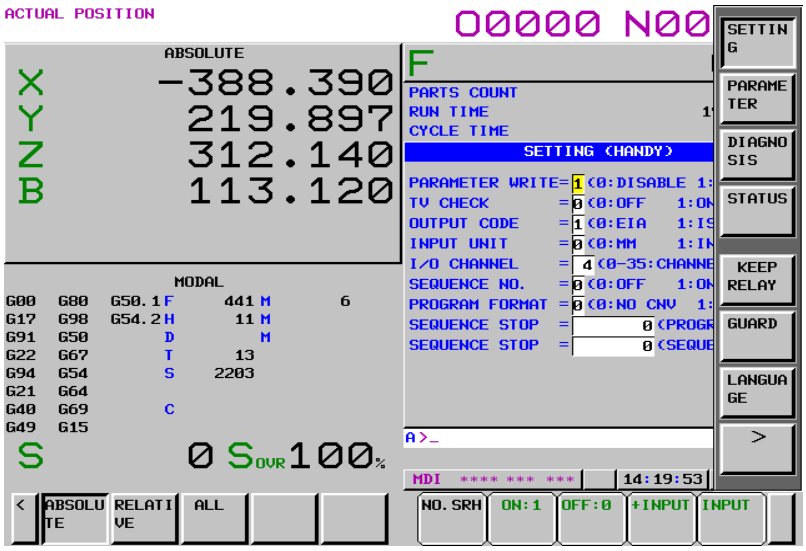

2. **Set the Parameters as per below details.**

<1> Set "1" in parameter No. 2294#0.

	#7	#6	#5	#4	#3	#2	#1	#0
2294								ITDOUT

ITDOUT(#0) αiCZ Sensor amplitude and offset information is
0: Not displayed on the diagnosis screen of the CNC.
1: Displayed on the diagnosis screen of the CNC.

3. **Go to CNC Parameter Screen.**

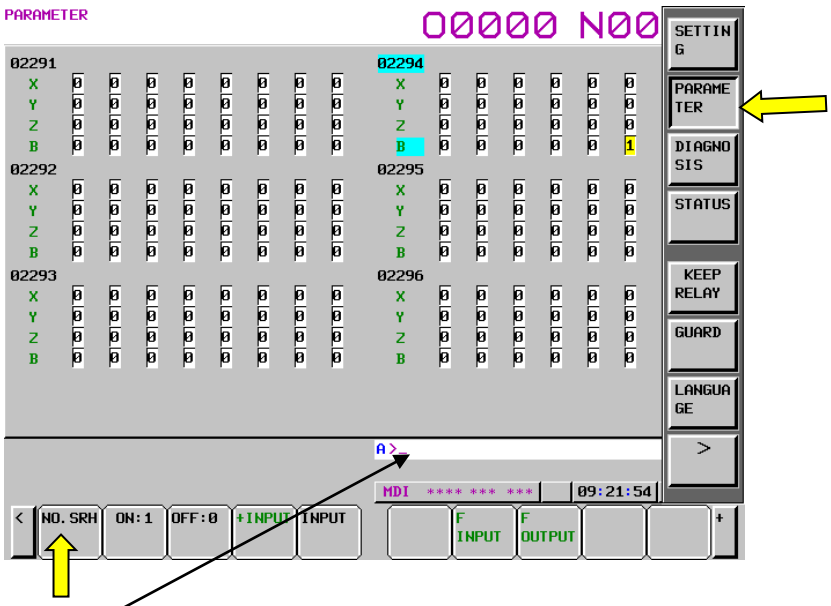

Type **2294** and press "NO. SRH" soft key

4. **Set CNC Parameter No. 2294 value to "1"**

5. **Set CNC Parameter No. 2115B value to "3418"**

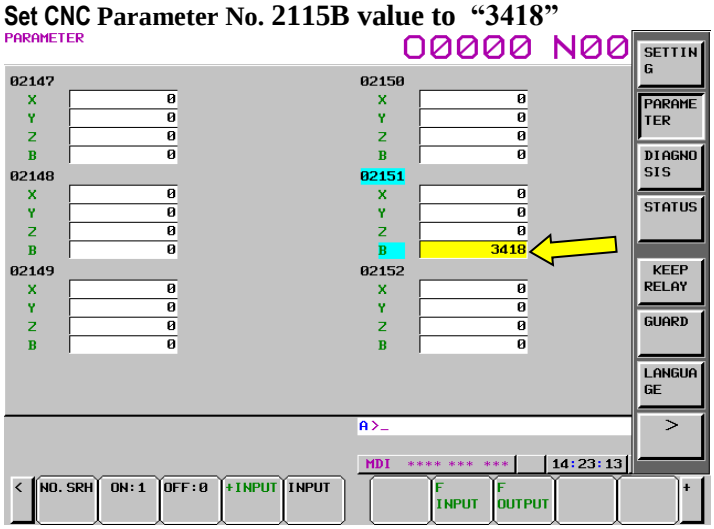

6. **Set the CNC Parameter No. 2153B value to "3419",**

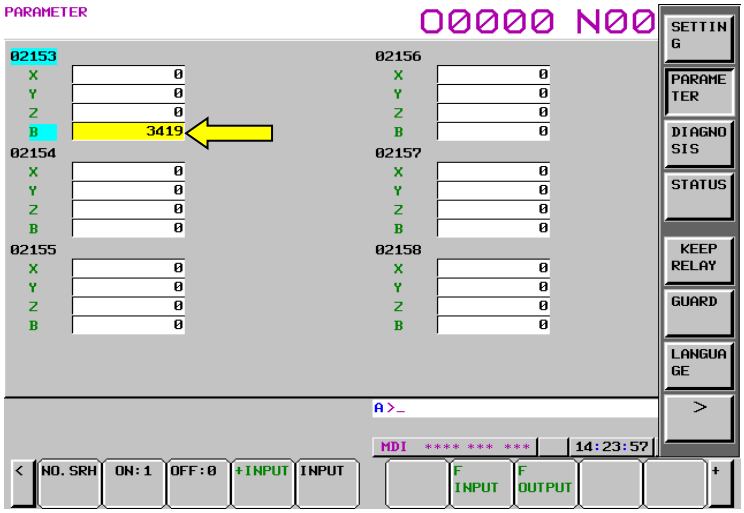

7. **Check and confirm the CNC Parameter "2115B" & "2152B" are "0. [Otherwise set these parameters to '0"].**

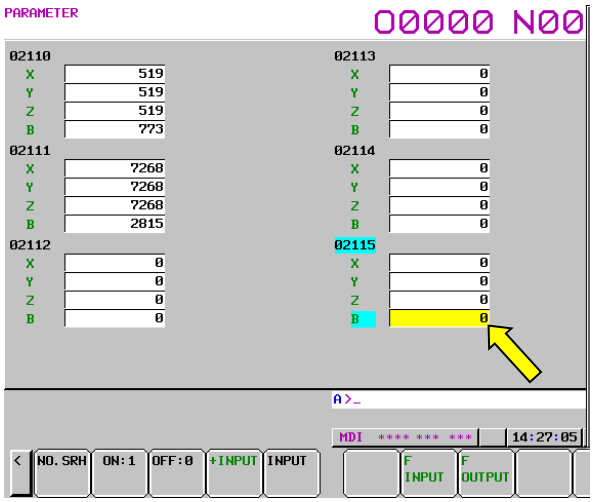

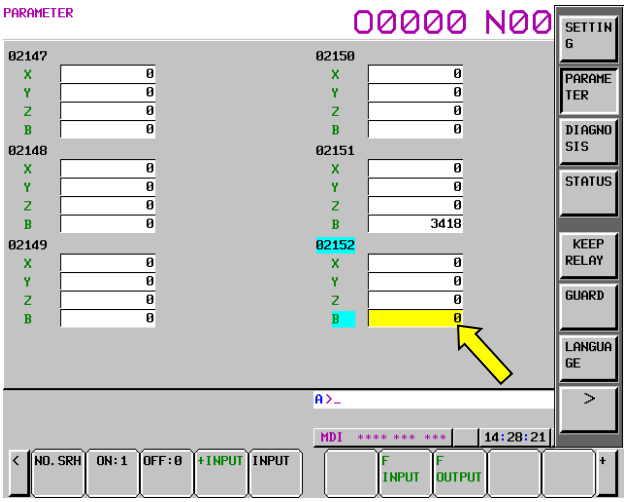

8. **Set the Feed rate override switch to 100%.**

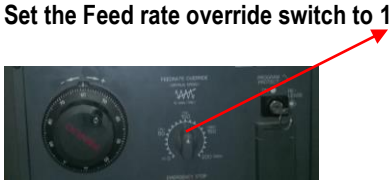

9. **Go to Diagnosis screen**

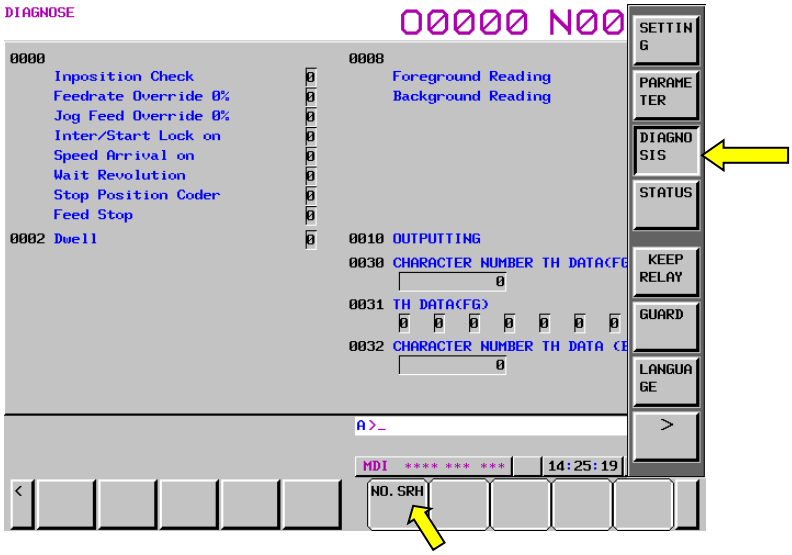

Type 353 and press "NO. SRH" soft key to find the DGN

10. **Rotate DDR at F100 Deg /min and check the values of the diagnosis information DGN.353 and DGN 354 on the Diagnosis screen**

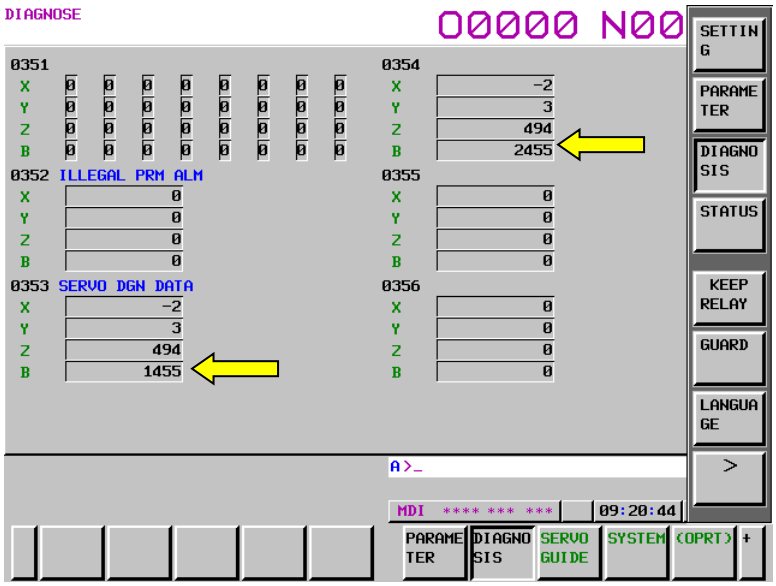

11. **Data Check Example:**

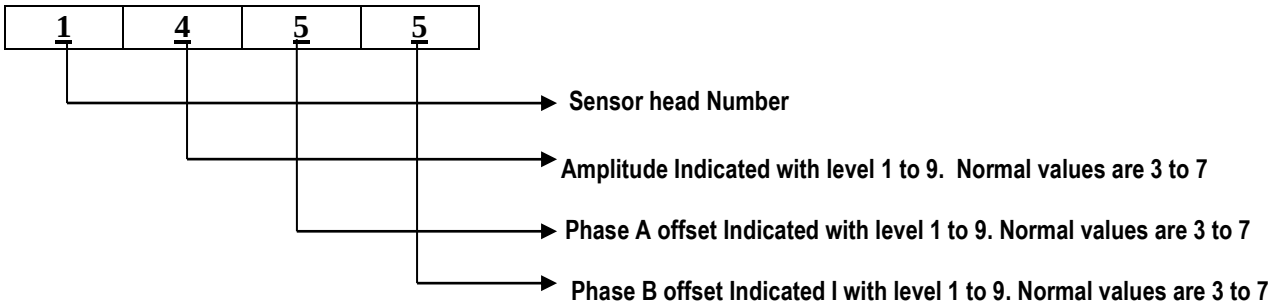

NOTE

Check The above values while the DDR is rotating. The offset values, in particular, cannot be measured when the DDR is stopped.

12. **If the Amplitude falls outside the range of normal values, the mounting position of the sensor should be adjusted again or the sensor should be replaced with new one because the sensor is considered to be incorrectly adjusted or defective.**

13. **If the offset value falls outside the range of normal values, sensor should be replaced with new one because the sensor is considered to be defective.**

14. **Restore the Parameter values changed in (3) & (4) to their original values.**

Additional information: CZi Sensors Out Put Signal sensor can be checked in other machines with below applicable Servo software .

With the procedure below, it is possible to check the information about the amplitude and offset of the output signal of the αiCZ Sensor on the diagnosis screen of the CNC. After mounting the sensor, check that the output signal is correct.

Series and editions of applicable servo software

CNC	Servo software		Remarks
	Series	Edition	
Series 30*i*/31*i*/32*i*/35*i*-B Power Motion *i*-A	90G0	03.0 and subsequent editions	
Series 30*i*/31*i*/32*i*-A	90D0 90E0 90E1	Q(17) and subsequent editions Q(17) and subsequent editions 01.0 and subsequent editions	
Series 0*i*-D	90C5 90E5 90C8 90E8	A(01) and subsequent editions A(01) and subsequent editions A(01) and subsequent editions A(01) and subsequent editions	