FRD Procedure 2015_002

April 20

2015

Servo and Spindle Motors Insulation values can be checked easily on FRD Maintenance screen. Which help to reduce trouble shooting time at field services. "This feature is available in FRD model iF series onwards machines".

[Checking of Servo & Spindle Motor Insulation Value]

Checking of Insulation value of Servo & Spindle Motors (This feature is available in FRD model iF series onwards machines").

"The Insulation value of Servo and Spindle motors in Maintenance screen".

1. **Press Quick NC button in Operator Panel, then Press Right arrow soft key, below screen will appear.**

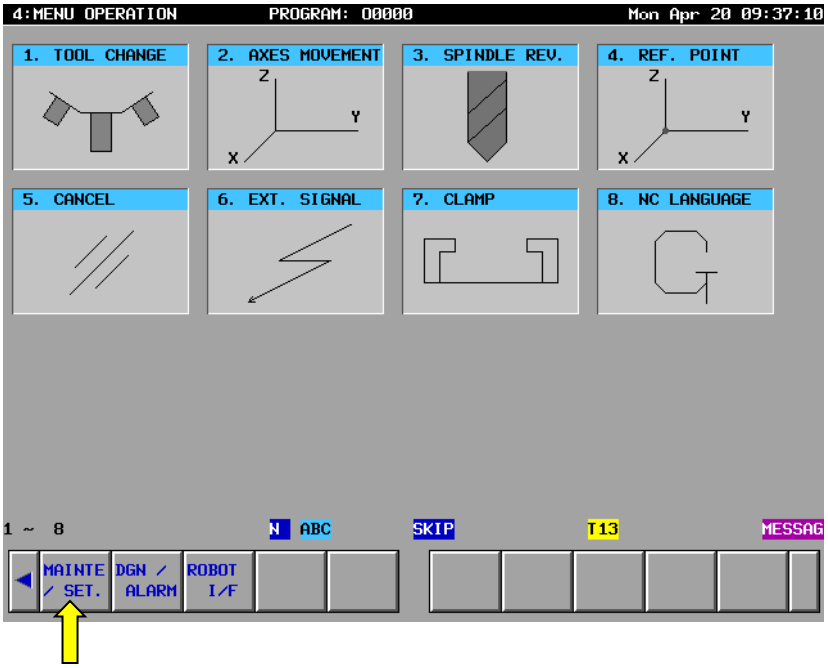

2. **Press "MAINTE/SET" soft key, below screen will appear.**

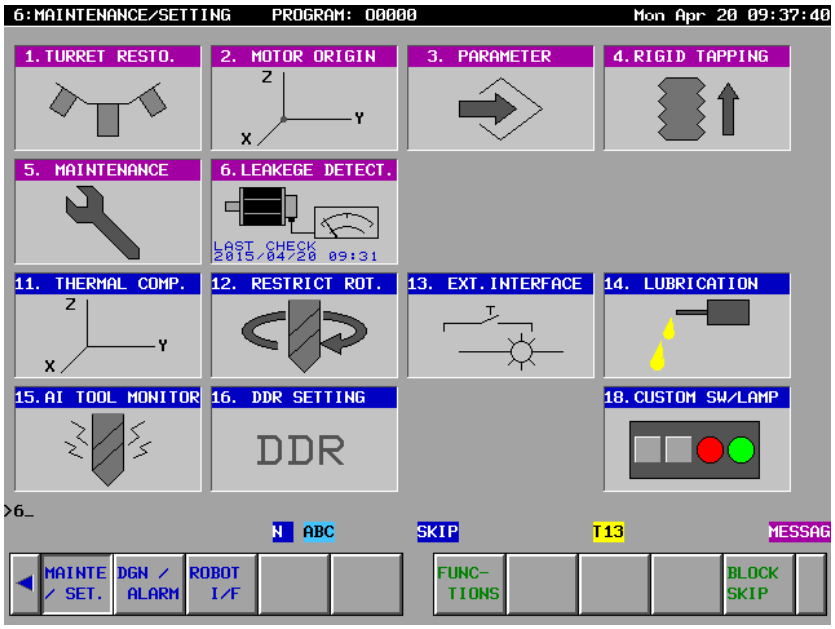

3. Press “6’ and then press Input key.

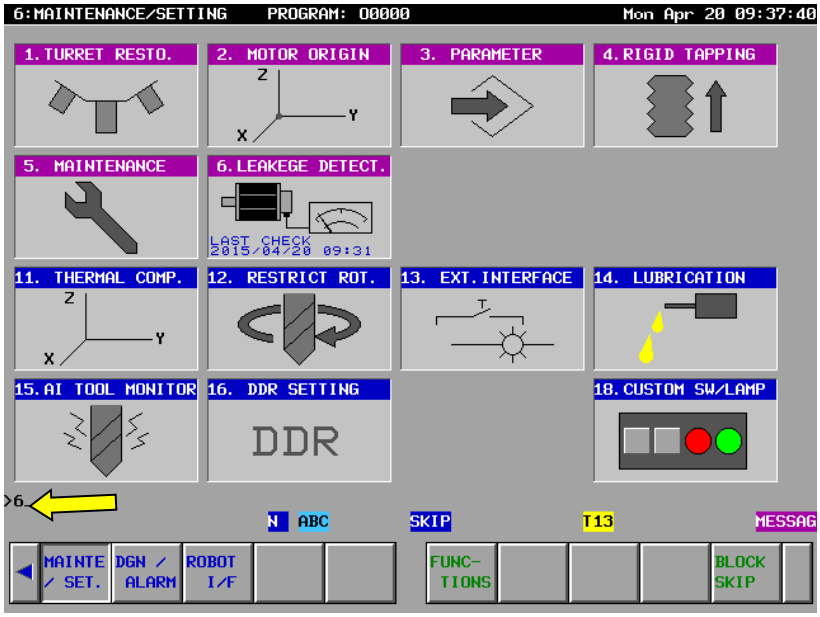

4. Below screen appears to start Checking process Press “DETECT” Soft Key.

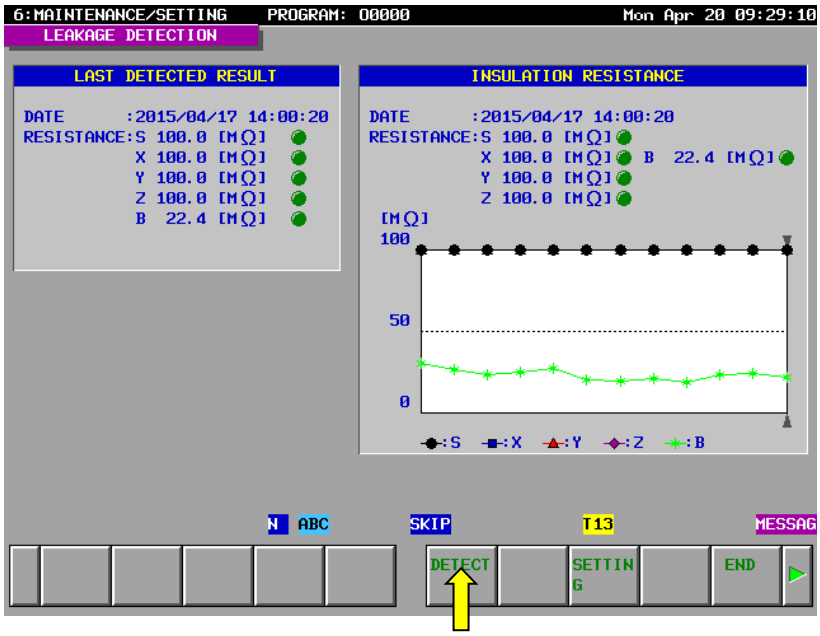

5. Below screen appears.

6. Press “EXEC” (Please take care of Warning Message)

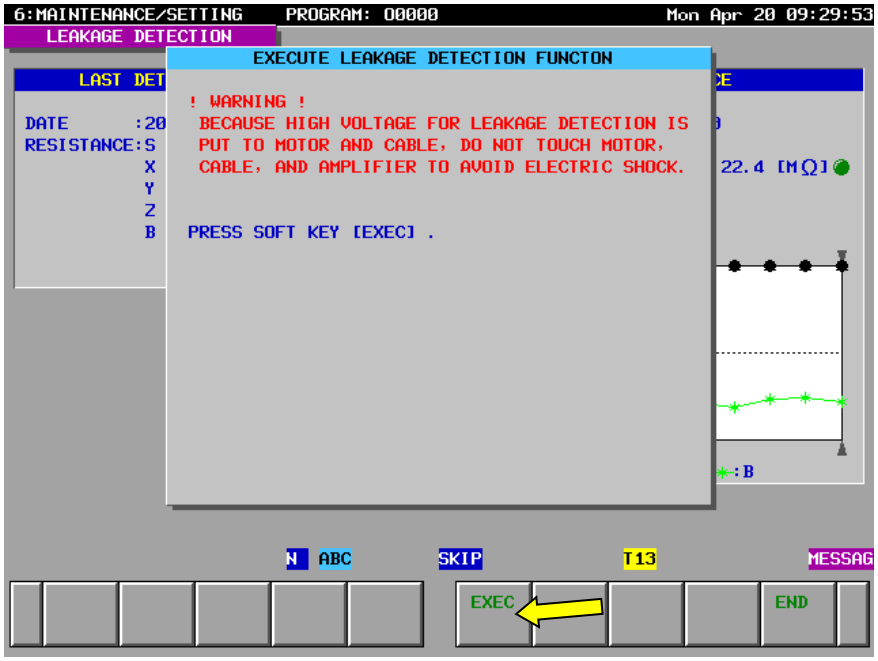

7. Press “Emergency Button” in Operator Panel.

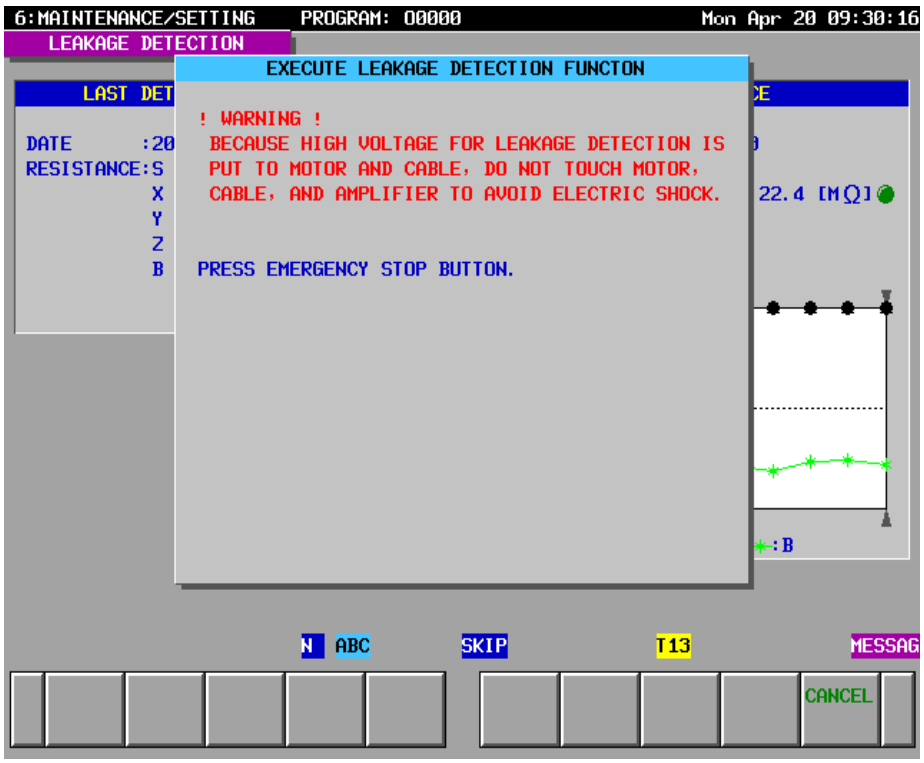

8. Leakage/Insulation checking process will start as below

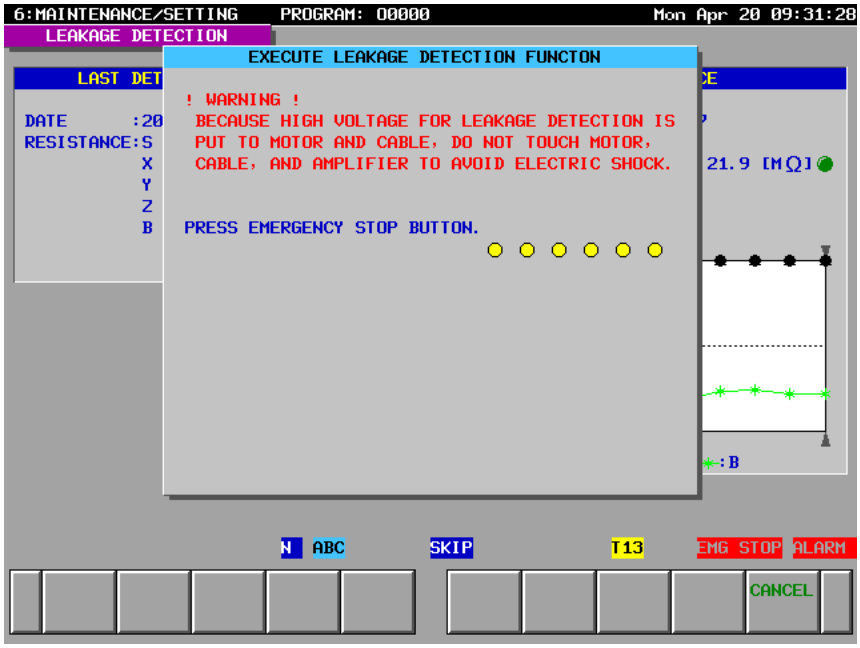

9. After checking "Finish Detection" will appear on the screen.

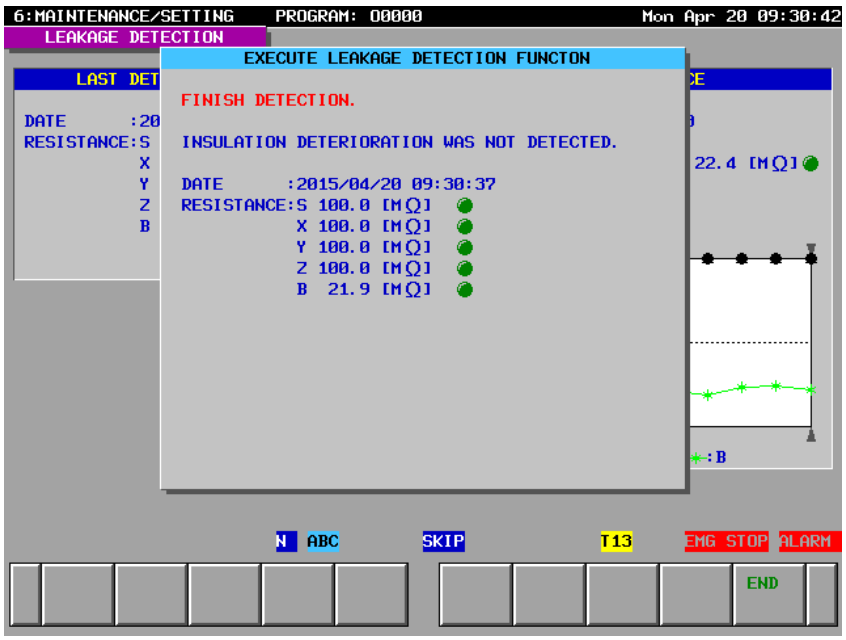

10. Press END soft key to complete the check. This finishes the insulation check
11. In case of any abnormality below results will appears. Please take necessary action.

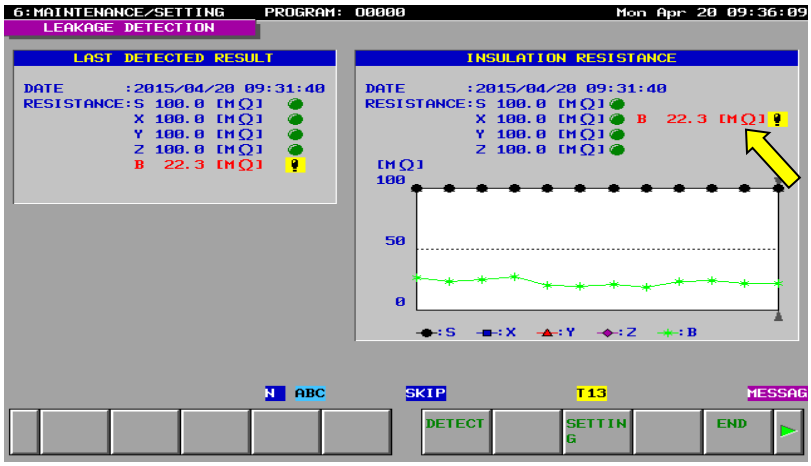

12. We can also set the "Executing timing/ Warning Interval/Warning Level (for each motor) in Leakage Detection Setting screen. Please find the below procedure.

13. Repeat the step from 1 to 3 and Press "Setting" soft key.

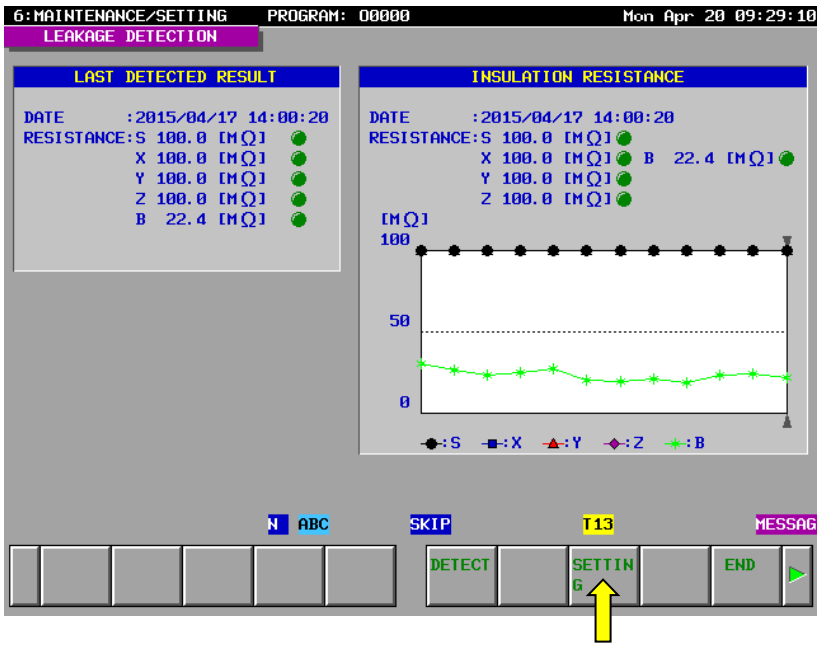

14. Setting screen will appear as below you can set required data by moving cursor up/down accordingly.

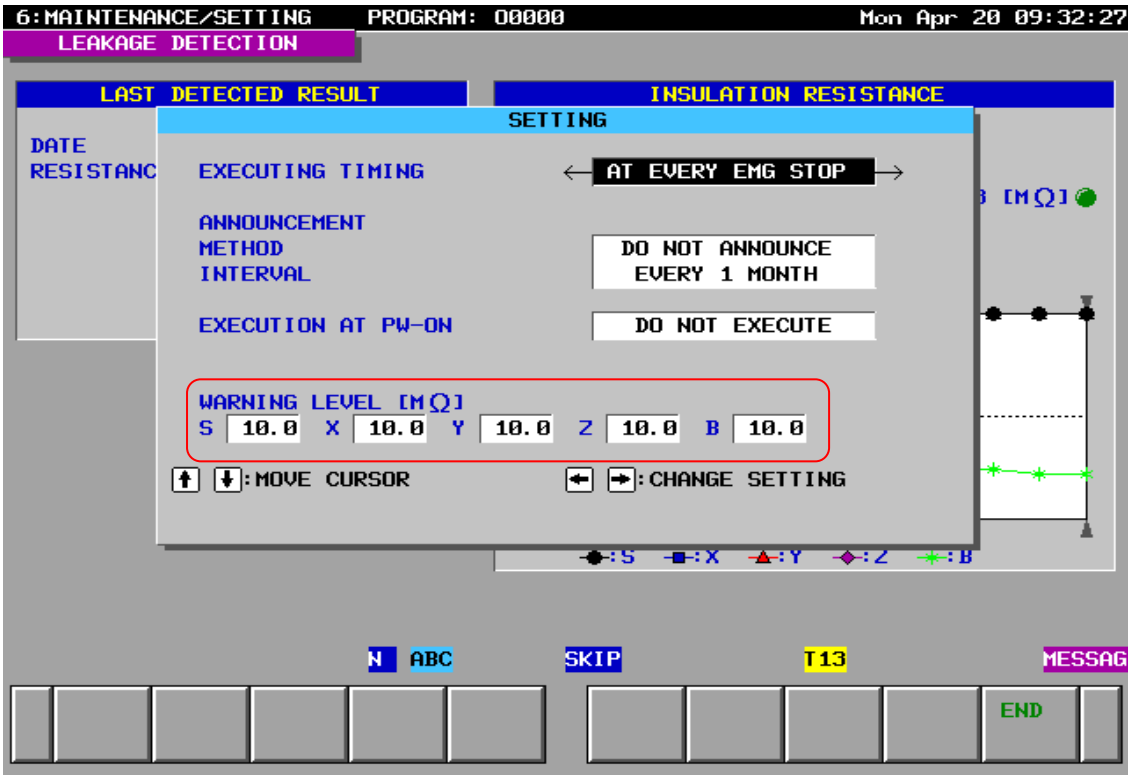

15.Press END soft key after completing the setting.