RC Procedure 2015_011

Sep 18

2015

This procedure describes about the how set the collision detection level of each axes. It is necessary to set the collision detection of each axes to avoid premature failure of seal plate/ Guide damage due to accident which affect the machine performance & accuracy/ speed / defective machining etc. So, we must set the collision detection in RC after installation of the machine & after replacement of seal plate related parts.

[Setting of collision detection of each axes in RC, which help to increase the performance of the machine]

Why we need to set the Collision detection in RC

- **It is necessary to adjust the collision detection for –**
  1. **Early detection of seal plate wear out to avoid water leakage phenomena and improve the machine performance.**
  2. **To avoid guide / nozzle damage by Z axis bumping the lower guide/ job and improve machining/ accuracy performance of the machine.**

- **It is important to set the collision detection after installation of the machine and after sela plate related parts replacements.**
- **Please check below points and after service activities & inform customer about importance of the water filtration in RC machine.**
  - **Customer is using FANUC Filters? If yes, please check the frequency of replacement.**
  - **Customer is running the machine with leakage from long time? If so, Please check the Ball screw and LM guide condition.**
  - **Check the Pre seal bellows condition?**
  - **Check the seal plate clean water flow?**

Procedure

1. Select Menu screen

2. Type 9998 and press Input

3. Press “Adjustment Menu” as below

4. Bellow screen will appear press “Collision Protect”

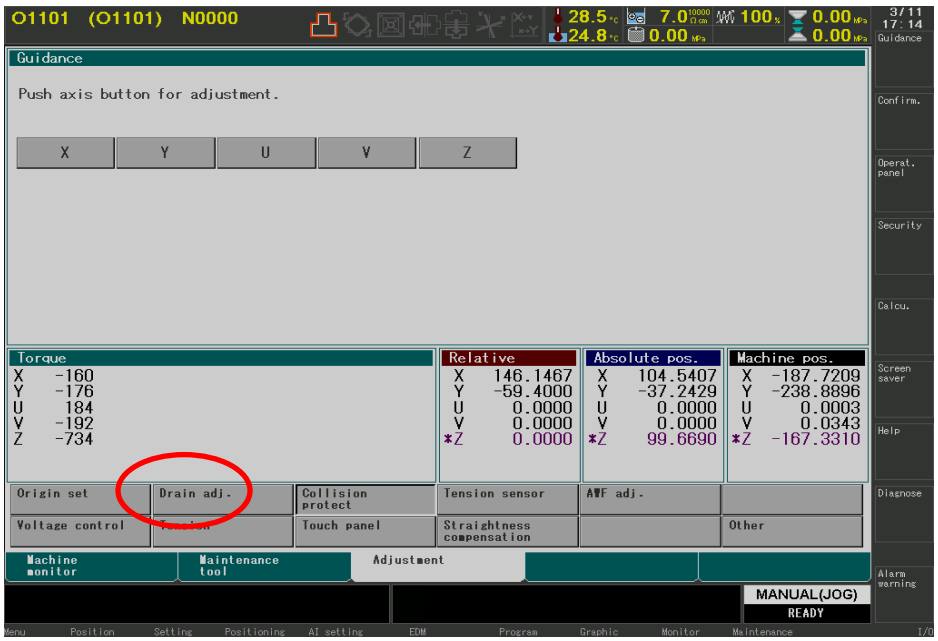

5. Select “X-axis button for adjustment”

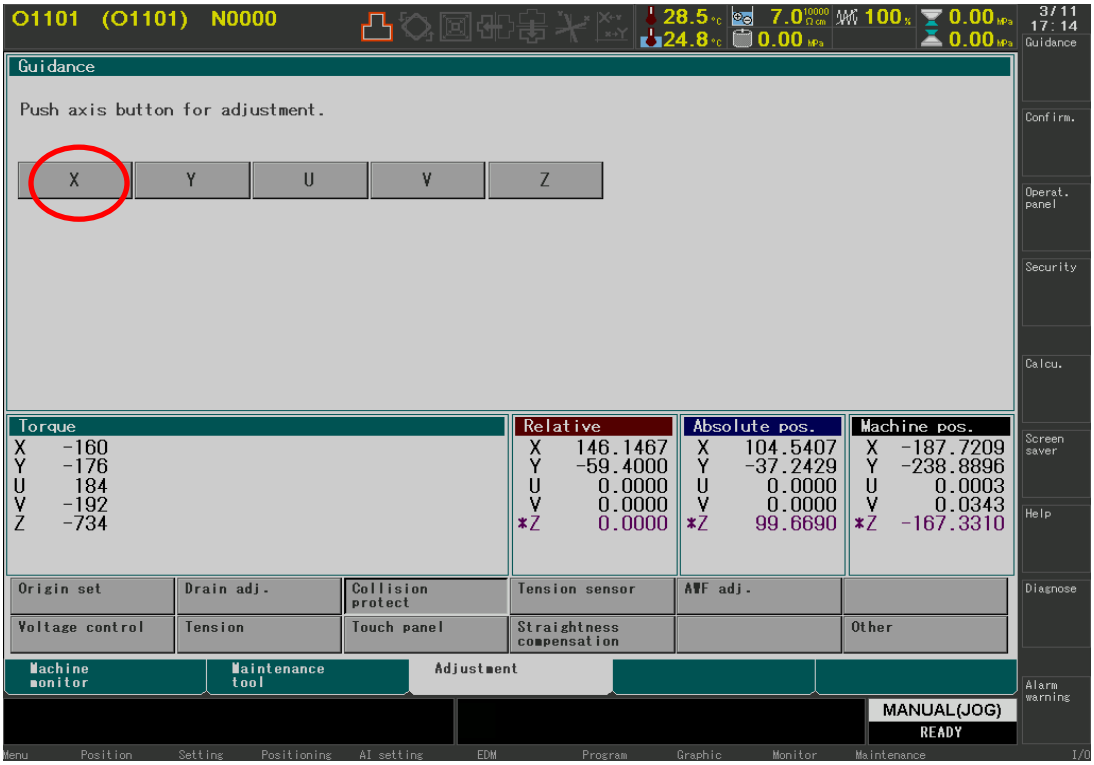

6. Follow the self-guidance as followed-

   1) Move axis to center of the machine.

   2) Push “Set Fin”.

   3) Push [CYCLE START] key.

   Important: Ensure no interference between jig and work (About 30mm (1.2 inch) moves for adjustment).

7. To continue other axes please press “Axis select”

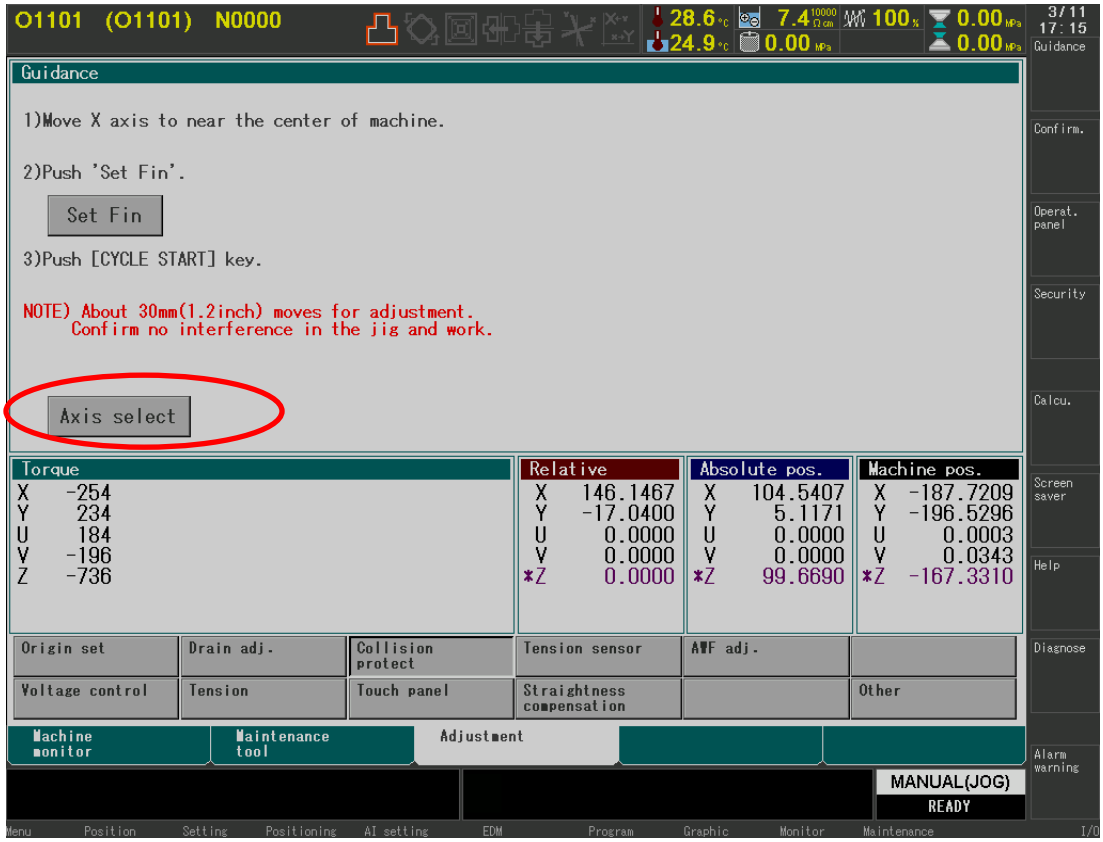

8. And repeat the steep from serial number “5”

9. Please record the load current of each axes.

10. End