CNC Procedure 2016_034	Dec 9th 2016
Procedure for download NC option in FS30/31/32iA (Old Series)	**Applicable for FS30/31/32iA (Old Series)**

For 30i-A Series (Old type)

1) Method to obtain CNC Identification.

① Push the “SYSTEM” key, and select the soft key of “SYSTEM”.

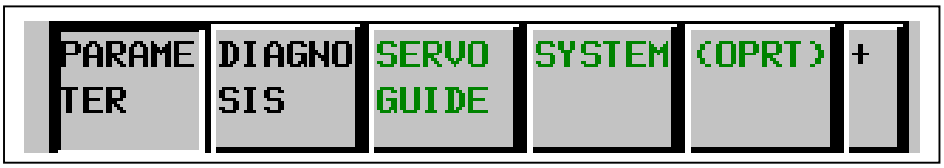

② Push the page “ UP” or “DOWN” until displaying CNC ID information.

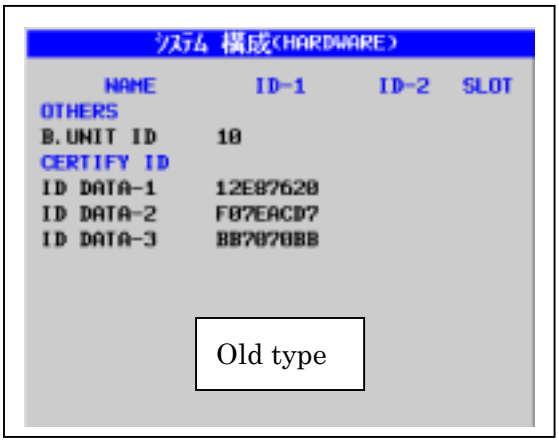

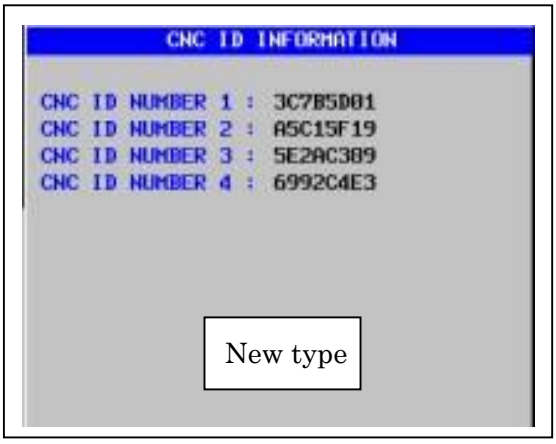

No exist CNC ID NUMBER 4 on Old type system

③ Write down this CNC ID NUMBER 1, 2, 3 to the paper.

④ When you input the CNC Identification No. on the option request screen of the web site, set the last of the CNC Identification number 4 column to 00000000.

(Remarks)

The file name of CNCOPSET.txt can’t be read to the control of an old type of 30i series. Therefore, in the change of the file name to “CNC-PARA.txt” from “CNCOPSET.txt”, CNC control can read the option setting data by the usual parameter input operation. (In that case, the parameter number 8900#1 should set to 1.)

2) Method to set the option setting data to the CNC.

① Select the MDI mode, and push the "OFFSET/SETTING" key.

The I/O channel is changed to “4". (PRM No.20=4: corresponds to the memory card.)

② Set the parameter write enable switch(PWE) to 1 on the setting screen.

③ Push the “SYSTEM” key, and select the soft key of “PARAMETER”.

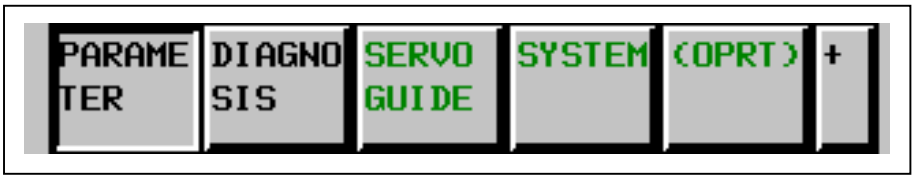

④ Push the soft key of “ (OPRT)”, and input the number 8900.

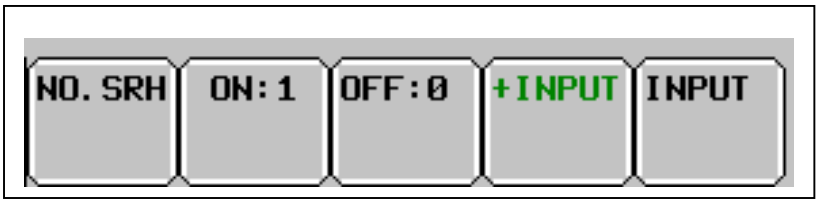

⑤ Push the soft key of “NO.SRH”.

⑥ Set the parameter number 8900#1=1.

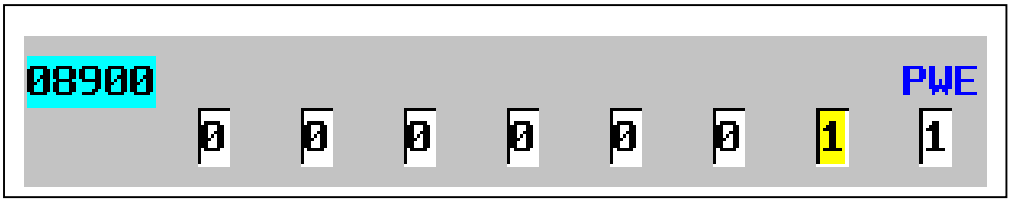

⑦ Select the EDT mode or EMG (Emergency stop) condition.

⑧ Insert the memory card to the memory card slot on CNC control unit screen left side.

⑨ Push the continuously menu key to a right edge until the soft key "ALL IO" appears.

⑩ Push the “ALL IO” soft key, and push the “PARAMETER” soft key.

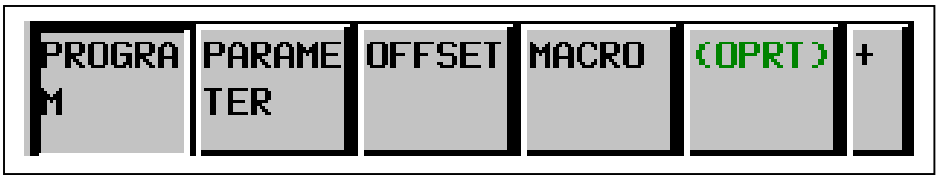

ALL IO screen is changed as follows by pushing the “PARAMETER” soft key.

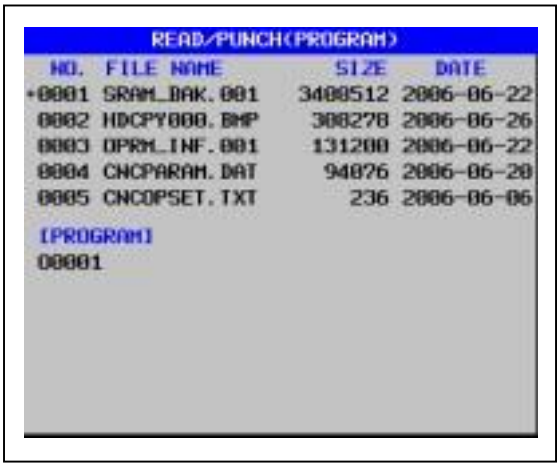

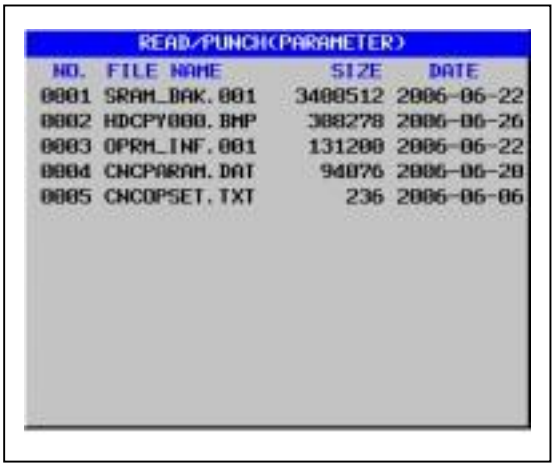

⑪ Push the soft key of “(OPRT)”.

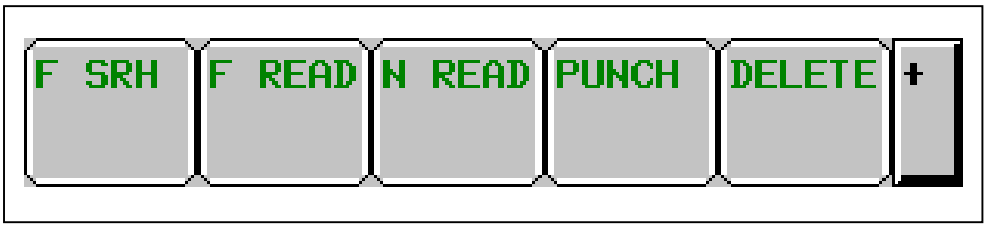

⑫ Push the soft key of “F READ“, and input the file number of “CNC-PARA”.

⑬ Push the soft key of “F SET”.

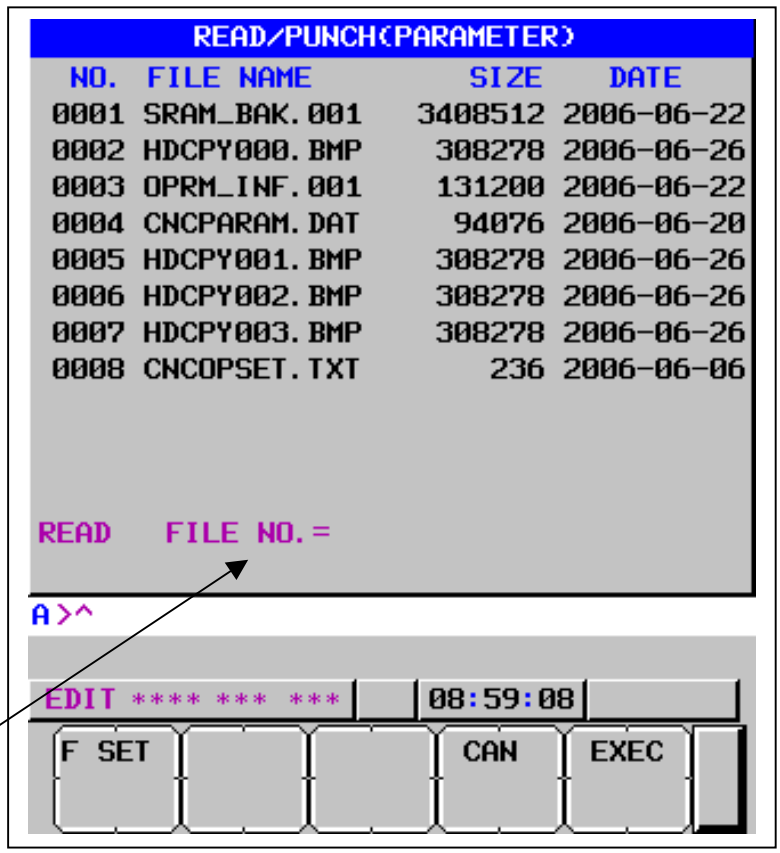

Set the file number of “CNC-PARA”



⑭ Push the soft key of “EXEC”

⑮ When the reading completes normally, the following alarm occurs.

“ PW0000 POWER MUST BE OFF “

⑯ Select the MDI mode.

⑰ Set the parameter number 8900#1=0.

⑱ Set the “PARAMETER WRITE” in the setting screen to 0.

⑲ Turn off the CNC power supply and then turn on.

(Attention)

Please note that the CNC identification number of old 30i series is changed by the following operations.

1) Restore operation of SRAM file from Other control.

(Also, restore SRAM file which the same control is different with the CNC-ID.)

2) CPU card exchange

3) Option bit change(addition and deletion)

When the option setting data with a different CNC identification number is read to CNC control unit, it becomes SR114 alarm (error of the format of the macro).