

Section: **INVERTER SUPPORT**

Revision Date:

Subject: **INVERTER 19 FIRE INCIDENT REPORT**

Effectivity Date:

|                            |                                                            |
|----------------------------|------------------------------------------------------------|
| <b>Equipment:</b>          | Inverters 19 and 20                                        |
| <b>Brand / Serial No.:</b> | INGECON SUN 920TL X360 (SN: 400152A17R20 and 400152A17R80) |
| <b>Location:</b>           | Block 10                                                   |
| <b>Date of Failure:</b>    | August 07, 2026                                            |
| <b>Reported by:</b>        | Engr. Gerie May R. Rivas – Operations Engineer             |
| <b>Action Taken by:</b>    | Engr. Clariden D. Montaño – Inverter Engineer              |

**A. CHRONOLOGICAL RESPONSE:**

1. In accordance with the Operations Team's verbal report to the Inverter Engineer Engr. Clariden at approximately 1208H where there are multiple Inverters displaying alarms (initially 200H alarm code on Inverters 19 and 20, then other Inverters reacted) on the Inverter Monitoring Dashboard, the tripping of the INCOMER 2 followed at approximately 1210H, making the entire Block Station 10 and 11 disconnected from the system. About 2 minutes later, the entire Auxiliary Power Supply of the Plant tripped as well, causing the entire Plant's System failed and entire field Inverters De-synched.
2. At approximately 1212H, the entire team already at the incident location in respond to the reports received from the personnel outside or near in the location. It was seen and observe right there that the Cabinet 1 of the Inverter 19 was still on fire and smoking. Immediately, the maintenance personnel were commanded to switch off the RMU 10 to isolate the entire Block 10. Engr. Clariden led the team to suppress the fire first, by securing the unaffected sections first (Power Blocks 1-4), then on where the fire started – the cabinet 1.
3. After the fire was suppressed, around 1227H, Engr. Clariden went back to the MCR to help resolve the entire plant's power interruption, they found out that the main breaker of the Auxiliary Power Supply also tripped. The team also secure everything be cleared then switched back on the Auxiliary breaker, and the plant's power goes back and following the inverters to go online and generating once again.
4. Engr. Froilan led the Maintenance team to conduct absolute isolation of the entire Inverter 19 by removing the XPLE Cables attached from the Inverter going to the LV Side of the Transformer, this ensures that the neighboring inverter 20 can still operate once the lines are already cleared and safe to re-energized. The activity lasted up to 1538H and able to brought back to normal operation of the inverter 20. Concluding the day with only Inverter 19 non-operational.
5. Engr. Clariden Montaño was able to identify clearly the highly suspected section where the fire started. The busbar of the L2 of the 3-phase lines connected to the input side of the AC Breaker rated 1600A was totally melted and the other two lines were severely damaged. This caused the entire surroundings of the AC-Breaker to get burned and melted. Below listed the severely affected major components on the catastrophic fire of the cabinet 1:

| Inverter No. | Affected Parts     | Status                  | Action Taken | Remarks |
|--------------|--------------------|-------------------------|--------------|---------|
| Inverter 19  | ABB 1600A Breaker  | Totally damaged         | None         | Pending |
|              | DC Swtich Isolator | Non-functional; damaged | None         | Pending |
|              | Thermal Breakers   | Totally damaged.        | None         | Pending |
|              | AC Cables          | Burned                  | None         | Pending |
|              | Signal Cables      | Melted                  | None         | Pending |
|              | Cooling Fans       | Totally damaged         | None         | Pending |
|              | Busbars            | Melted                  | None         | Pending |

|             |                          |                 |      |         |
|-------------|--------------------------|-----------------|------|---------|
| Inverter 19 | CMC Filters              | Totally damaged | None | Pending |
|             | Surge Protection Devices | Totally damaged | None | Pending |

6. The images below shown the actual pictures aftermath the fire incident on the Inverter 19.

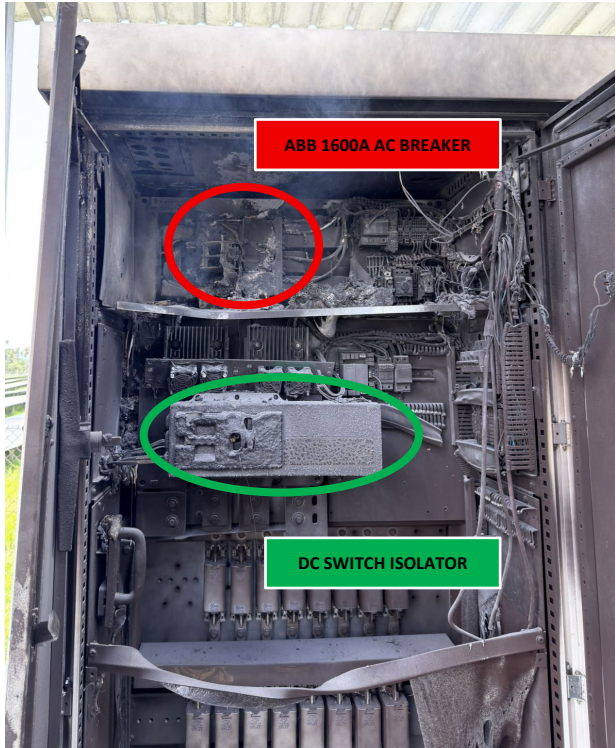


ABB 1600A AC BREAKER


DC SWITCH ISOLATOR

**INVERTER 19 CABINET 1** – Shown the situation of the major components on the cabinet 1.



WIRINGS

**ELECTRONICS AND SIGNAL WIRINGS** – shown the damaged wirings on the right side of the cabinet.

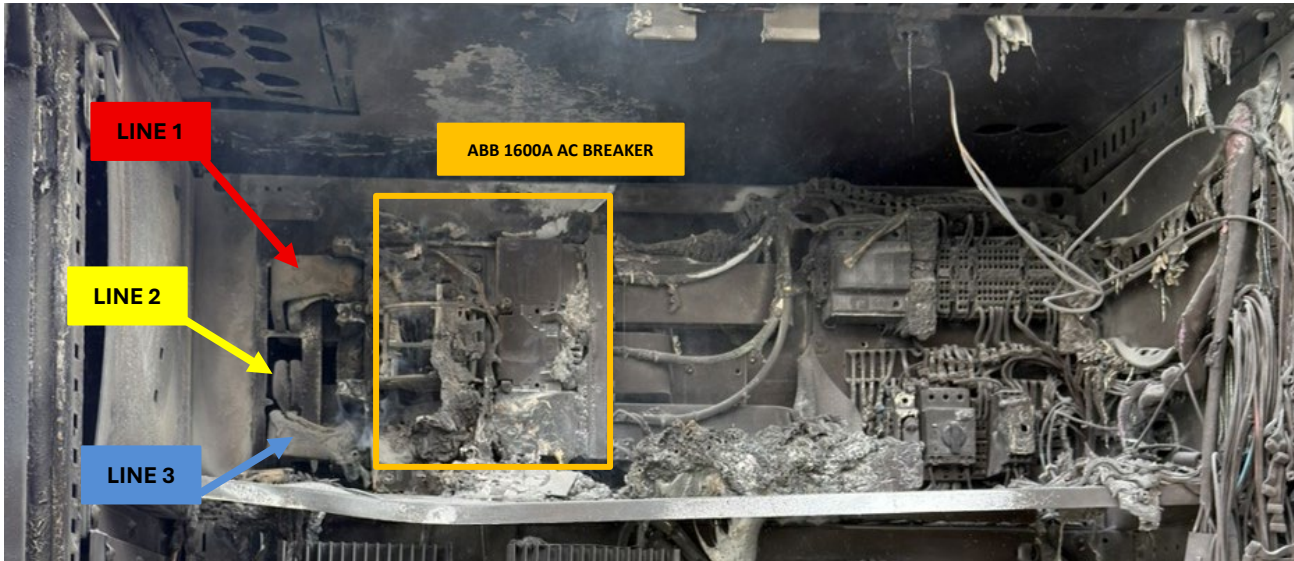

LINE 1

ABB 1600A AC BREAKER

LINE 2

LINE 3

**AC BUSBARS 1600A** – shown the totally disconnection of the busbar of Line 2 due to melting; suspected as where the fire started.


7. All electronics devices and electrical components in the cabinet 1 are irreparable and the entire cabinet is unsafe for occupancy of new replacement parts.

**B. EQUIPMENT STATUS:**

Inverter 19 remains totally isolated from the plant's system.

Prepared by:

**ENGR. CLARIDEN D. MONTAÑO**  
Inverter Engineer

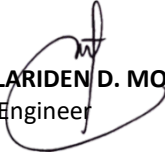

Reviewed by:

**ENGR. RHETT M. L. AYLLON**  
O&M / Plant Manager

Approved by:

**ENGR. JOHN L. COLOSO**  
Operation Head