
Three issues. A stronger coordinated model.

Selected before-and-after evidence of routing, equipment placement, and connection troubleshooting.

PROJECT RECORD / OCTOBER 2026

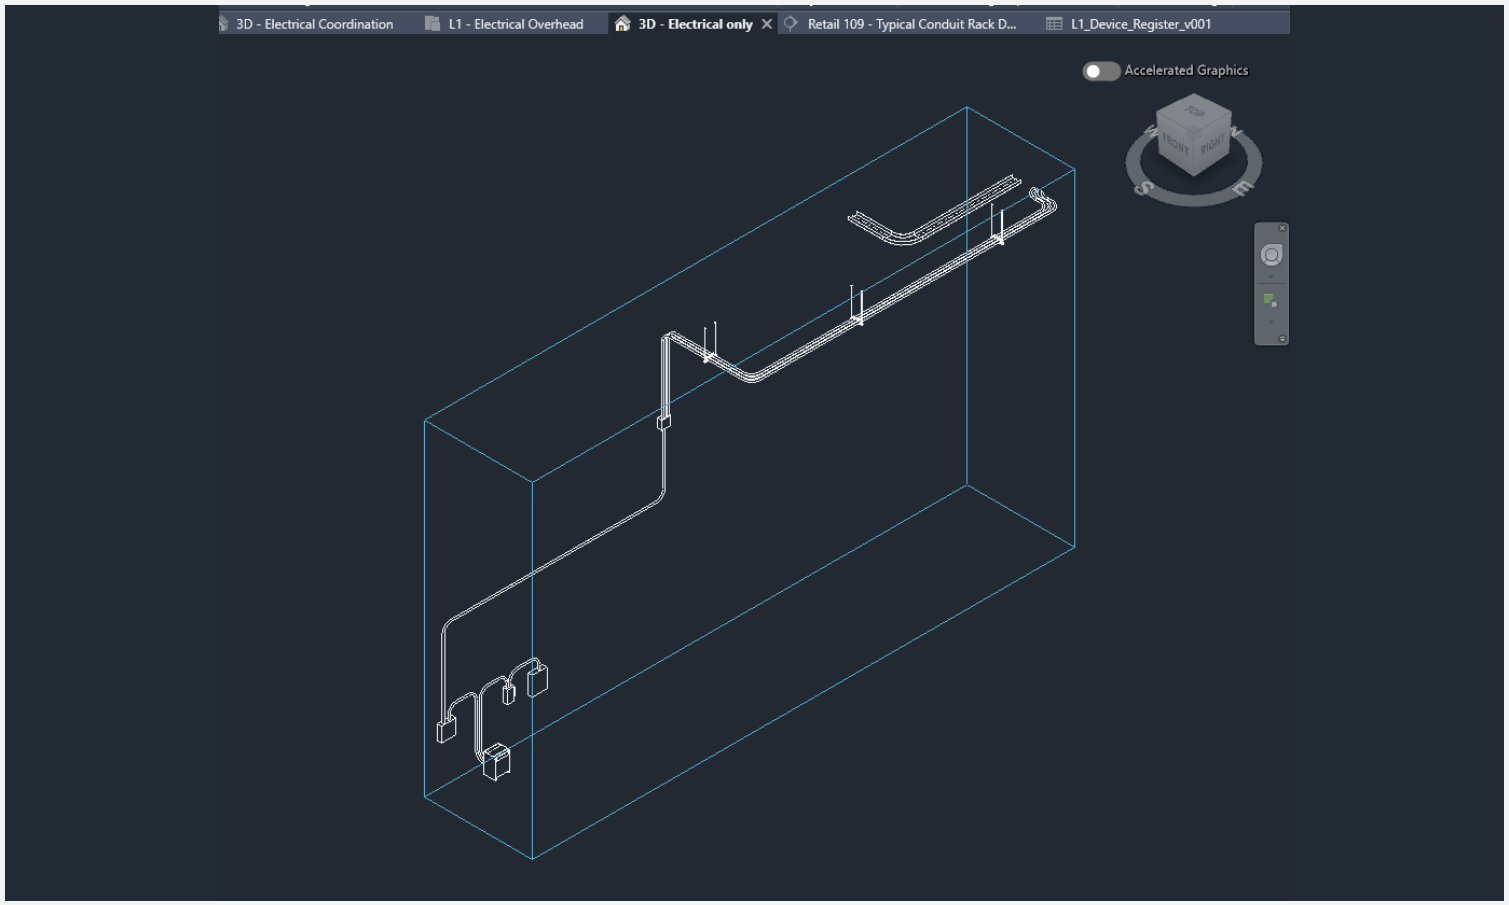

REVISED ELECTRICAL MODEL

The equipment arrangement, riser, junction box, and overhead distribution shown together after troubleshooting.

01 Conduit / wall route

Clarified the concealed route and reviewed the remaining wall intersections.

02 Panel / transformer layout

Reworked equipment placement to support practical conduit geometry.

03 Junction-box transition

Organized the box connection and upward route to overhead distribution.

FINAL NAVISWORKS CHECK

13 tests / 0 New / 0 Active


Evidence set: Revit screenshots, October 3-10; Navisworks report v002(2), October 11. Issue 01 is a clash-review case. Issues 02 and 03 document Revit modeling and coordination troubleshooting.

Conduit / wall route

A partially embedded riser route was revised to make the concealed intent clear and remove the original elbow intersections.


01 / NAVISWORKS CLASH REVIEW

BEFORE / WALL-FACE ROUTE

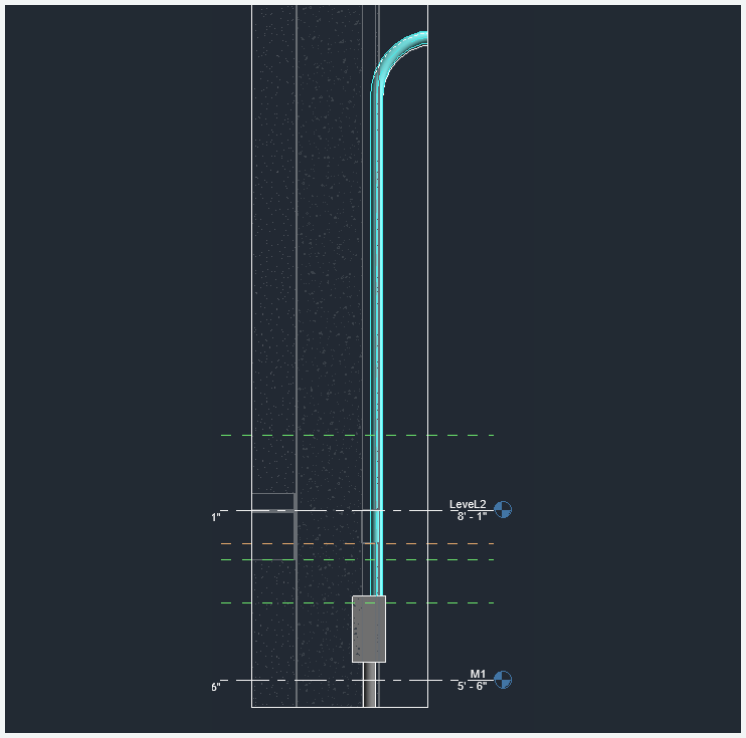


Section shows the earlier relationship between the vertical run and wall face.

AFTER / REPOSITIONED RISERS

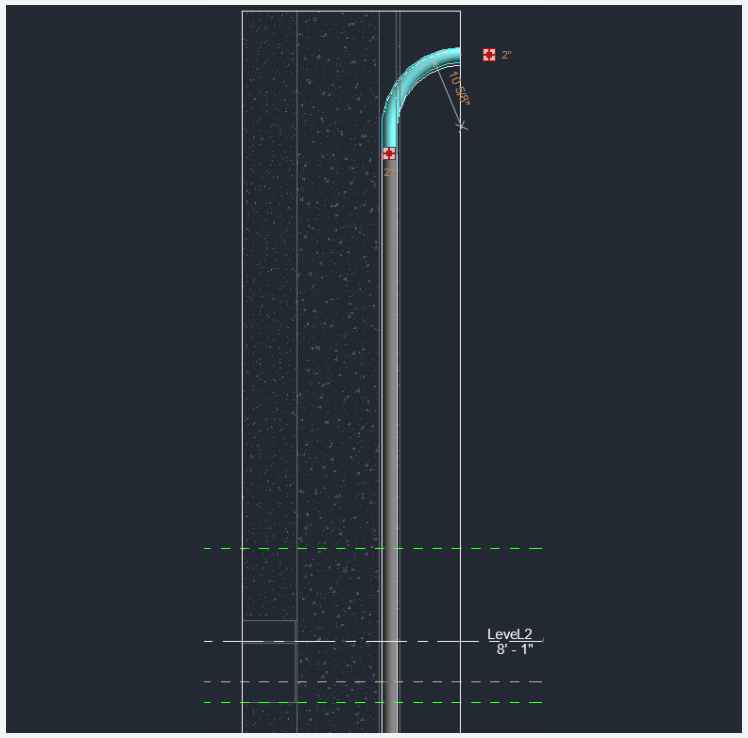

Revised section shows the concealed route and adjusted upper bend.

CHECK / WALL CUTAWAY

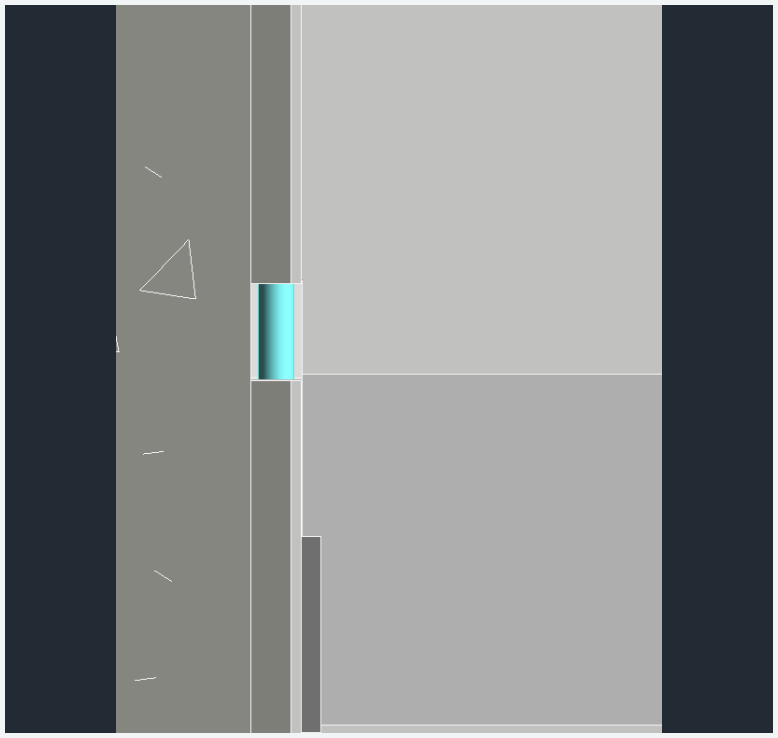

Cutaway retains the small exposed horizontal transition at the nook.

ISSUE

The risers and elbows intersected the architectural wall; the intended routing needed a clearer model representation.

CORRECTION

Moved the risers fully into the wall and adjusted the elbow positions. Refreshed the model and reran the hard-clash tests.

REVIEW OUTCOME

Three original elbow pairs: Resolved. Remaining concealed-riser wall intersections: Approved as intentional for this educational review.


Verification: Conduit vs Architecture in ST-VDC-01_Clash-Report_Initial_v002(2).html. Wall cavity, framing, and opening details remain unverified.

Panel / transformer arrangement

Equipment position and conduit geometry were worked through together, turning an awkward connection trial into an orderly arrangement.


02 / REVIT EQUIPMENT & ROUTING TROUBLESHOOTING

BEFORE / CONNECTION TRIAL

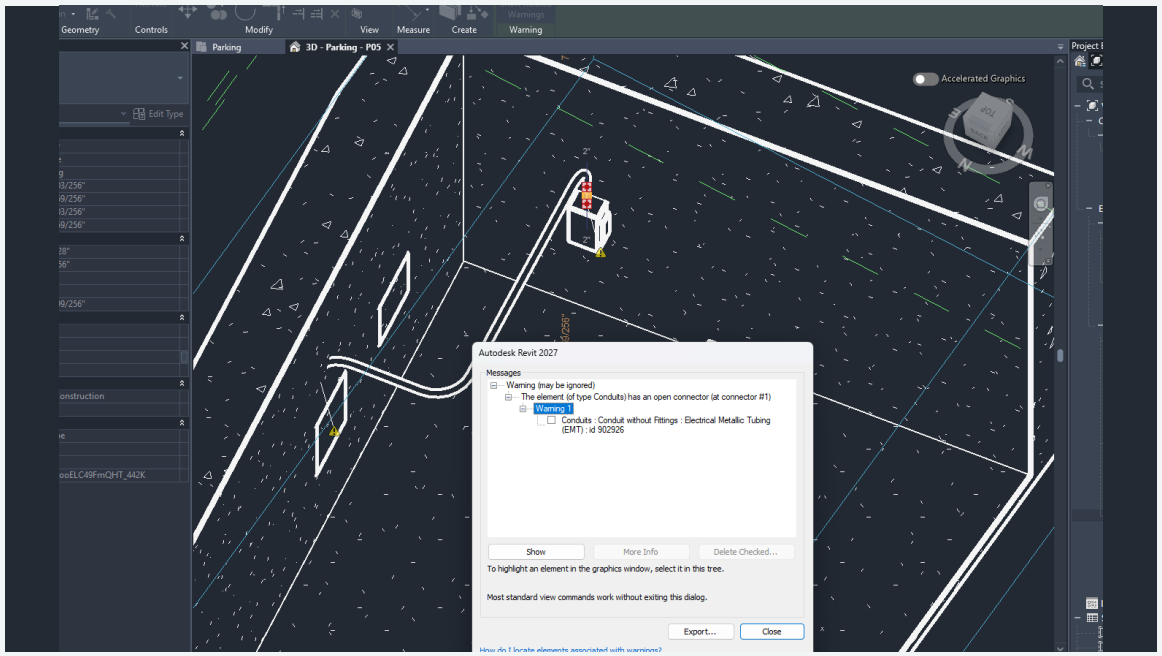


The earlier trial includes an open-connector warning and a difficult routing arrangement.

AFTER / COORDINATED ARRANGEMENT

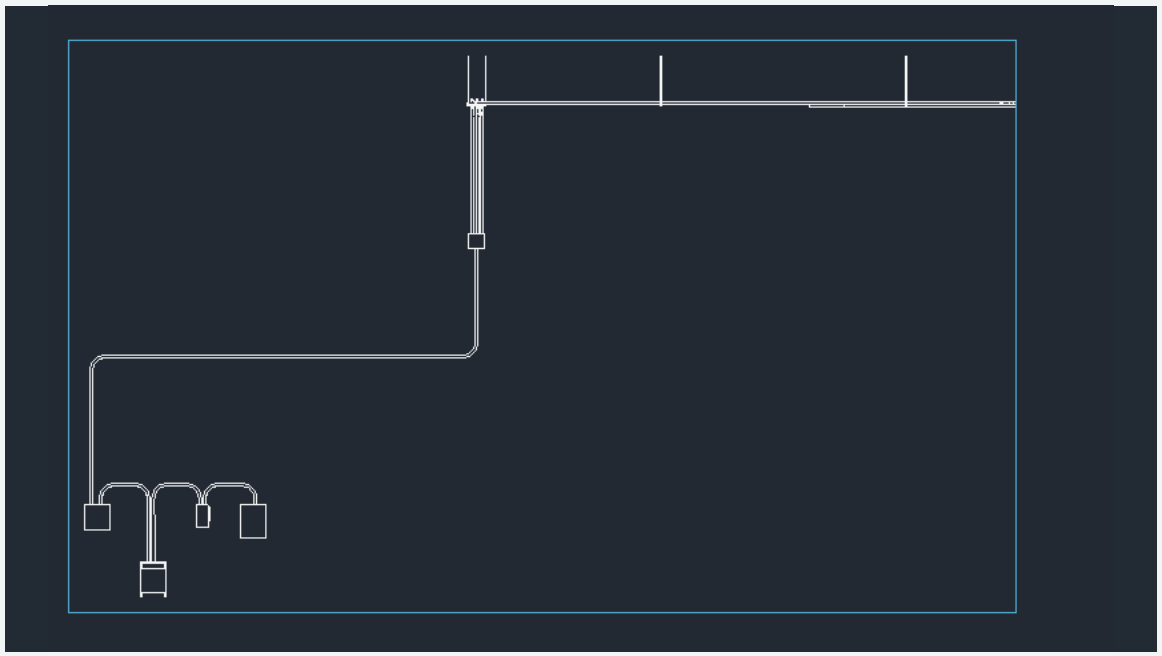

Revised equipment row connects into the riser and overhead distribution.

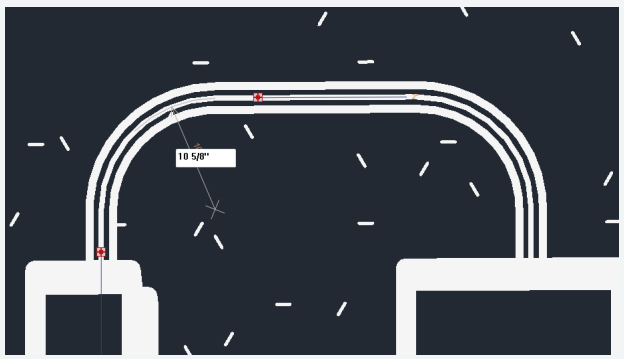

PROCESS / MAKE ROOM FOR THE BENDS

The bend study helped establish workable spacing and conduit transitions between enclosures. The displayed bend radius is 10 5/8 inches.

CORRECTION & OUTCOME

Reworked equipment spacing, mounting positions, and connector alignment. The revised model presents the panel, disconnect, and transformer connections as an organized system.

Modeled feed sequence: P480-1 > DS1 > TX1 > P208-1.


Evidence: October 3 routing trial, October 5 bend study, and October 9 revised elevation. This records modeling progress; it does not establish electrical service clearances.

Junction box / riser transition

The box connection was refined as part of the wall-route revision, with a clearer upward path to the overhead rack.


03 / REVIT JUNCTION-BOX CONNECTION

BEFORE / EARLIER BOX CONNECTION

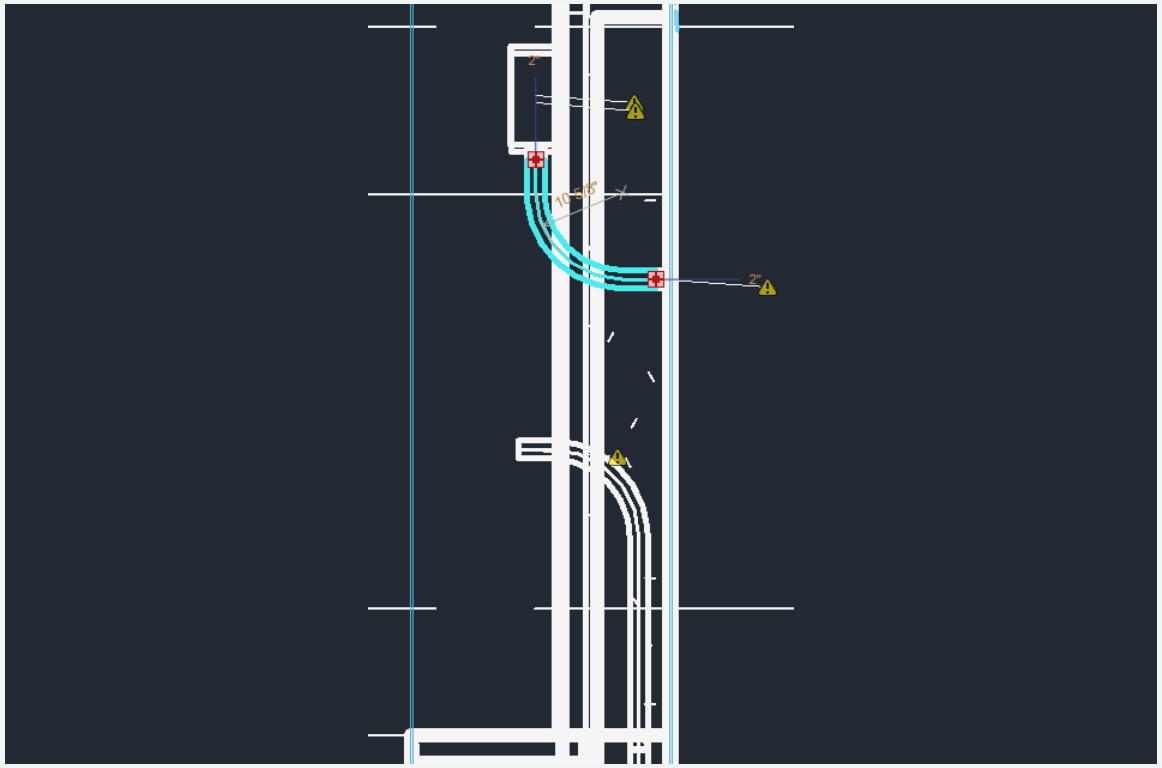

Earlier box and elbow configuration during connection troubleshooting.

AFTER / STRAIGHT TOP CONNECTION

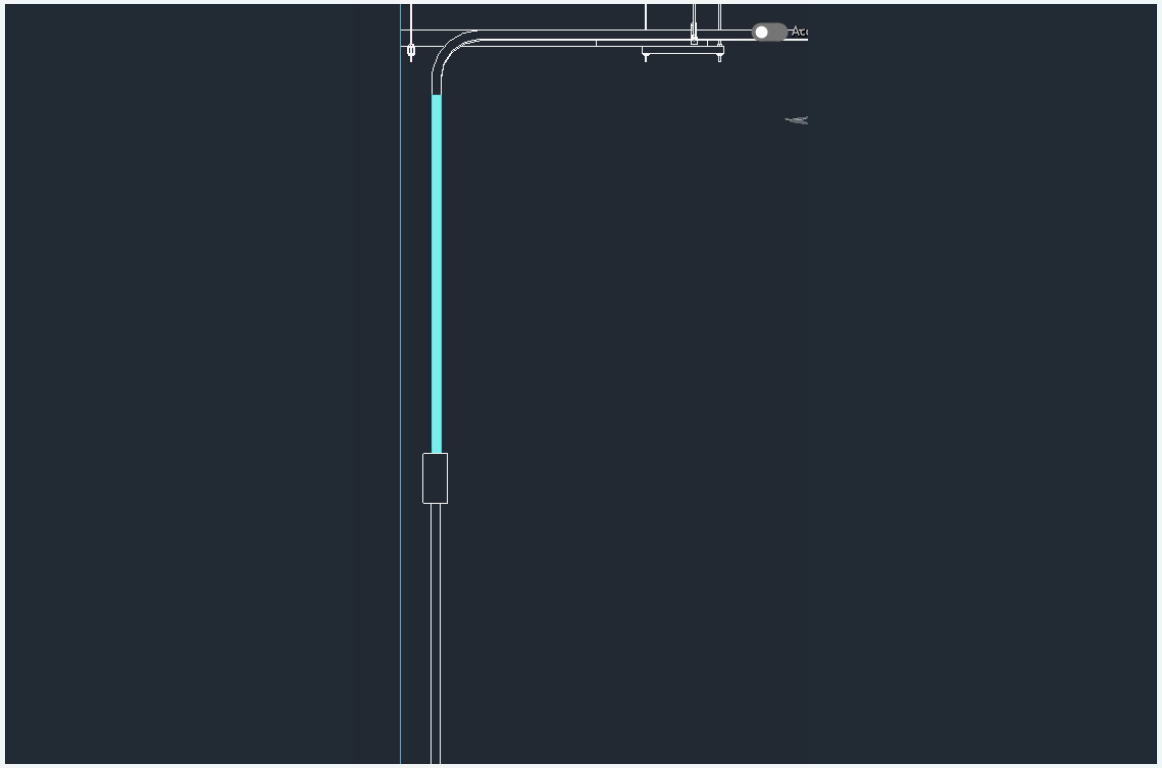

Revised straight connection above J1, with the bend at the overhead transition.

ISSUE

The junction-box interface and elbow arrangement needed to fit the intended riser route and concealed wall placement.

CORRECTION

Refined the J1 placement and conduit approach. Organized the top connection as a straight vertical run to the upper bend.

DOCUMENTED OUTCOME

The final view records the revised connection geometry. The latest clash run has no New or Active results across all 13 tests.

Review scope: unused junction-box connector warnings are separate from hard-clash results. Accepted modeled conditions are not evidence of a warning-free or construction-approved design.