

|                                |                                  |                                          |                             |
|--------------------------------|----------------------------------|------------------------------------------|-----------------------------|
| SUPPLIER<br>BluePeak Biologics | PRIMARY EVIDENCE<br>UTL-BPB-1026 | INVOICE LINE<br>INV-SUP-009-2026-Q4-L004 | REVIEW DATE<br>2027-01-08   |
| AFFECTED RUN<br>BP-1026-03     | EVENT DATE<br>2026-12-19         | CLASSIFICATION<br>Major                  | CLAIMED FEE<br>\$111,000.00 |

EVENT DESCRIPTION AND CONTAINMENT


**Detection:** In-process bioburden sample, vessel day 17. The isolate was identified as *Ralstonia pickettii*.

**Immediate action:** Run isolated; transfer path and hold tank placed on quality hold.

EVIDENCE REVIEWED

- Positive sample localized downstream of transfer connection TC-4
- Retained upstream sample remained negative
- Gasket inspection found a visible compression fold
- Maintenance closeout omitted the required post-assembly pressure-hold result

Figure 1. Contamination localization

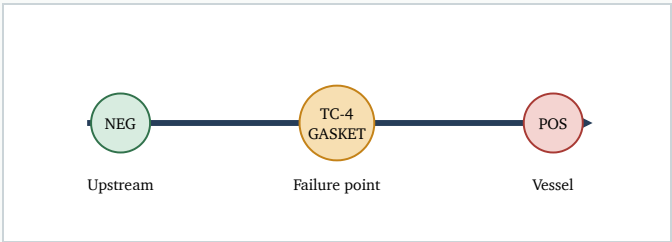

ROOT CAUSE AND RESPONSIBILITY

A supplier-maintained transfer-hose connection was reassembled with a pinched gasket after preventive maintenance, compromising the closed path.

**Sponsor-cause review:** No sponsor material, instruction, or change contributed to the connection failure.

ROOT CAUSE CONCLUSION

A supplier-maintained transfer-hose connection was reassembled with a pinched gasket after preventive maintenance, compromising the closed path.

IMPACT ASSESSMENT

The affected run remained isolated and no released product was impacted. The investigation is supplier-responsible.

CORRECTIVE AND PREVENTIVE ACTIONS

| Action                                                              | Owner                      | Due      |
|---------------------------------------------------------------------|----------------------------|----------|
| Replace TC-4 gasket and affected hose set                           | BluePeak Biologics Quality | Complete |
| Add witnessed pressure-hold verification after hose maintenance     | BluePeak Biologics Quality | 30 days  |
| Retrain maintenance technicians on gasket installation and closeout | BluePeak Biologics Quality | 30 days  |

|                                                             |                         |
|-------------------------------------------------------------|-------------------------|
| FINAL DISPOSITION                                           | APPROVED INVOICE AMOUNT |
| Supplier responsible; reject pass-through investigation fee | \$0.00                  |
|                                                             | Claimed: \$111,000.00   |

Mara Chen

Caldova Quality

Jon Bell

Caldova Finance

Elena Ruiz

Supplier Quality