

SUPPLIER Keystone Device Assembly	PRIMARY EVIDENCE FIR-KDA-1026	INVOICE LINE INV-SUP-010-2026-10-L004	REVIEW DATE 2026-11-09
BUILT 317,000	ACTUAL SCRAP 7,000	ALLOWED SCRAP 4,755	EXCESS 2,245


NONCONFORMANCE STATEMENT

Documented scrap exceeded the 1.5% contractual allowance by 2,245 units. The affected records are FIR-KDA-1026, KDA-BT-1026, and SCRAP-KD-1026-EXCESS.

DEFECT EVIDENCE

Code	Severity	Quantity
COS-12	Minor	2,400
ASM-07	Major	1,900
NSH-03	Major	1,600
LBL-04	Minor	1,100

Figure 1. Cause-to-loss relationship

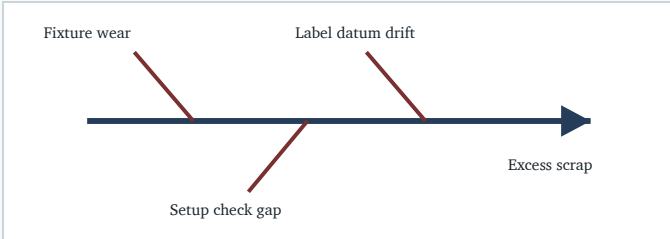

SPONSOR-CAUSE REVIEW

Build traveler KDA-BT-1026 and approved ECO-KD-447 contain no sponsor-directed condition that caused the excess scrap.

ROOT CAUSE CONCLUSION

Fixture wear and an incomplete clip-seating setup check caused the major assembly defects; label datum drift caused a smaller secondary loss.

IMPACT ASSESSMENT

Accepted units remain conforming and released. Excess scrap is attributable to supplier process controls.

CORRECTIVE AND PREVENTIVE ACTIONS

Action	Owner	Due
Replace clip-seating fixture wear block	Keystone Device Assembly Quality	Complete
Add first-piece clip height verification	Keystone Device Assembly Quality	30 days
Trend label datum capability for the next three lots	Keystone Device Assembly Quality	30 days

FINAL DISPOSITION

Disallow excess scrap charge

APPROVED INVOICE AMOUNT

\$0.00

Claimed: \$86,450.00

Mara Chen

Caldova Quality

Jon Bell

Caldova Finance

Elena Ruiz

Supplier Quality