

SUPPLIER BluePeak Biologics	PRIMARY EVIDENCE UTL-BPB-1026	INVOICE LINE INV-SUP-009-2026-Q4-L004	REVIEW DATE 2027-01-08
AFFECTED RUN BP-1026-03	EVENT DATE 2026-12-19	CLASSIFICATION Major	CLAIMED FEE \$111,000.00

EVENT DESCRIPTION AND CONTAINMENT


Detection: In-process bioburden sample, vessel day 17. The isolate was identified as *Ralstonia pickettii*.

Immediate action: Run isolated; transfer path and hold tank placed on quality hold.

EVIDENCE REVIEWED

- Positive sample localized downstream of transfer connection TC-4
- Retained upstream sample remained negative
- Gasket inspection found a visible compression fold
- Maintenance closeout omitted the required post-assembly pressure-hold result

Figure 1. Contamination localization

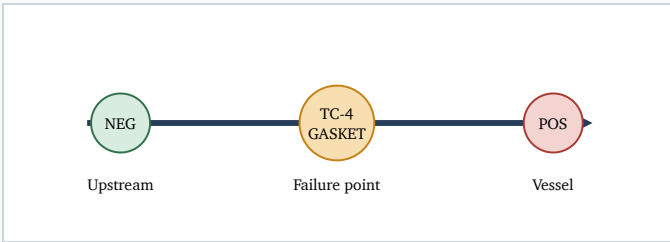

ROOT CAUSE AND RESPONSIBILITY

A supplier-maintained transfer-hose connection was reassembled with a pinched gasket after preventive maintenance, compromising the closed path.

Sponsor-cause review: No sponsor material, instruction, or change contributed to the connection failure.

ROOT CAUSE CONCLUSION

A supplier-maintained transfer-hose connection was reassembled with a pinched gasket after preventive maintenance, compromising the closed path.

IMPACT ASSESSMENT

The affected run remained isolated and no released product was impacted. The investigation is supplier-responsible.

CORRECTIVE AND PREVENTIVE ACTIONS

Action	Owner	Due
Replace TC-4 gasket and affected hose set	BluePeak Biologics Quality	Complete
Add witnessed pressure-hold verification after hose maintenance	BluePeak Biologics Quality	30 days
Retrain maintenance technicians on gasket installation and closeout	BluePeak Biologics Quality	30 days

FINAL DISPOSITION	APPROVED INVOICE AMOUNT
Supplier responsible; reject pass-through investigation fee	\$0.00
	Claimed: \$111,000.00

Mara Chen

Caldova Quality

Jon Bell

Caldova Finance

Elena Ruiz

Supplier Quality