

Off-glow resistor trial


2 × 10 kΩ axial resistors · ¼ W minimum · one lamp first



UNPLUG LAMP POWER + USB BEFORE SOLDERING


COMPONENT SIDE

White power resistors at top

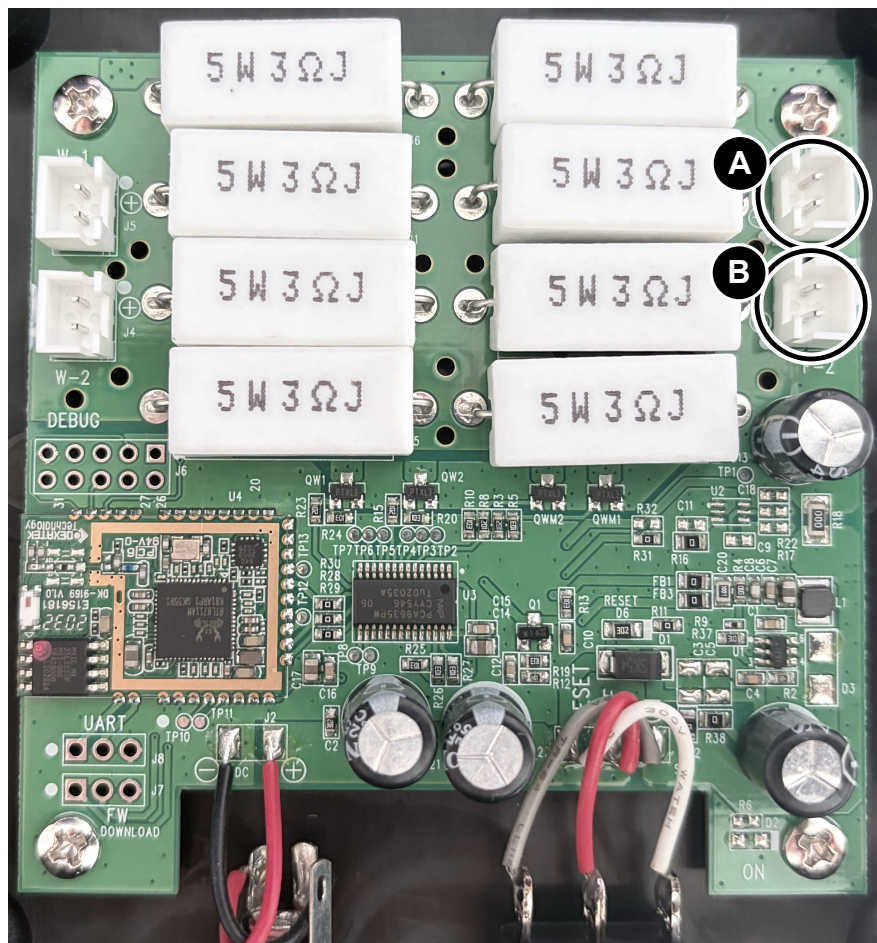


Original board photo; DC input wires at bottom.

A F-1 / J1

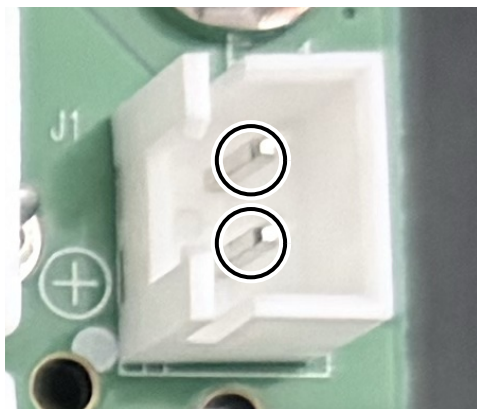

Upper right connector

B F-2 / J3

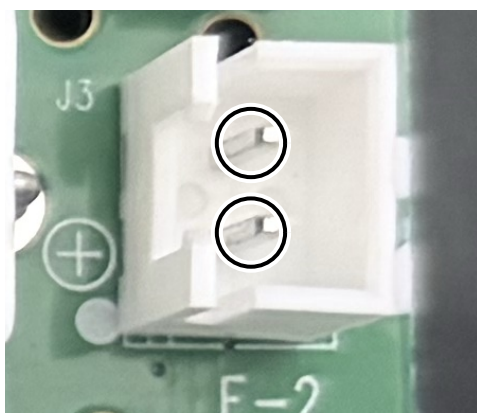

Lower right, above capacitor

ONE RESISTOR ACROSS EACH CONNECTOR

One lead to each circled contact's solder pad. Either direction.

The underside pads are not shown; follow the two connector pins.

Keep panel wires connected normally. Insulate exposed resistor leads.

Leave W-1/W-2 unchanged. Do not connect to GND, OE or the ESP.

WHILE OPEN: FLASH PREPARED FIRMWARE 0.1.4

Lamp/bench power + VBUS-blocked USB. Preserve NVS / Home pairing.

Check settled Off with status, registers and verify before fitting parts.

If PWM is nonzero or a fault appears, fix that before adding resistors.

Reassemble with power removed. Then check fades, low brightness and Off in a dark room. This is a trial; the glow fix is not yet proven.