



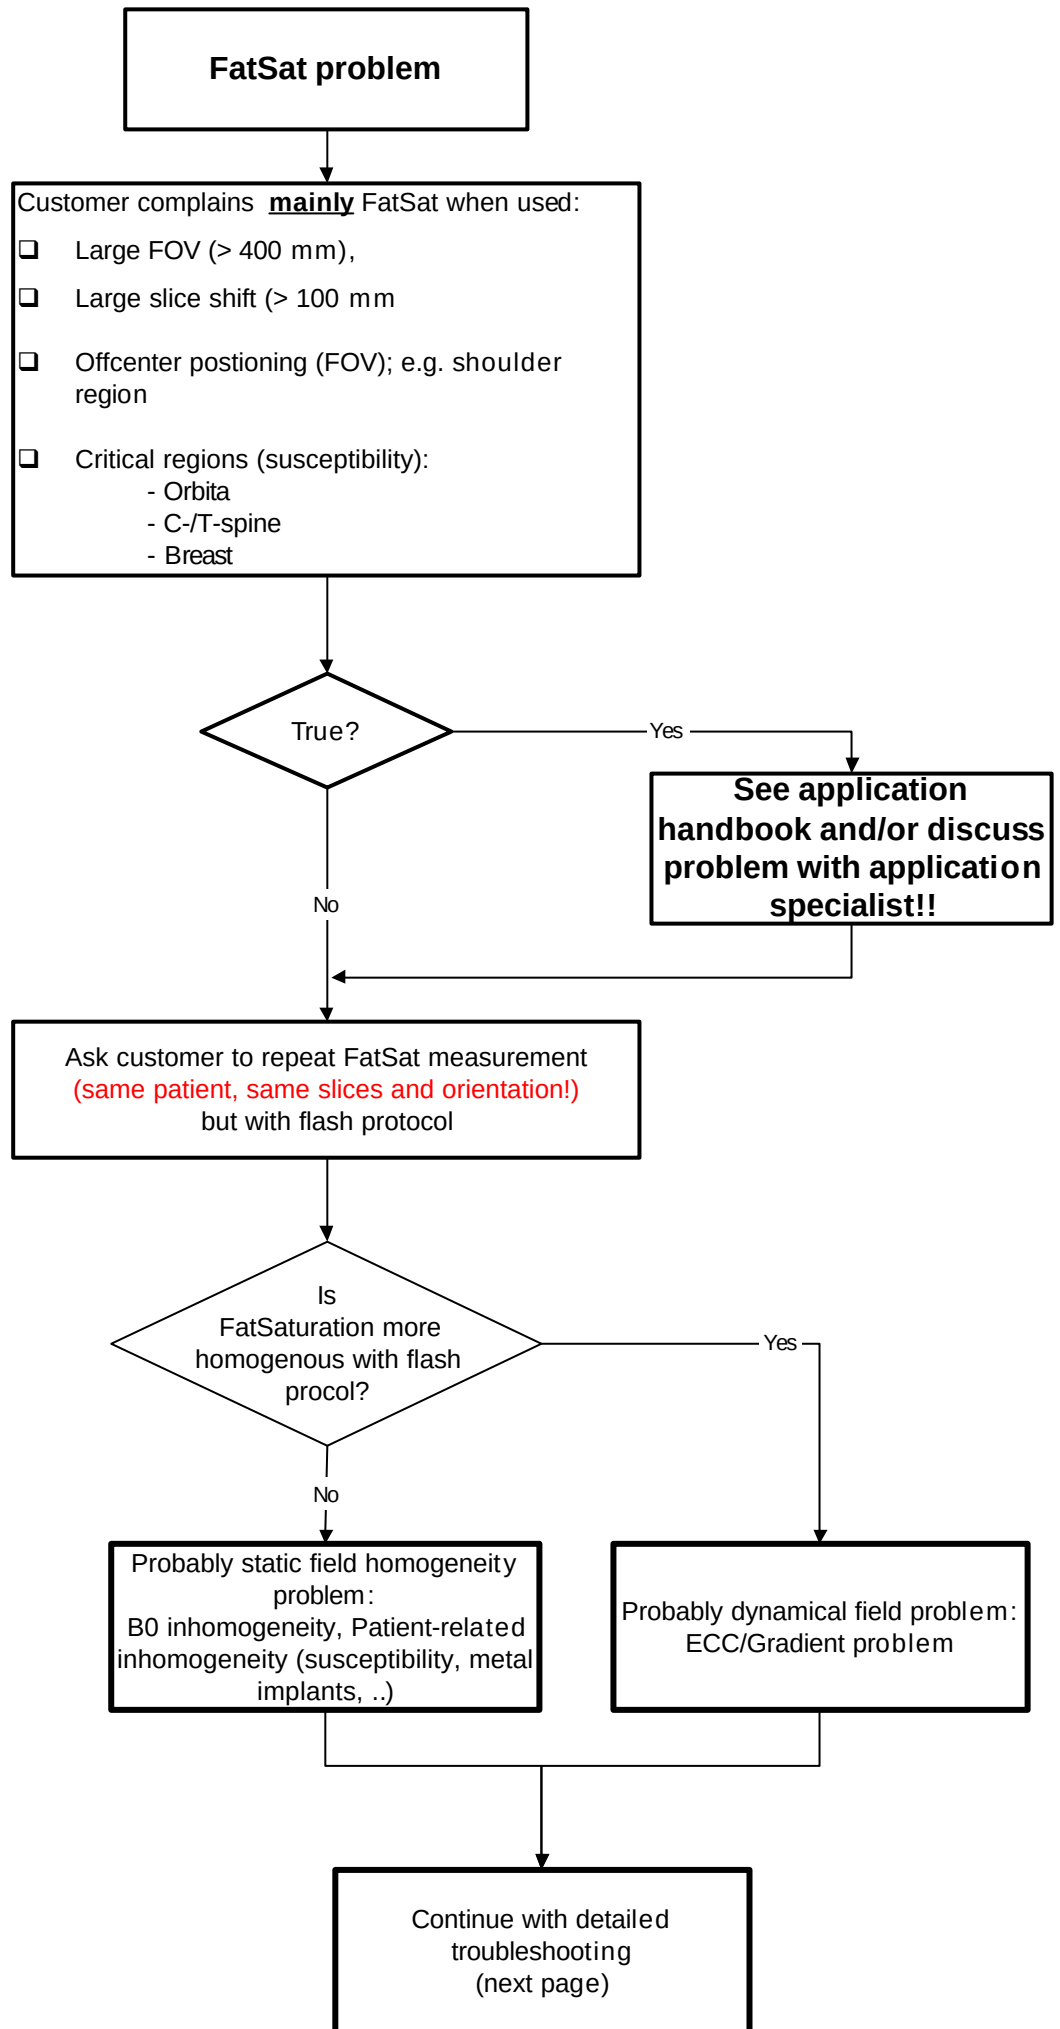


Detailed troubleshooting for FatSat

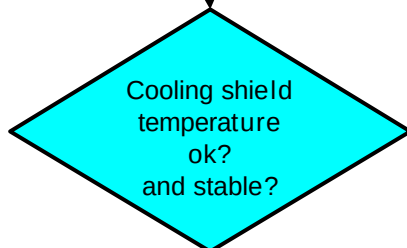

No


- ☐ Check coldhead
- ☐ Check compressor
- ☐ Power failure?, eg. over weekend

Yes

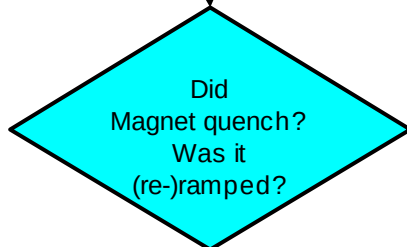


No

Perform Quality Assurance checks (BodyCoil)

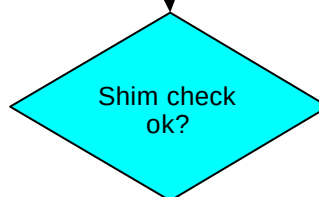


No

- ☐ Check Phantom positioning
- ☐ Check environment for static/dynamic magnetic field interferences
- ☐ Repeat TuneUp steps :
RF chara,
Regulator Adjust,
Phantom shim



Yes

Yes

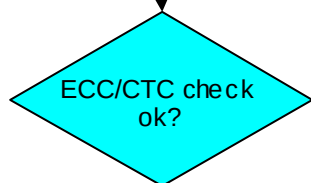

No

Yes

Check field homogeneity with Shim device/Re-shim magnet

Take care that

- EIS is resetted before
- GPA and Shim PSU are switched off
- A11 < 4 ppm (positioning shim device!)

Repeat TuneUp step: ECC Adjust

Attention!

For ECC adjustment system has to be in thermal equilibrium. Therefore do not perform TuneUp step ECC immediately after or during He filling or after magnet was ramped up.

Specification values for 2nd order terms

A20, A21, B21, A22, B22

*Without shim option:
1,5 ppm

With shim option:
0,7 ppm
Additionally all shim currents
< 1 A

Continue next page

FatSat: Continuing problem

Attention!

If you run FatSat check phantom has to be in rest for at least 10 Min.

FatSat check ok?

No

Perform detailed troubleshooting:
- SeSo: rf and gradient tests,
- QA (Expert Mode): Field stability

Yes

Run specific Quality Assurance tests with local coils

Purpose of this check is to find out if local coils influence magnetic field homogeneity.

1. Run FatSat check (BodyCoil) with small spherical phantom (without loader). Use the result as reference values for the following step.
2. Position spherical phantom close to coil element you want to check and run QA FatSat check (BodyCoil). Compare results with reference!!

Attention:

Small spherical phantom has to be close to magnet isocenter and in rest for at least 10 Min. Image results should be uniform in brightness!

Coil related problem?

Yes

No

Detailed troubleshooting necessary!
Call USC/HSC

Replace coil