

FCT SERVICE NOTE

SN05112916a

Class A Service information enclosed.

Date:

21 October 2005

Subject: VCT Systems- DCB may not be seated all the way into chassis


DCB may not be seated all the way into chassis. As a consequence the fiber optic cable that connects to the DCB may not mate properly.

Effectivity:


All VCT manufactured through December 2005.

Details:

The DCB cannot be seated all the way into the chassis because the fiber optic connectors on the DCB get hung up on an improperly aligned trim plate (5118563).

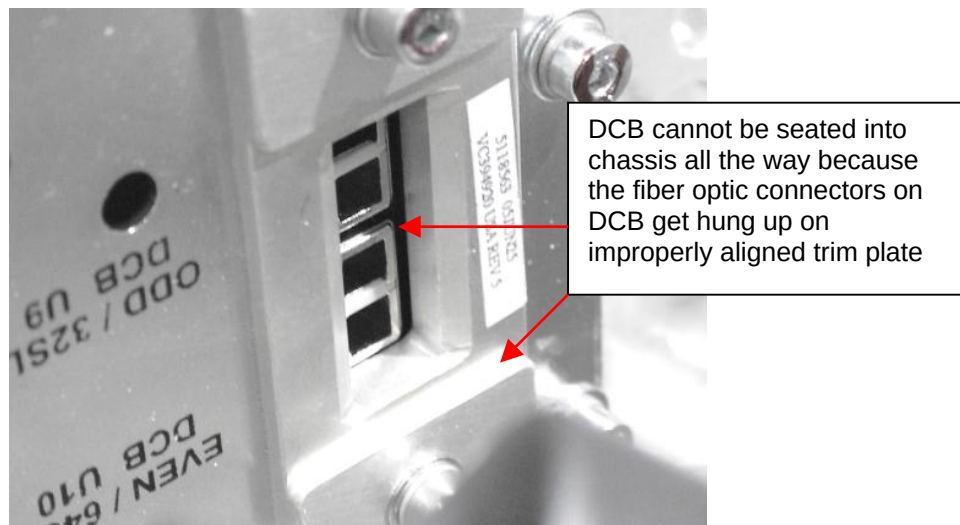


Incorrect DCB Configuration

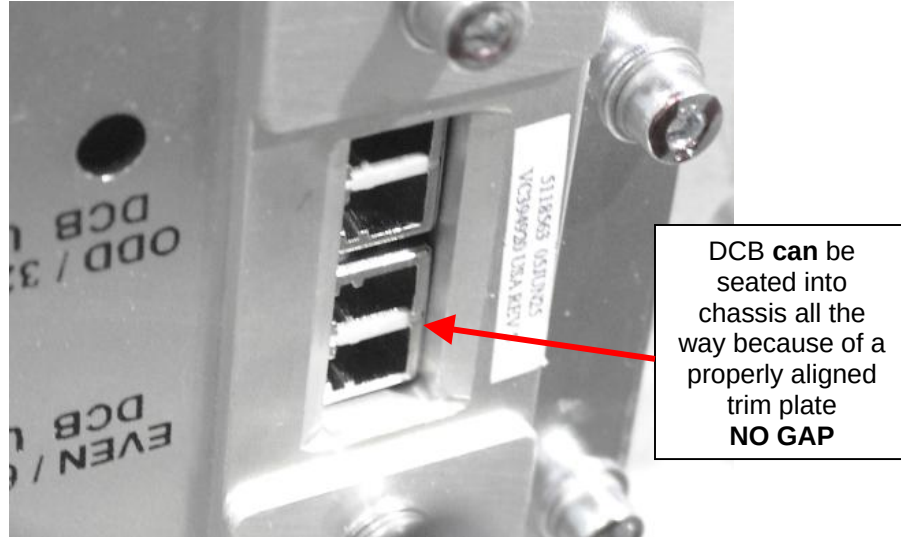


Correct DCB Installation

Resolution:

Remove trim plate before re-seating DCB into chassis. Then install trim plate (leave screws loose) and fiber optic cables to DCB connectors (U9 & U10). Tighten screws on trim plate.

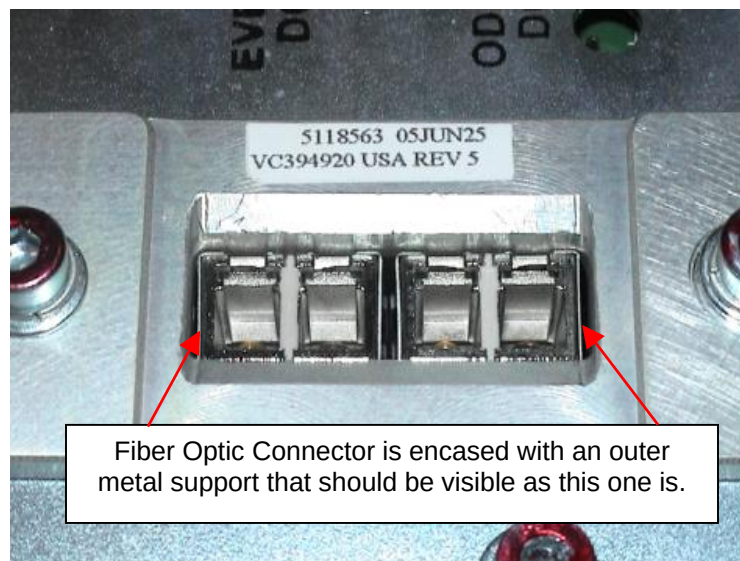

Correct DCB Installation

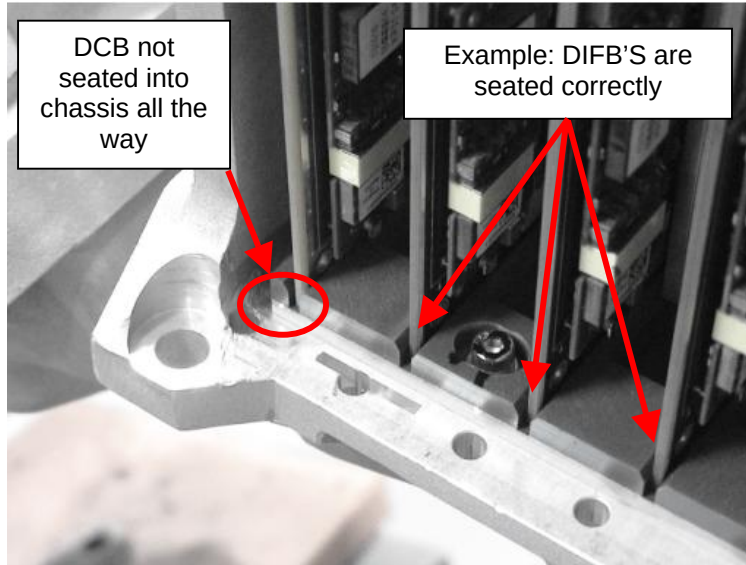

NOTE: You should hear 2 clicks when you install each fiber optic cable to DCB. By following the above procedure, your DCB will be seated all the way into the chassis and fiber optic cable will be seated (2 clicks).

Tom E. Neitzel
WSO CT Bay Adv Tech