

[new...](#) | [new revision](#) | [page status](#) | [copy](#) | [move](#) | [delete](#)

welcome!
ct tech pubs web page
ct water cooler
ct tech pubs updates
surveys
9800/hla
[highspeed family \(us\)](#)
ct/i
lightspeed family
yms family
all ct products
index
old ct emails
communiques pending
approval
customize
members

search:

advanced search
news: daily | weekly

go offline | chat | notify |
print | tutorial | help

home> [highspeed family](#)
(us)

Power Brush Block 2302508 Barrier Height Issue

[christopher hardiman](#) ([christopher c hardiman](#)), 07/08/2002 - 10:59 am



PROPRIETARY WARNING

This information is Property of GE - For GE Service Personnel Only.
Disclosure to third parties prohibited.

Communique Number

MQUE-5BJNRU

[Revision #CH-429A of [Power Brush Block 2302508 Barrier Height Issue](#) by [Christopher C Hardiman](#)]

Equipment

HSA, CT/i, LightSpeed QXi

Problem

The barriers that are between each of the brushes have been found to be excessively tall in three known cases. They are projecting between .5mm and 1mm higher than specified. This causes the barriers to rub against the slip ring barriers. Please refer to attached images for more details.

Corrective Action

Only about 3% of the brushes that have been ordered and installed in the last six months have experienced the problem. After installing a new power brush, manually check clearances by rotating the gantry by hand and observing that the barriers on the brush block clear the slip ring barriers by at least .8 mm. Since radial run out can vary from system to system, measuring the brush blocks may not be conclusive in all cases. IF ANY CONTACT OCCURS DURING MANUAL ROTATION, STOP, REMOVE THE BRUSH BLOCK AND ORDER ANOTHER TO REPLACE IT.

You can download any of the files below by dragging them to your Windows desktop.
To open a file for reading, double-click it.



Author

Christopher C Hardiman

Revision

07/08/2002 10:59 AM

[new...](#) | [new revision](#) | [page status](#) | [copy](#) | [move](#) | [delete](#)

Power Brush Block 2302508 Barrier Height Issue
Email Supporting Material

Refer to the figures below:



Figure 1. Damage Caused by Barrier Height Issue

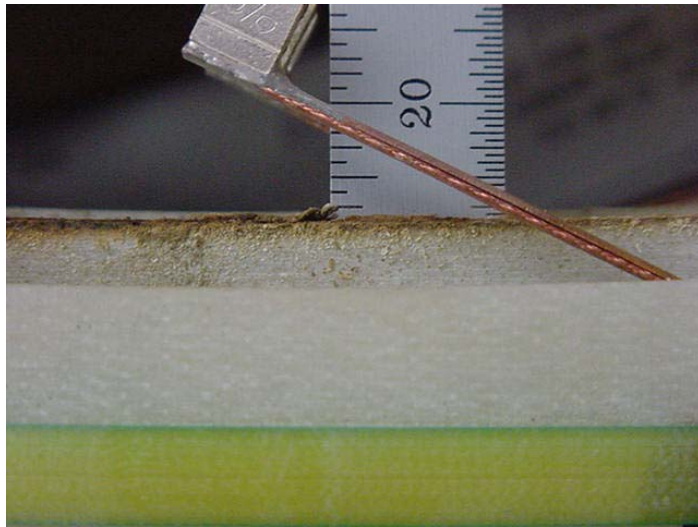


Figure 2. Barrier Height Measurement. Specification is 12 mm +/- .2 mm.