



Copyright © 2005 by General Electric Company, All Rights Reserved.

FMI Completion Certification Report

Mail To

GEMS - Americas

GEMS - Europe

G.E. Medical Systems
Attn: FMI Admin. W-523
P.O. Box 414
Milwaukee, WI 53201

GEMS - Europe
FMI Admin. 322
BP34
F78533 Buc Cedex, France

Send to your
Country FMI or Service
Administrator

FMI No.: 25355

FMI Title: HP80 & RT (Varian Tube) Quick Disconnect

Customer Full Name:

Number and Street Address:

City and Country:

Country Code

Site Number

System I.D.

Unit Tracked:

Model Number	Serial Number	Compl. Date DD/MM/YY	FMI Comp. Code	Service Hours	
				Labor	Travel

FMI Completion Code

1. Modification Complete or previously modified.
2. FMI not required per FMI instruction.
3. Not modified. Unit in storage. FMI kit returned to stock.
4. Modification refused or equipment altered. Customer signature and title required.
5. Unit location unknown or unit not in area. Product Locator notified.

Customer Refusal or Equipment Altered - Modification Pending.

Installer
Comments

Effectivity

The following CT Equipment is affected:

Gantry S/N	SID	Costumer	Country
00000332072CN8	TLB0127	Tilburg	NL
00000334875CN2	A5624105	Monzino	IT
00000336283CN7	406543LS16	St Patrick's	US
00000332070CN2	508771CCRT	Cape Cod	US
00000341514CN8	203688RTCT	Yale New Haven	US
00000330304CN7	404778CTRT	Emory	US
00000331235CN2	256737CTRT	CULLMAN REGIONAL	US
00000330304CN7	414805RTCT1	Froedtert	US
00000330015CN9	815226CTRT	St Anthony Medical	US
00000000071CZ1	617732RT	Brigham's & Williams	US

Purpose

The purpose of this FMI is to update the selected HP80 & RT LightSpeed 5.X systems that were shipped with incorrect Quick Disconnect. Corrosion build up inside steel plated quick disconnect may cause plunger to stick open, causing leakage of coolant during pump or heat exchanger replacement. This FMI will fix this issue.

Related FMIs

FMI Number	Title
25349*	Pressure Switch, Purge Kit
25350*	Pressure Switch, Purge Kit, Pump
25351	HPower M4 & Collimator Fix
25356	Smart ID Rev.2
25358	KV Board Replacement

Note *: Either or FMI will apply. Both of these FMIs have a Purge kits as a part of the kit.

Furnished Materials

Qty	Description	Part #
1	Teflon Tape	46-208982P1
1	FMI Document	5132036-100
1	Varian Male Quick Disconnect	5131420

Tool Required

Qty	Description	SW Version	Part #
1	Purge Kit	N/A	5122149


Personnel Requirements

"2" hours labor and "1" hours of travel

Procedure


Preparation or Before you Begin

1. **Overview:** The male Quick Disconnect being replaced in this procedure can become corroded, and stuck in the “open” position. A new design Quick Disconnect eliminates this failure mode.
2. Follow gantry positioning in this procedure closely – doing so prevents a faulty quick disconnect from leaking too much fluid.
3. The propylene glycol mixture in the heat exchanger is conductive – so be sure to catch it all. Only a few mL of fluid will leak.
4. Remove side, top, and front gantry covers.
5. Turn off the Axial Drive Enable, HVDC Enable, and 120VAC switches on the service switch board.
6. The quick disconnect that will be replaced during this procedure is circled in the following picture. Note that the pump’s disconnect will not be touched – only the heat exchanger’s male quick disconnect in this location will be replaced.

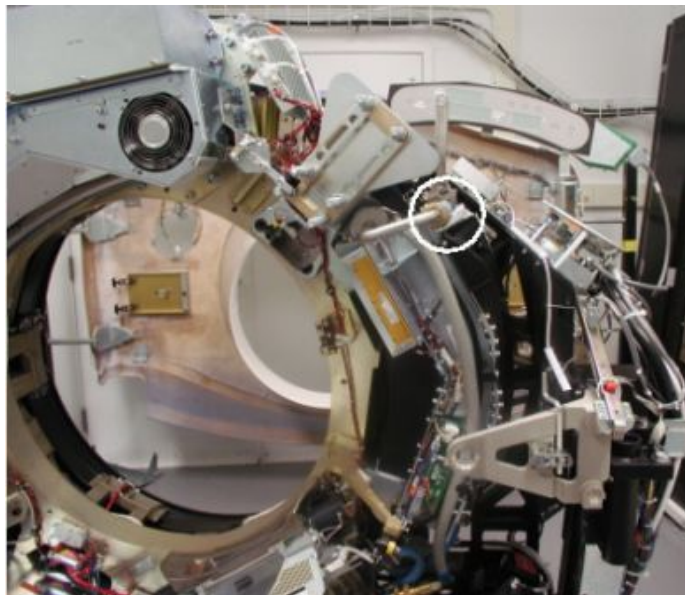

Replacement Procedure

1. Place the finger clamp on the black heat exchanger hose near the pump (this hose leads to the accumulation bellows). Turn the clamp to finger tight – you'll notice that the clamp might bend a little bit – this indicates the hose is successfully clamped off. The clamp prevents coolant flow from the heat exchanger accumulator during this procedure.

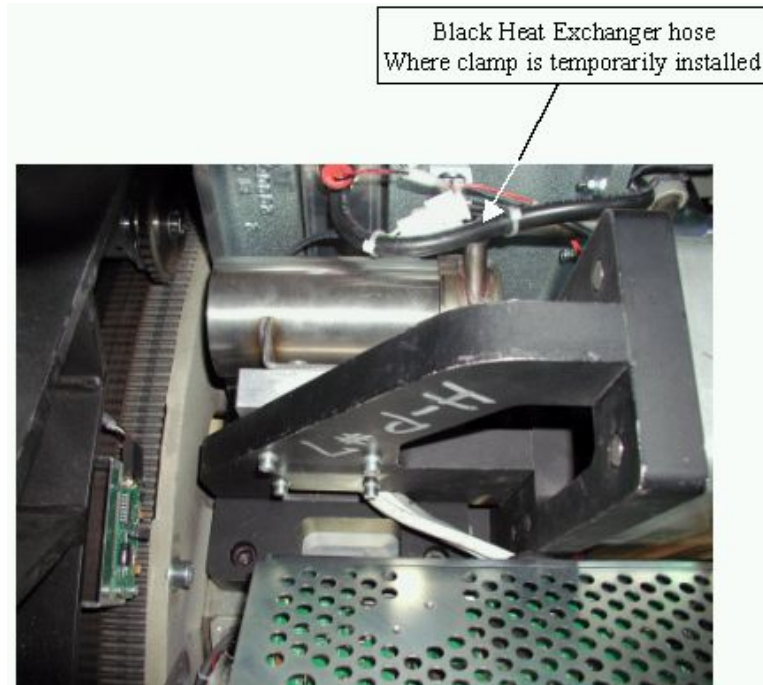

2. Position Gantry so that the Quick Disconnect is around 2 o'clock (you will be working in this area so position the gantry such that you can easily access the pump mounting screws)
3. Since access to the 4 pump mounting screws is easy in this gantry position, remove the 4 pump mounting screws, but do not disconnect pump.

IMPORTANT


Positioning the gantry in the following step is crucial – since gravity, combined with the clamp from step 1 will not allow excess fluid to spill if the Quick Disconnect is defective.

4. Rotate the gantry so that the quick disconnect is at the 12 o'clock position. Place an absorbent pad underneath the disconnect joint to catch residual fluid.
5. Disconnect the pump from the heat exchanger, absorbing any residual fluid that may come out (a few drops is normal). Leave the pump suspended on the gantry for the replacement.
6. Put the protective plastic cap from the new male quick disconnect onto the old one.
7. Move the gantry back into a workable position to loosen the quick disconnect (quick disconnect at 3 o'clock).
8. Using 1-3/8" and 1-1/8" wrenches (or equivalent – adjustable wrenches will work), loosen the male quick disconnect from the heat exchanger. Do NOT remove it yet. Note that the yellow ferrel in the short hose attached to the heat exchanger allows the quick disconnect to rotate without damaging the connection.

IMPORTANT

Positioning the gantry in the following step is crucial – since gravity, combined with the clamp from step 1 will not allow excess fluid to spill.

9. Rotate the gantry so that the quick disconnect is at the 12 o'clock position.
10. Place absorbent pad under the disconnect to catch any residual fluid.
11. Remove the QD. Catch any fluid in the absorbent pad (a few milliliters is normal for this step). See following image.

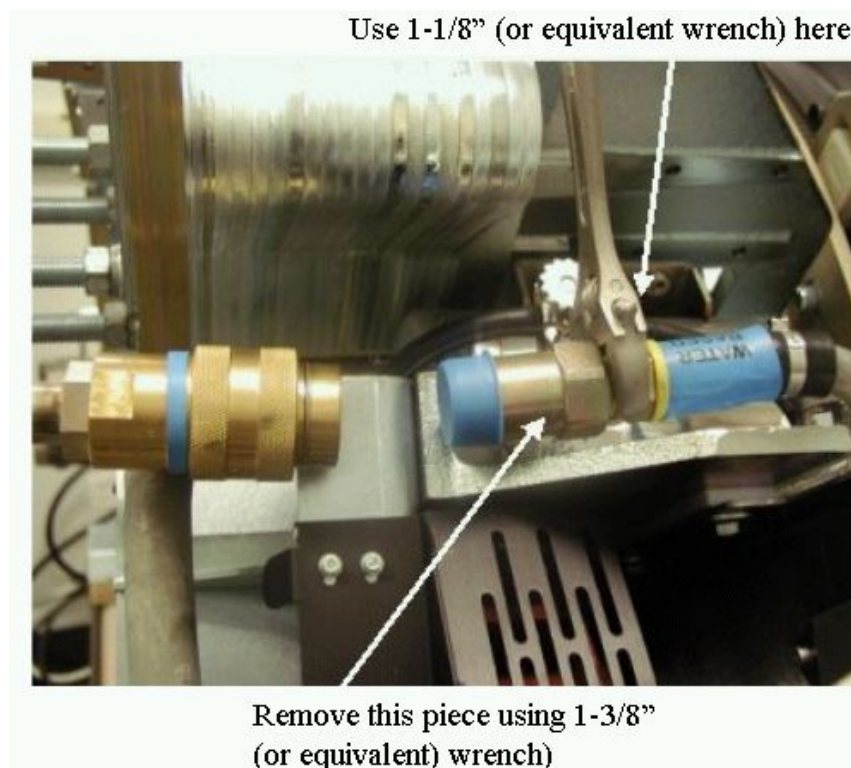

12. Prep the threads by wrapping the supplied Teflon tape around them – 2 to 3 turns is sufficient. Do NOT allow tape to cover inside diameter of hose fitting.

NOTE: The threads to prep are on the hose fitting that is still connected to the heat exchanger, not inside the replacement part.

13. Hand-tighten the replacement QD onto the hose. The joint will rotate when it is hand tight.
14. Using the two wrenches, tighten the QD 1.5 turns.
15. Wipe any residual fluid.
16. Reconnect the pump. Replace tie-wraps that were cut.
17. Install the pump mounting screws.
18. Remove the finger clamp.
19. Purge the system with the purge kit. Directions can be found in the LightSpeed 5.x RT or Pro 16 service methods manual under “Troubleshooting” -> “X-Ray Generation” -> “Heat Exchanger Purging (RT, Pro 16 80kW)”.

NOTE: Early versions of the service manual may not contain these instructions.

Latest revision for LS 5.x Pro16 (5113144-800) is revision 1. Latest revision for LS 5.x RT (5113142-800) is revision 1. This information is as of February 18, 2005