



ELLIS & WATTS INTERNATIONAL, INC  
4400 GLEN WILLOW LAKE LANE BATAVIA, OH 45103  
(513) 752-9000

10/10/01 SB-009

## **SERVICE BULLETIN**

### **Service Issue**

This issue applies to the units indicated by(X):

☐ US only  
☐ Foreign only  
☒ Universally


**The purpose of this bulletin is to address an important service issue relative to chiller functions:**

The following issues pertain to LC20M, LC20M/RAC, LC20M/WC, LC20MT, LC20MT/O, LC18MT/WC, model chillers:


1. During a recent service visit it was discovered that there is a jumper connected between terminals 11 and 22 on the dual pressure control for the refrigeration system (see attached photo). This jumper essentially overrides the safety switches of the control. **Effective immediately** we are requesting that all service providers visit each site **ASAP**, that has any of the above listed models to determine if this control has the identified jumper. If so, the jumper must be removed by cutting it as close to each terminal as possible.

Notes: 1. 24VDC is present on these terminals.  
2. DO NOT attempt to remove the jumper wire by loosening terminal screws without prior permission to shut down the chiller.

2. It has been brought to our attention that there have been occurrences of cracked Quick Disconnect (QD) fittings (see attached photo). This problem can occur on units with brass QD fittings. We are requesting that all service providers visit each site and inspect all QD fittings for cracks. Please contact E & W Service department with your findings (866-863-7784).

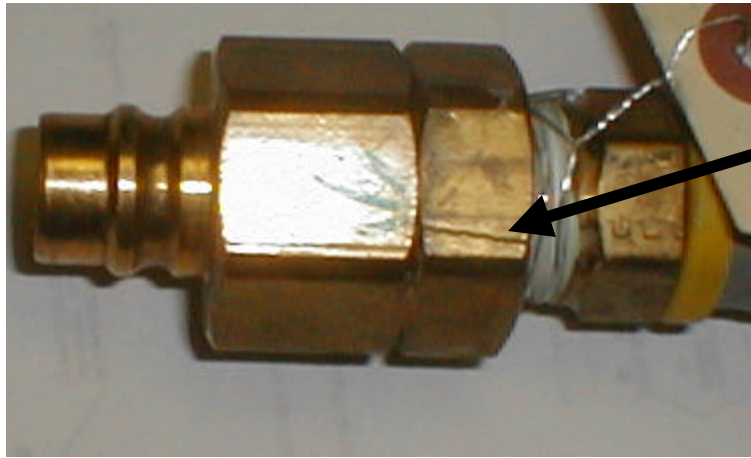

Crack  
location

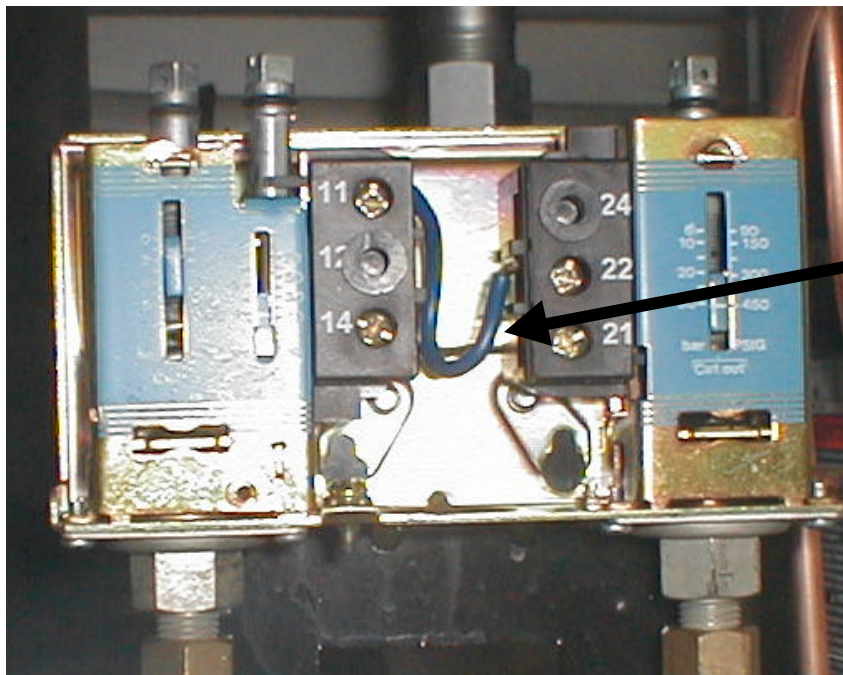

Remove  
jumper