

FCT SERVICE NOTE

SN 05121410a

Class A Service information enclosed.

Date: December 14, 2005

Subject: VCT Gantry GFI Breaker Wiring

Effectivity: VCT systems (7.x systems)

Details:

The Gantry GFI breaker has been wired backwards on most VCT 7.x gantries. The Load wiring is currently on the Line side. This wiring issue causes the Ground Fault Interrupt (GFI) functionality to not work. Due to this issue, the breaker will not trip for any Ground Fault issues.

Recent gantries shipped have been corrected by manufacturing prior to shipment, but we can't easily define exactly what sites received a gantry with the correct wiring. All VCT gantries going out as of Mid November 2005 should be wired correctly but should be check anyway to verify.

Resolution:

FMI 25376 will contain instructions for performing the rewiring of this breaker. In order to resolve this safety issue as soon as possible, this service note also has the instructions for rewiring the breaker. Please perform this procedure at your next site visit. As soon as the official FMI is deployed, you can then close it and charge your time off to that FMI. Closing the FMI will provide us with the verification that the work has been done on that site.

This procedure consists of the following steps:

- Test breaker using the test button, if it trips, you are done, if not, continue.
- Remove 2 wires from each side and put them on the opposite sides of the breaker.
- Power on Gantry and verify it now trips.

Shawn Ray
FCT Engineering
Steve Merritt
FCT Service Engineering

VCT Gantry GFI Breaker test and Rework Directions

1) GFI Breaker test

- a) Remove right side gantry cover and disable Axial Drive.
- b) With all power to the gantry still on, press the GFI test button. The GFI should trip and the gantry rotating side power should be off (will hear DAS/Detector plenum fans shut off). If it does, reset the breaker, put side cover back on and you are done. If the breaker does not trip, continue with section 2 of this procedure.

2) GFI Breaker rework procedure

- a) Make sure that all power is turned off to the gantry using LOTO procedures per service manual directions.
- b) Remove covers as necessary to access GFI.
- c) Remove GFI safety cover (2 screws on top of service switch panel bracket).

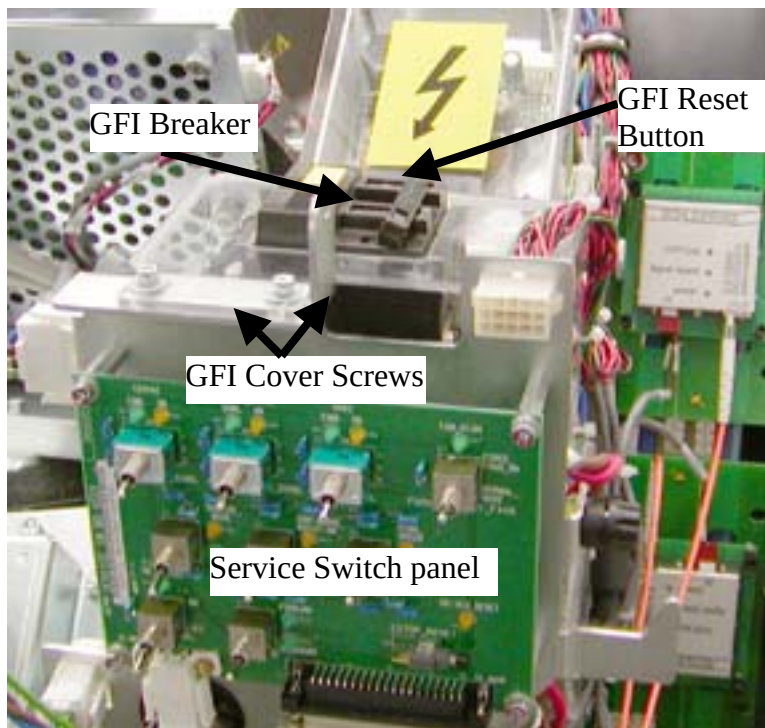


Figure 1 GFI breaker

- d) Remove wires from both sides of the GFI breaker.

- e) Insert wires from AC filter to the GFI breaker on the sliping side (see Figure 2) and tighten screws. Wires are labeled as 5118424.

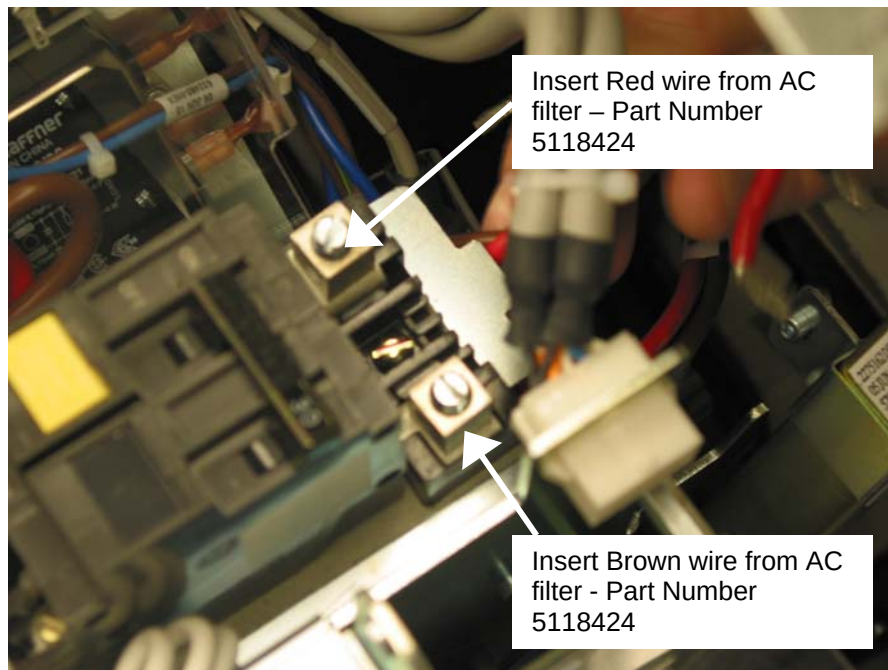


Figure 2 Wires from AC Filter

- f) Insert wires from Sliping Brushblock to the GFI breaker on the gantry front side (see Figure 3) and tighten screws. Wires are labeled as 5118296.

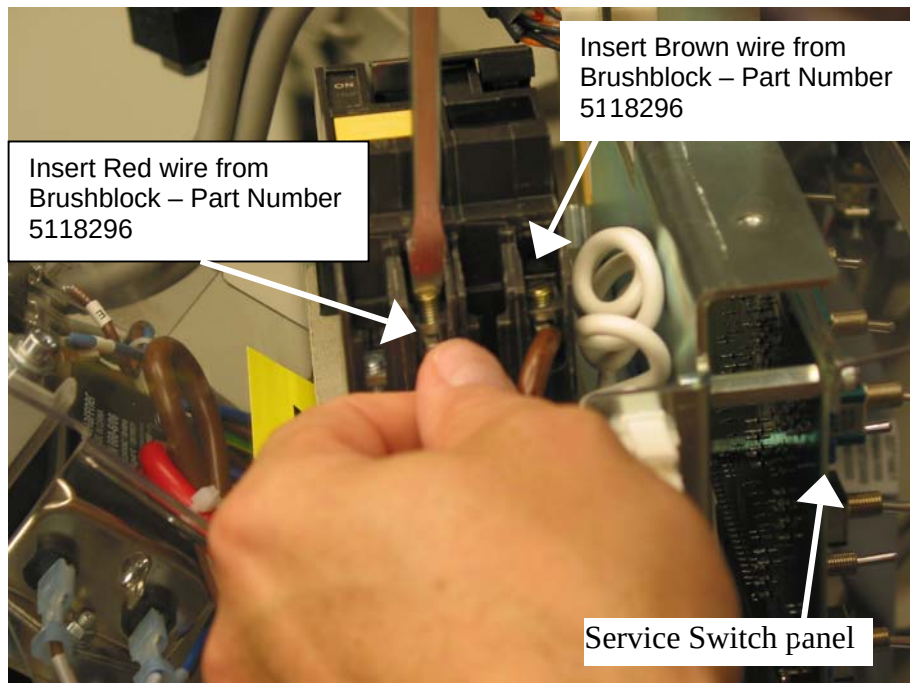


Figure 3 Wires from brushblock

- g) Reinstall the GFI plastic safety cover.
- h) Turn on power to the gantry and push the test button on GFI. The GFI should trip. If it does, reset the breaker, put covers back on and you are done. If it does not, recheck wiring per above instructions.