

FCT SERVICE NOTE SN06022713a

Class A Service information enclosed.

Effectivity: **LightSpeed VCT 64, 32 Slice and H-power Brush Block Alignment**

Date: March 4, 2006


Subject: Poor Slip Ring Brush Block Alignment 5.x and 7.x Systems

Issue: VCT and H-power Slip Ring Brush Block Misalignment is a leading cause of communication problems across the Slip Ring.

Cause: Brush Block to Slip Ring **Alignment is critical to ensure problem free operation.** VCT and H-power systems have Faster Rotation Speeds. The Faster Rotation speeds of 0.4 and 0.35 seconds have magnified the importance of proper Slip Ring Brush Block Alignment.

Resolution: Align the Brush Block assembly to the Slip Rings. See The Service Manual for the Brush Block Adjustment procedure, look under replacement procedures section. Perform this Brush Block alignment check on your next PM or when ever Slip Ring communication problem occur.

Adjustment setscrew

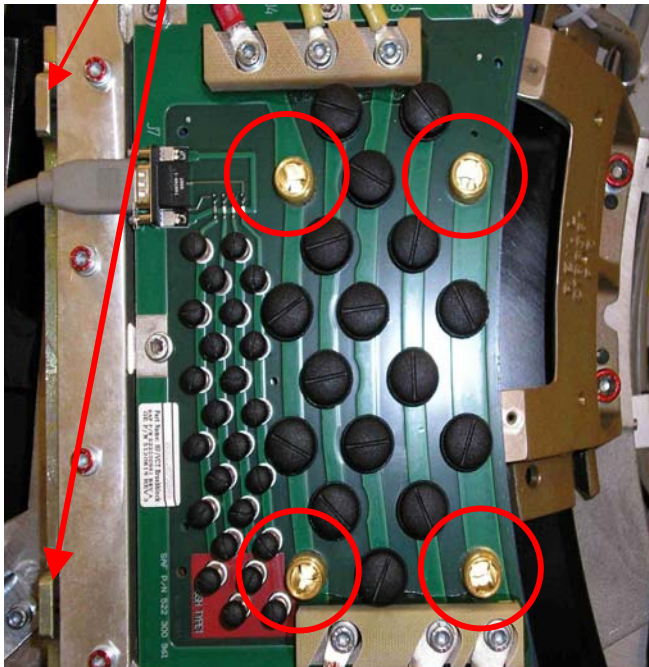

Note: Three Tips when Aligning the Brush block to the Rings

1. Carefully push brush block against the position adjustment set screws in the mounting bracket.
2. Remove (4) Power brushes (all four corners).
3. Use a flashlight to verify Brush Block position, adjust the brushes so they ride in the center of their tracks via the Adjustment Screws. Adjust the brush block setscrews if necessary to center the brush over the ring.

- Finalization

- Perform Cardiac Study to verify 0.35 or 0.4 sec Rotation scans.

Note: See the Service Manual Brush Block replacement procedure for further details.

David Palermo
Service OnLineCenter