

FCT SERVICE NOTE SN06051511a

Class A Service information enclosed.

Date: May 11, 2006

Effectivity: CT systems using the Performix Pro VCT 100 X-Ray tube (Hercules - D3194T).


Subject: Performix Pro 100 KW X-Ray Tube Coolant Hose Routing

Issue: Improper x-ray tube coolant hose routing could allow the oil coolant hose to contact the Gantry frame resulting in a loss of coolant oil and/or other Gantry damage. The purpose of the looped coolant hose on the cathode side is to allow flexibility when trying to reach the heat exchanger quick-disconnect during a tube change. If the black coolant hose is pulled into a coil that is too small, portions of the hose will contact the stationary portions of the Gantry during rotation. This contact could result in damage to the hose and possibly leak oil throughout the Gantry.


Resolution: The position of the loop in the coolant hose on the cathode end of tube must be maintained. The short-term solution is to have the field engineers make sure the looped hose extends above the lift bracket. A permanent poke-yoke solution will be released later. The Tube replacement procedure will be updated to make everyone aware of this potential issue in the future and the Service classes will be updated to inform FE's of the potential issue as well. If the hose loop is too tight, the hose should be adjusted to make the loop extend past the lift bracket (see pictures below).

Note: When performing major and minor gantry service always manually rotate the Gantry by hand to ensure no cables or hoses obstruct free rotation. Also, perform a Gantry rotational test at 0.4/0.35 seconds to ensure problem free operation.

The attached pictures show a failed hose with a tight loop, and an example of a properly looped hose.

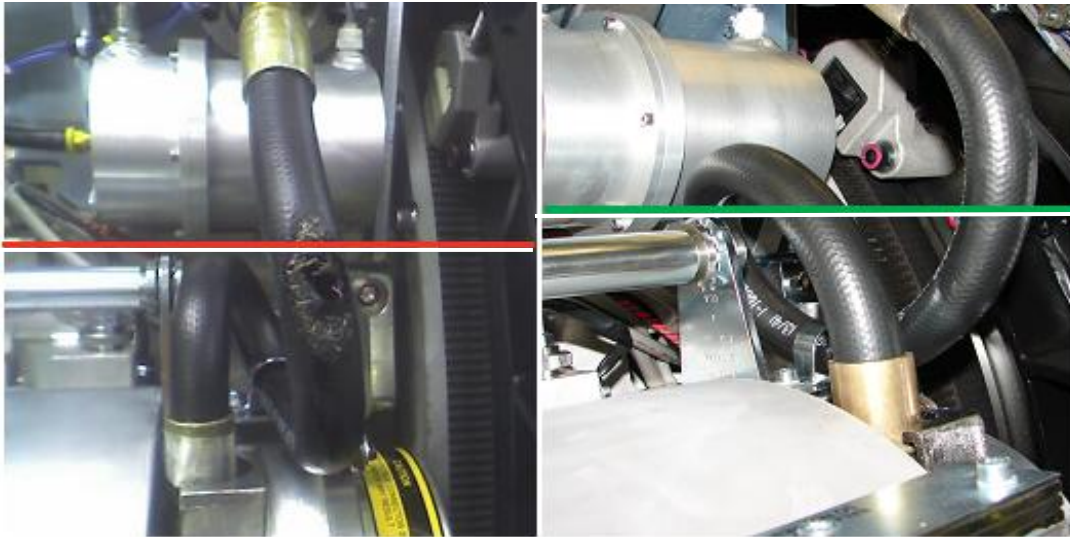

Side view: Improper (left) and proper (right) loop

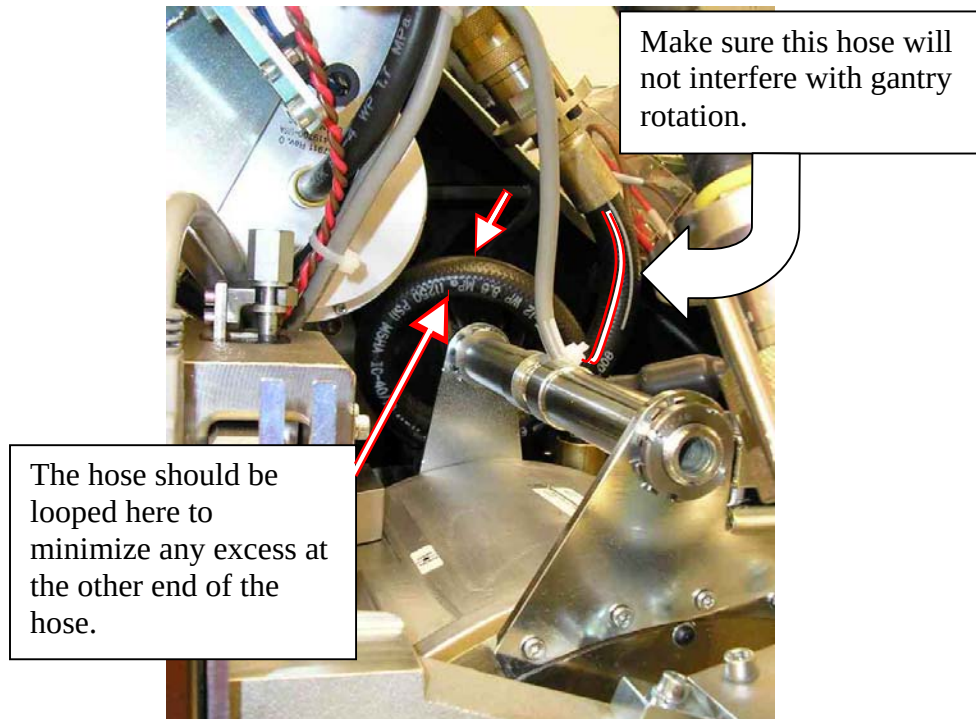

Front view: Proper Loop above Lift Bar the hose loop should extend above the Lift bar.