

820-0228 – Install Instructions for Cryo Comp. Flow Meter (P/N: 205-0121) GE P/N: 5156316

Tools Required:

- 7/8" wrench or slip wrench
- Adjustable wrench or slip wrench
- Tie Wraps (Lytron P/N 101601-01)
- 2' foam insulation tape

Removal Procedure:

1. Perform shutdown of system in accordance with Lytron manual #820-0190.
2. Lockout/Tag out system in accordance with GE procedures.
3. Drain system. Drain system in accordance with Lytron manual #820-0190. Alternate draining through the pump housing is also permissible.
4. Move Electrical Power Box out of the way by following Lytron procedure #820-0233.
5. Remove cabling to flow meter by disconnecting from Signal Box and cutting retaining tie wraps along wire route.
6. Disconnect incoming fluid from Cryo meter (top) by using the adjustable wrench and 7/8" wrench. (Refer to Photo 1)


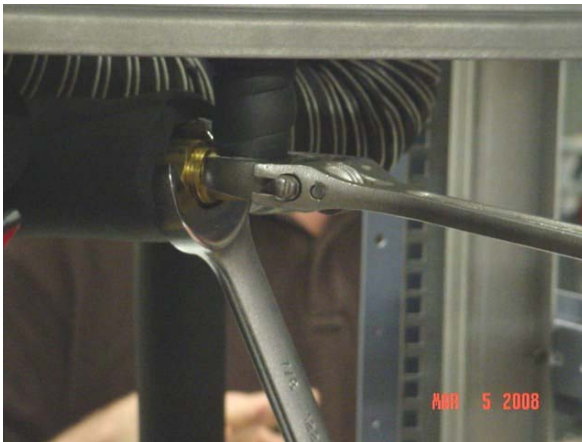


Photo 1

7. Disconnect outgoing fluid from Cryo meter (bottom).
8. Loosen 3/8" nuts securing Cryo meter (2 places).

NOTE: There are 4 flat washers and 1 lock washer per bolt. Care should be taken so that they do not drop into machinery.

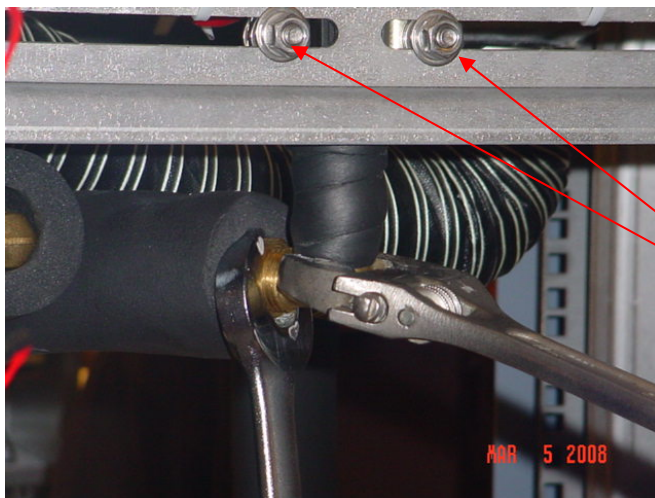

3/8" Nuts & supporting washers

Photo 2

9. After removing 3/8" nuts and supporting washers & bracket, remove the Cryo meter assembly from the top of the machine. (Refer to Photo 2)

End of Procedure

Re-install of Cryo Comp. Flow Meter (P/N: 205-0121)

1. From the top of the machine, place the Cryo meter so that it will easily mate with supply and return lines (top and bottom).
2. Use mounting bracket and 3/8" nuts and supporting washers that were saved during the removal of the old meter. Use 4 washers and a lock washer per bolt.

CAUTION: Do not over tighten the 3/8" nuts as this might impede flow through the meter.

3. Connect the upper and lower fluid connections using an adjustable wrench and a 7/8" wrench.
4. Route cable for Cryo meter along support beam toward the left edge of the machine. Secure with suitable tie wraps.
5. Continue to route cable until it terminates at the Signal box jack XX to jack 26. Secure with tie wraps.
6. Fill system in accordance with Lytron manual #820-0190.
7. Check for leaks around unit just installed.
8. Wrap exposed joints with foam insulation tape to prevent condensation.
9. Return machine to running condition per Lytron manual #820-0190.

End of Procedure