

FCT SERVICE NOTE

SN05080916a

Class A Service information enclosed.

Date:

14 September 2005

Subject:

Power cable (2363839-2) for slip ring transmitter may not have (Fair-rite) ferrite bead positioned or secured properly.

Effectivity:

HP60, HP100 & RT systems manufactured in Waukesha from approximately January 2005 to present.

Details:


The ferrite bead moves around when it is not secured properly. The cable becomes disconnected and cable damage may occur.

The transmitter is located on the slip ring and directly below it are 2 ty-wrap pads.

The ferrite bead should be ty- wrapped between these pads.

Resolution:

Inspect ferrite bead position. Remove right gantry side cover. Turn off axial drive & HV enable switch. Rotate gantry so that the center das chassis is approximately at the 1 o'clock position. You now should be able to see the transmitter though the opening in the upper slip ring cover. The opening in the cover is by the receiver.

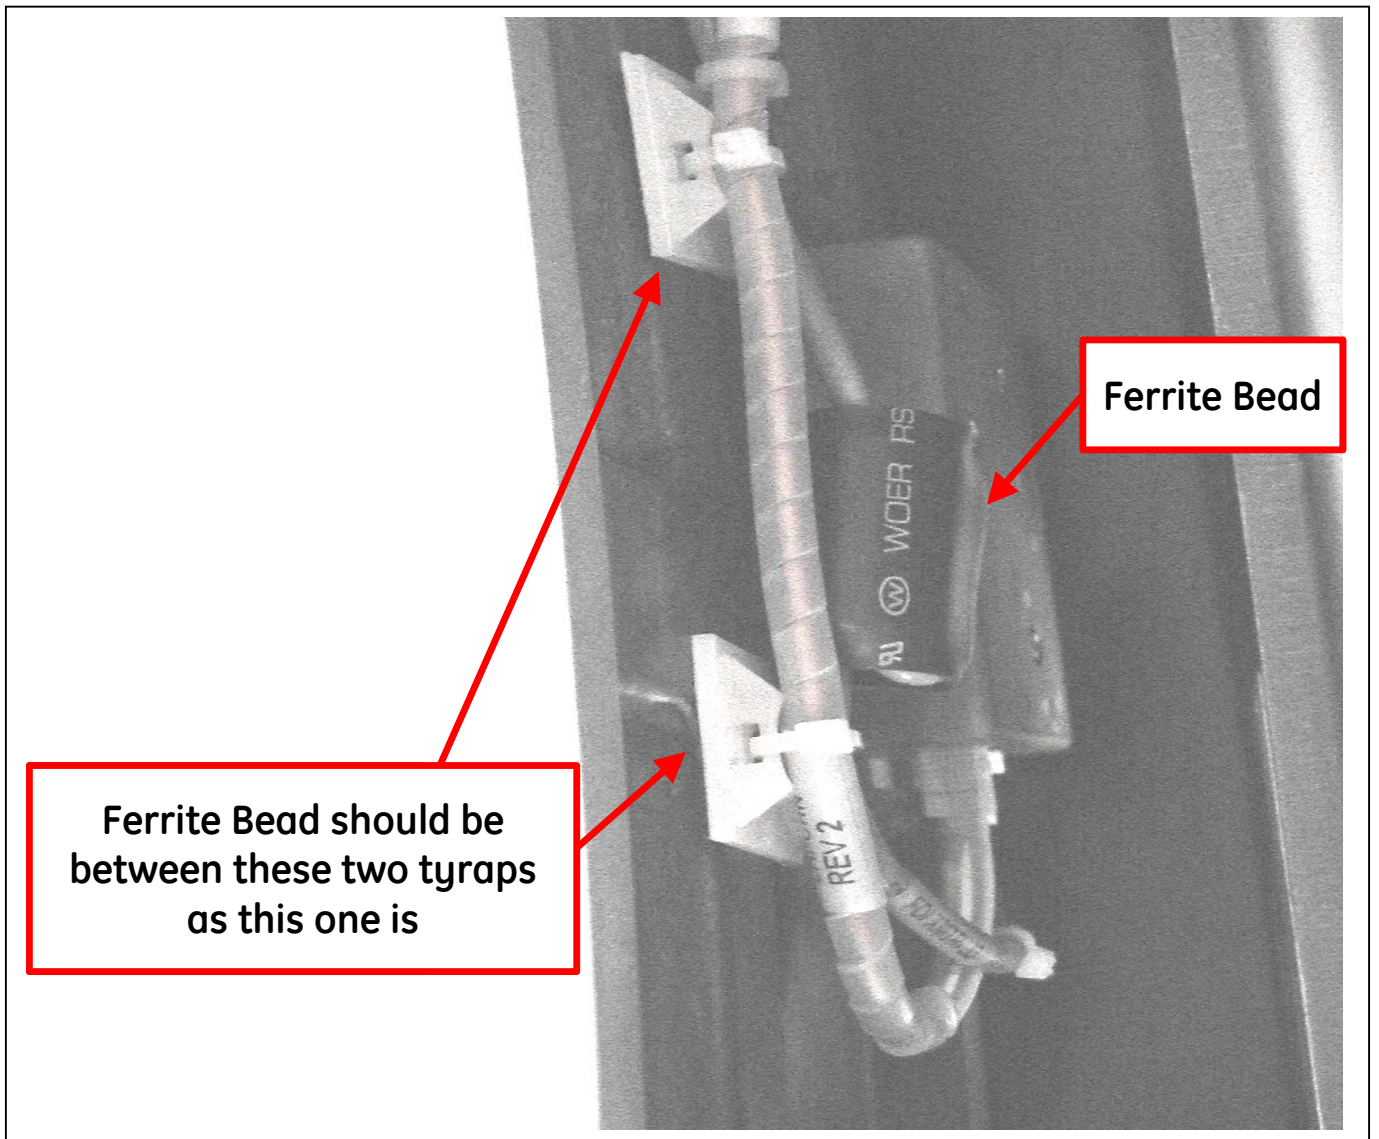

Tom E. Neitzel
WSO CT Bay Adv Tech