

FCT SERVICE NOTE

SN05110411a

Class A Service information enclosed.

Date: November 04, 2005

Subject: VCT POR Dial Indicator mounting bracket & Local FE Support actions.

Effectivity: VCT 32/64 slice systems

Details:

The POR mounting bracket has been found to vibrate loose and fall off during system operation. This has resulted in damage to the Detector Mylar window in one confirmed case. As with any loose object, other unspecified damage can also occur. Currently this part is not a FRU. Engineering is working to change this to a FRU Yes. Part # 5126933

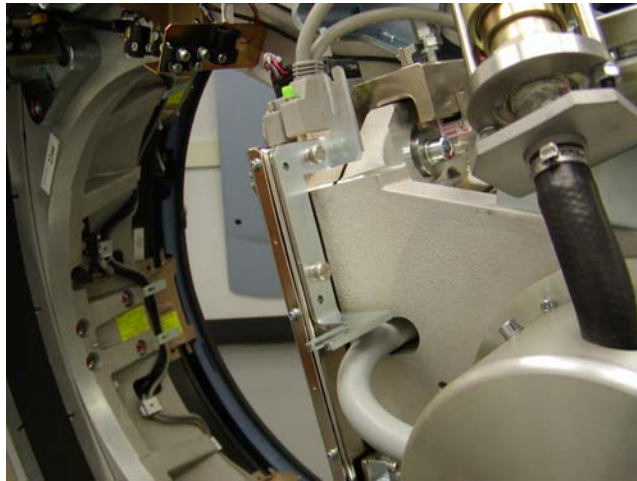


Figure 1 POR Bracket Location

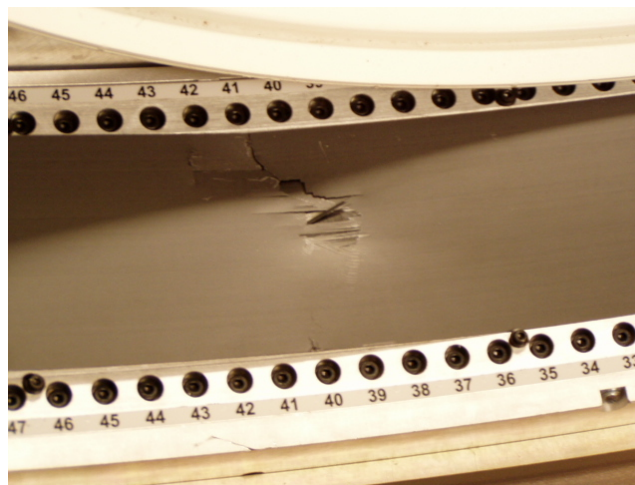


Figure 2 Damaged Detector Mylar Window

Resolution:

Upon system installation, PM, or any service call requiring Gantry cover removal, inspect this bracket to see if it is loose. It is recommended that this bracket be removed and stored in the provided Service cabinet until needed.

Place a piece of tape on the CCB sheet metal housing (under bracket location) and write the storage location of this bracket as a courtesy to your fellow Engineers.

Make sure to run the Gantry Balance Check to ensure no adjustments are needed.

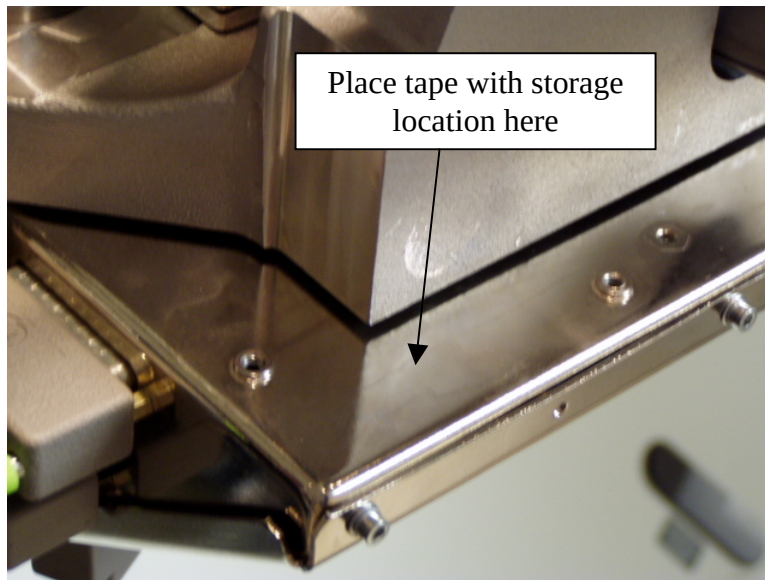


Figure 3 Tape and labeling location

Erwin Sulma
FCT Service Engineering