

[new...](#) | [page status](#)

welcome!
ct tech pubs web page
ct water cooler
ct tech pubs updates
surveys
9800/hla
highspeed family (us)
ct/i
lightspeed family
yms family
all ct products
index
old ct emails
[communiques pending approval](#)
customize
members

search:

advanced search
news: daily | weekly

go offline | chat | notify |
print | tutorial | help

home> [communiques](#)
[pending approval](#)

Upgrading From Maxoptic To Sony F551 MOD Drive

christopher hardiman (christopher c hardiman), 08/19/2002 - 08:13 am

**Priority**

4 - Tips, Parts, Surveys, etc.

PROPRIETARY WARNING

This information is Property of GE - For GE Service Personnel Only.
Disclosure to third parties prohibited.

Communique Number

MQUE-5D6HFZ

Equipment

LS Ultra, LS Plus, QX/I, CT/I

Problem

Maxoptic MOD Drive T3202KP will no longer be available as a CT FRU.

Corrective Action

The FRU level will be the new Sony MOD 2318598. See attached for further details on the upgrade procedure.

You can download any of the files below by dragging them to your Windows desktop.
To open a file for reading, double-click it.

**Author**

Christopher C Hardiman

Revision

08/19/2002 08:13 AM

[new...](#) | [page status](#)

LS Ultra, LS Plus, QX/I, CT/I: Upgrading From Maxoptic To Sony F551 MOD Drive.

This information is Property of GE - For GE Service Personnel Only. Disclosure to Third Parties Prohibited.

Subject: Maxoptic MOD T3 Drives

- Maxoptic MOD Drive T3202KP will no longer be available as a CT FRU
- The FRU level will be the new Sony MOD 2318598

Effectivity:

All CT/I and Lightspeed system using Maxoptic MOD 2260734-2 and T3202KP

Problem Description:

The MOD Drive fails to operate or operates intermittently.
Jams when inserting or removing a disk.
Failure to respond to operator commands

Corrective Action: On failure of your Maxoptic MOD drive ONLY, order the Sony MOD 2318598, new bezel 2138604-2 and follow the replacement procedure. Replacing the bezel should reduce the dust collection in the MOD and provide additional cooling.

Replacement Procedure

Remove all images from archive queue. The archive queue should now be empty.
Replace Maxoptic MOD with the Sony MOD.
Check MOD Drive Jumper Setting. (see page 2)
Reconfiguration System.
Test Archive By Saving Images.

Additional information available on Clarify CT-SOLUTION-028076 or in your system service manual.

Configuration

The Maxoptix and Sony MOD Drives are NOT Plug and Play devices. When the MOD Drive is replaced, reconfiguration must be run to assure proper operation. Failure to run reconfiguration will result in erratic operation due to a mis-match in the configuration file.

Note: UNIX / IRIX is case sensitive. Use the commands exactly as shown.

- 1) shut down CT application from the service desktop, utility, application shutdown
- 2) Open a unix shell and login as root [**su -**].
- 3) enter Password: [**#bigguy**]
- 4) enter [**reconfig**]
- 5) select [**config**]
- 6) select [**accept**]
- 7) Reboot [**yes**]
- 8) [**ST**]to restart applications (if auto boot is disabled)

Jumper setting

GE Specific Jumper Settings

GE specific settings for the Sony SMO-F551-SD MOD are shown in Figure 5-66. See Table 5-33 for descriptions of the Functional Switch connectors.



Figure 5-66 Sony MOD Functional Switch - GE specific settings

Jumper Descriptions

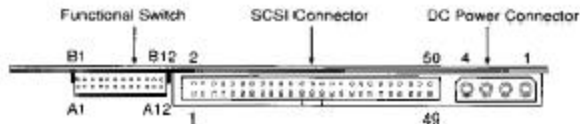


Figure 5-67 Sony SMO-F551-SD (MOD) connectors (Rear view)

A1	SCSI ID2	B1	GND
----	----------	----	-----

* This pin is NOT directly connected to the GND. Do not use this pin as GND. SMO-F551-SD drives the signal to GND level depending on the functional switch setting. Otherwise, the signal is not driven to GND level.

Table 5-33 Functional Switch Connector Pin Assignments (Sony MOD)

A2	SCSI ID1	B2	GND
A3	SCSI ID0	B3	GND
A4	Disable SCSI Parity	B4	GND
A5	Disable Write Cache	B5*	Reserved
A6	Disable AUto Spin-up	B6*	Reserved
A7	Force Verify for Write command	B7*	Reserved
A8	Disable Manual Eject	B8*	Reserved
A9	Enable Fast SCSI	B9*	Reserved
A10	Device Type	B10*	Reserved
A11	Enable Termination	B11	GND

A12 Terminator Power

B12 Terminator Power Source

* This pin is NOT directly connected to the GND. Do not use this pin as GND. SMO-F551-SD drives the signal to GND level depending on the functional switch setting. Otherwise, the signal is not driven to GND level.

Table 5-33 Functional Switch Connector Pin Assignments (Sony MOD) (Continued)

Useable Media Type / Size

The recording media listed below is available through DIA for the Sony MOD. MOD brand may vary. Larger media sizes are not software supported.

1.2 GB Media

2.3 GB Media

User Drive Tray Bezel

Ultra consoles use a bezel 2138604-2 that will improve airflow within the user drive tray and reduce dust accumulation in MOD and CD Rom drives. This bezel is compatible with CT/I / QX/I and Lightspeed Plus consoles

