

2244591 ERROR: HFA-PS OverVoltage Fault.

Indicates a problem with:

- HFA
- HFA Power Supply
- PDU or Incoming Power

Extended Error:



Look at the fault LEDs on the front of the HFA-PS. If the fault is **BUS_OV**, this indicates an over-voltage on the 420V 3-phase input to the Power Supply. If this is a hard failure (does not go away with a TPS Reset), try the following:

- 1.) Check the input power to the Power Supply. If the voltage is not 420V +/-10%, check the Input Select taps on the PDU.
- 2.) Replace the Power Supply.

If the failure is intermittent, there may be improper airflow to the HFD cabinet, or a problem with the incoming power. A Dranetz® power monitor should be connected at the Power Supply input to monitor the power quality. If transient voltages above 565Vrms are present, the problem is due to the incoming power quality. Contact a local Power & Grounding representative.

If the fault is **OV X**, **OV Y**, or **OV Z**, this indicates an over-voltage on the Power Supply's DC outputs to the SGAs. If the fault occurs intermittently, it may be fixed with FMI #60607. Otherwise, the cause could be the SGA/HFA, Power Supply, or DC Cables between the Power Supply and HFA. Use the following sequence to isolate the bad part:

1. Check that all of the DC output cables are fully seated at Power Supply and HFAs.
2. Swap both DC cables between the failing axis and either of the other axes, *at the SGA/HFA* (it may be necessary to cut wire ties), and reproduce the problem. If the fault changes axes, replace the HFA.
3. Return the cables to normal at the HFA, and swap them at the Power Supply. If the fault changes axes, replace the DC cables. If it still remains on the original axis, replace the Power Supply.

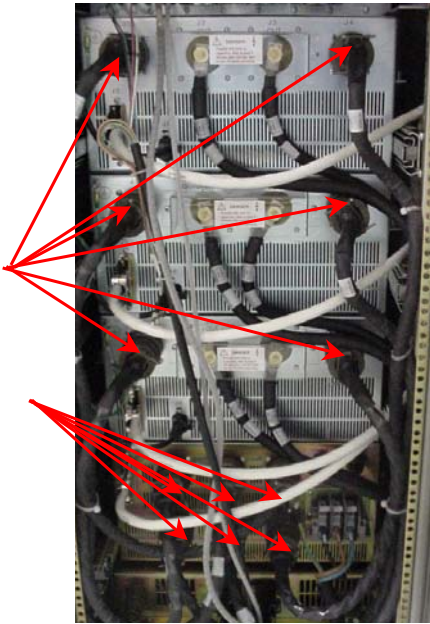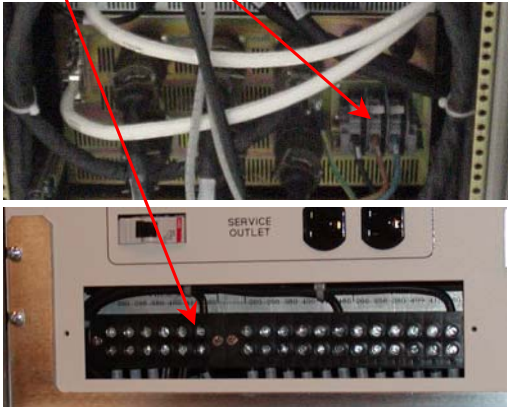

(Note: If you do not see a red LED indicating an OverVoltage Fault, remove the JP1 jumper from the Power Supply Control Board. This will prevent the GP/GP3 from clearing faults on the Power Supply. You can use the Reset pushbutton on the front of the Control Board to manually clear faults.)