



Correcting Rings Artifacts caused by Bad Detectors

This procedure is for finding bad detectors, and placing them on the bad list. This procedure shouldn't be use for correcting banding artifacts. A banding artifact looks like a ring artifact except it is wider and caused by entire module being bad or modules not powered up.


1. Login to System as "philips_service"
2. Double Click on "Scanner Application" Icon on the desktop
3. After Scanner Application completely boots Click on "Home"

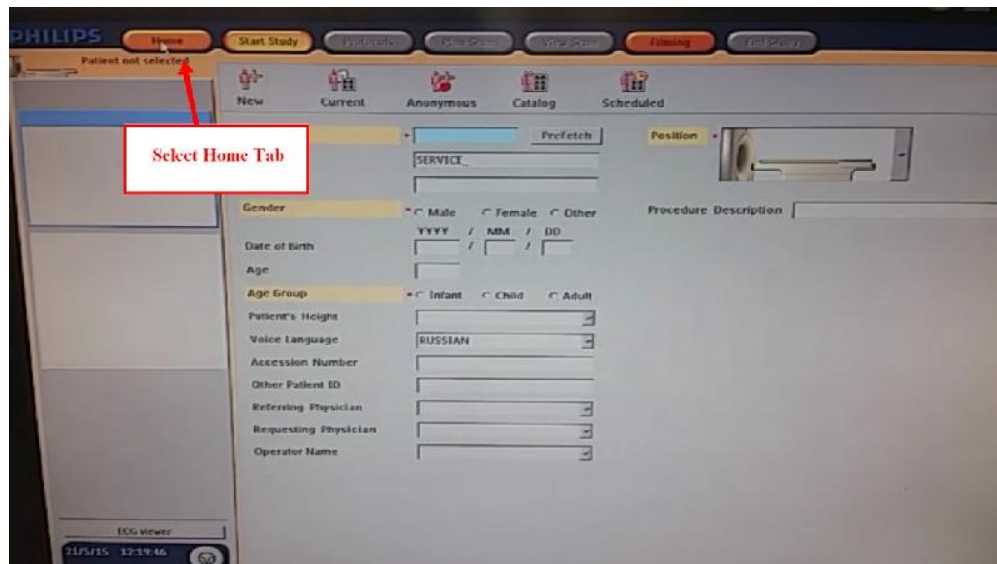


4. Click on Diagnostics Tab

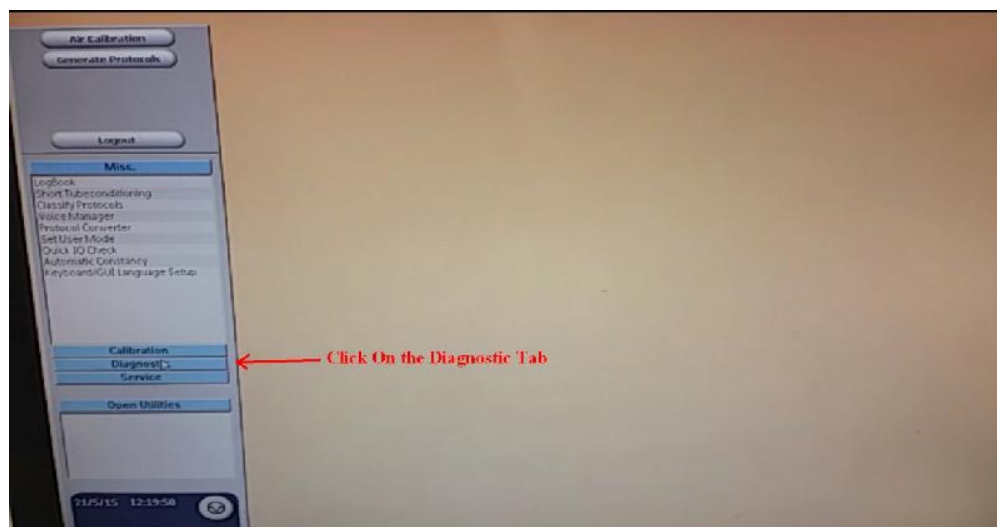


5. Click on FEE Detector test

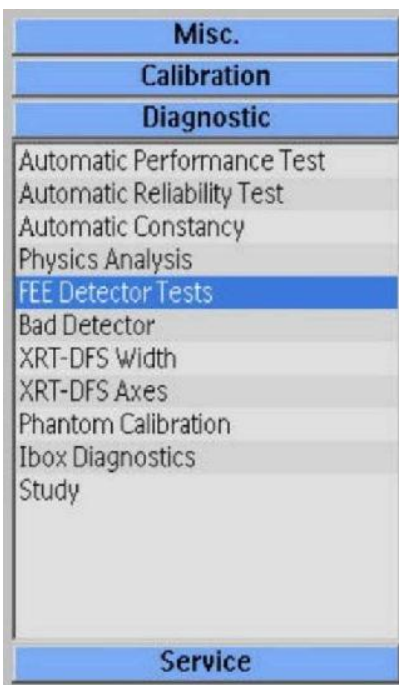


6. Next, select from the FEE Detector Test screen the “Dead channels test”

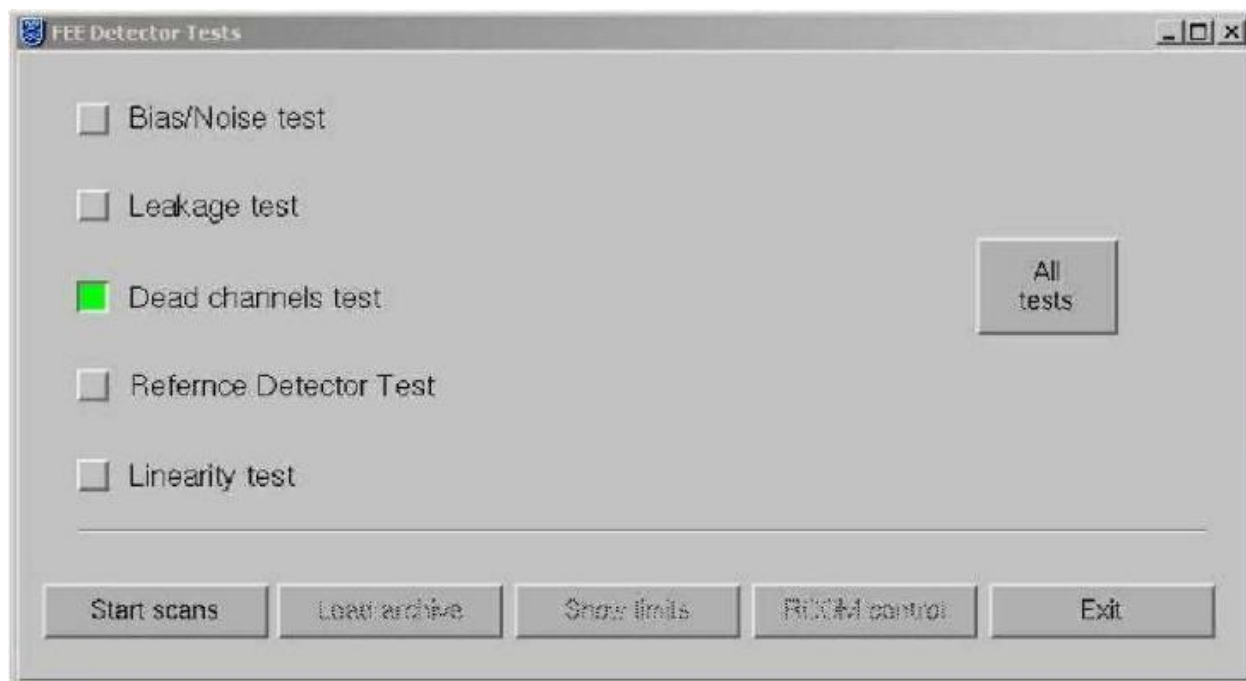


7. Press the “Start Scans” button.

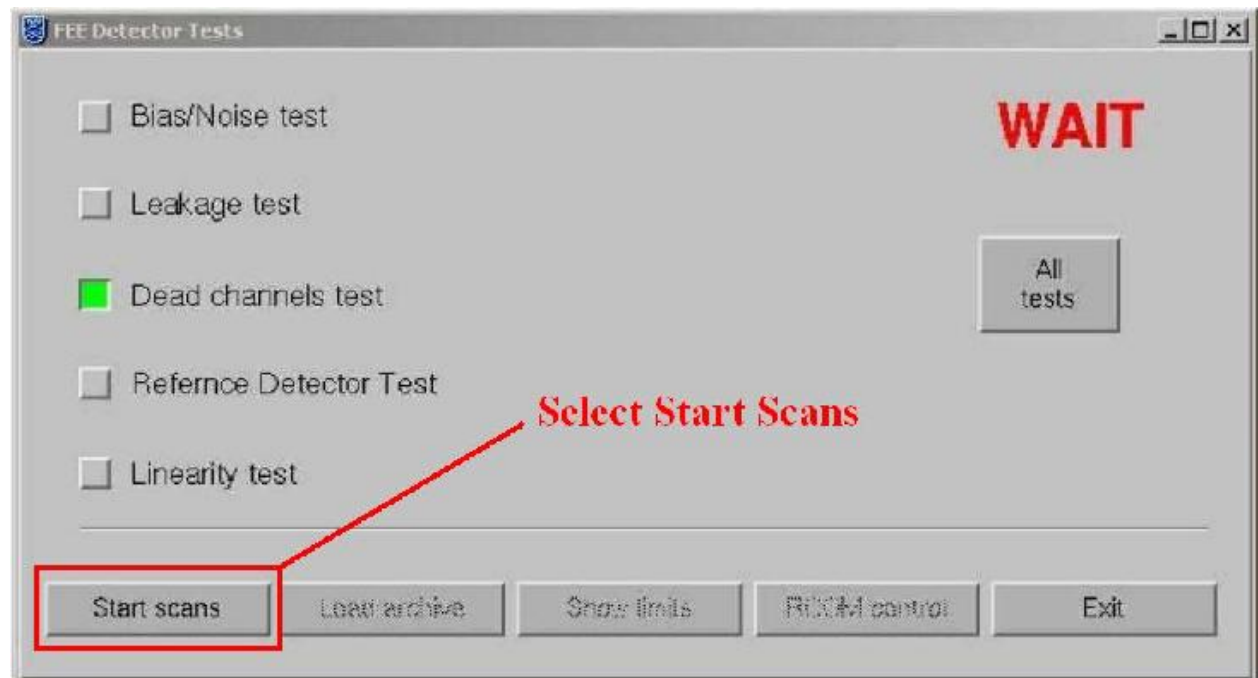


8. A warning prompt may appear, follow the information within the prompt and press the "Start automatic scans" button.

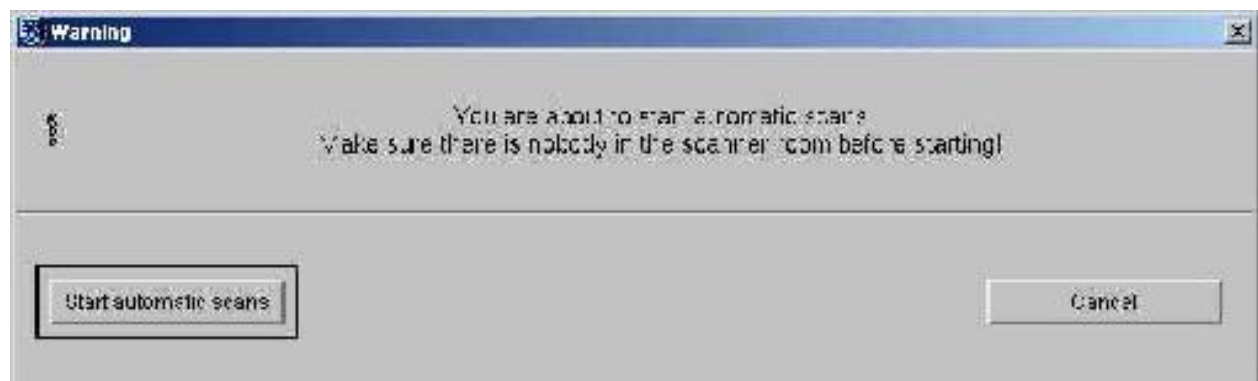

9. Change the protocol by selecting the “Advanced” tab and select the appropriate collimation for the system then press the “GO” button.

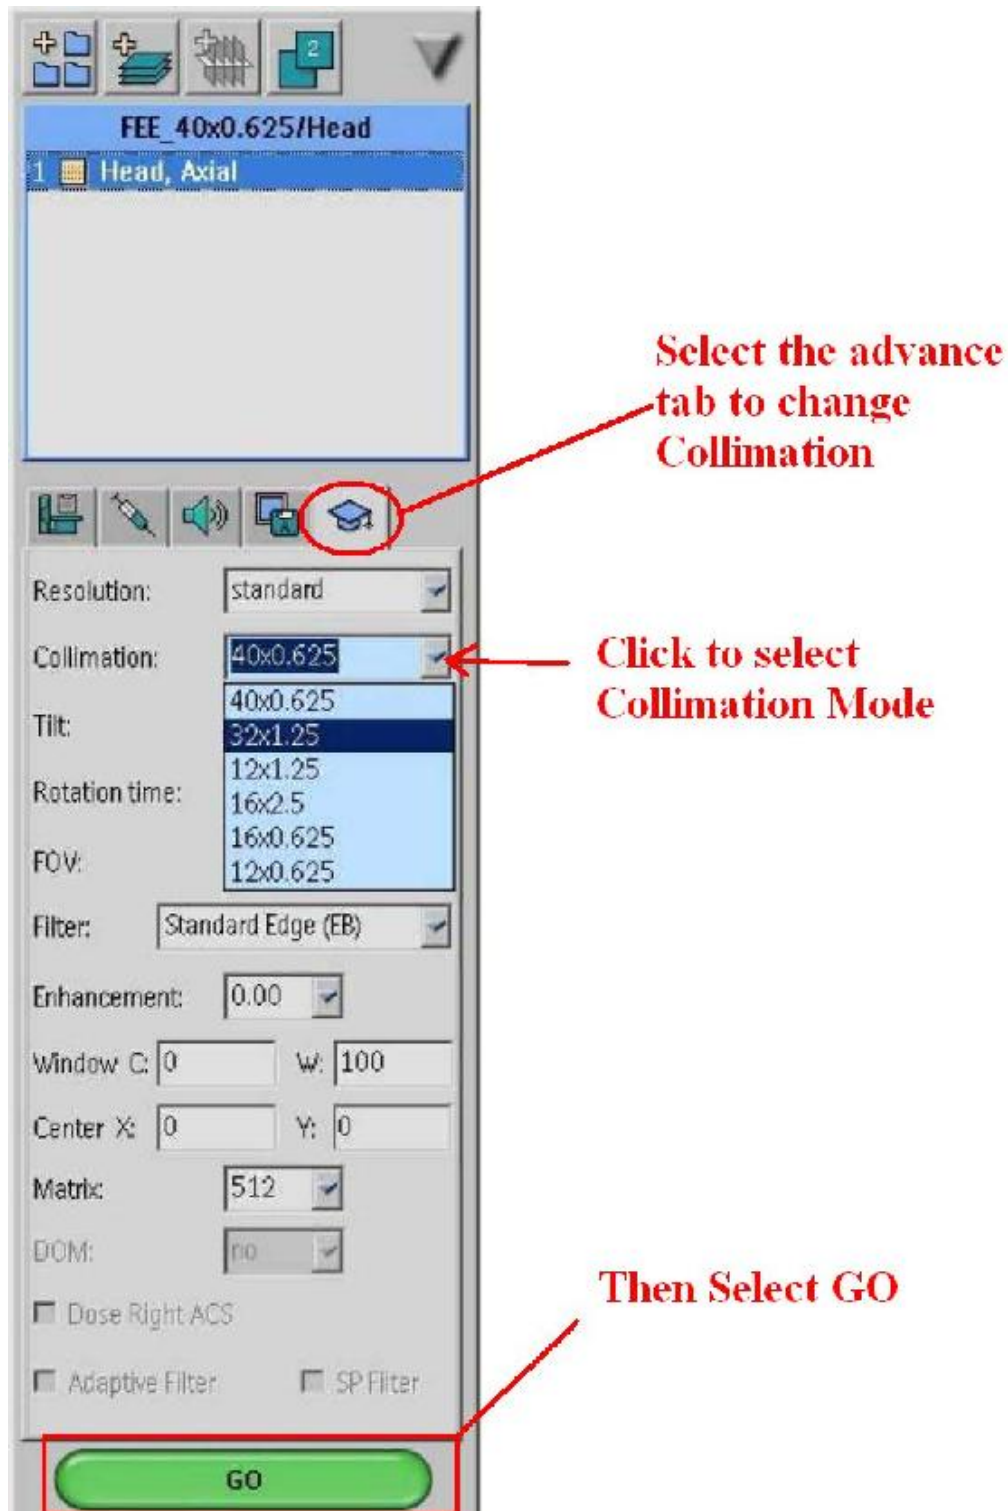


10. When the acquisition has finished, a list of failed channels will pop up. If there are any failures listed then they will need to be added to the Bad Detector list following the steps below. Record the Slice Number and Detector Number for each bad detector listed or leave the Result window open.

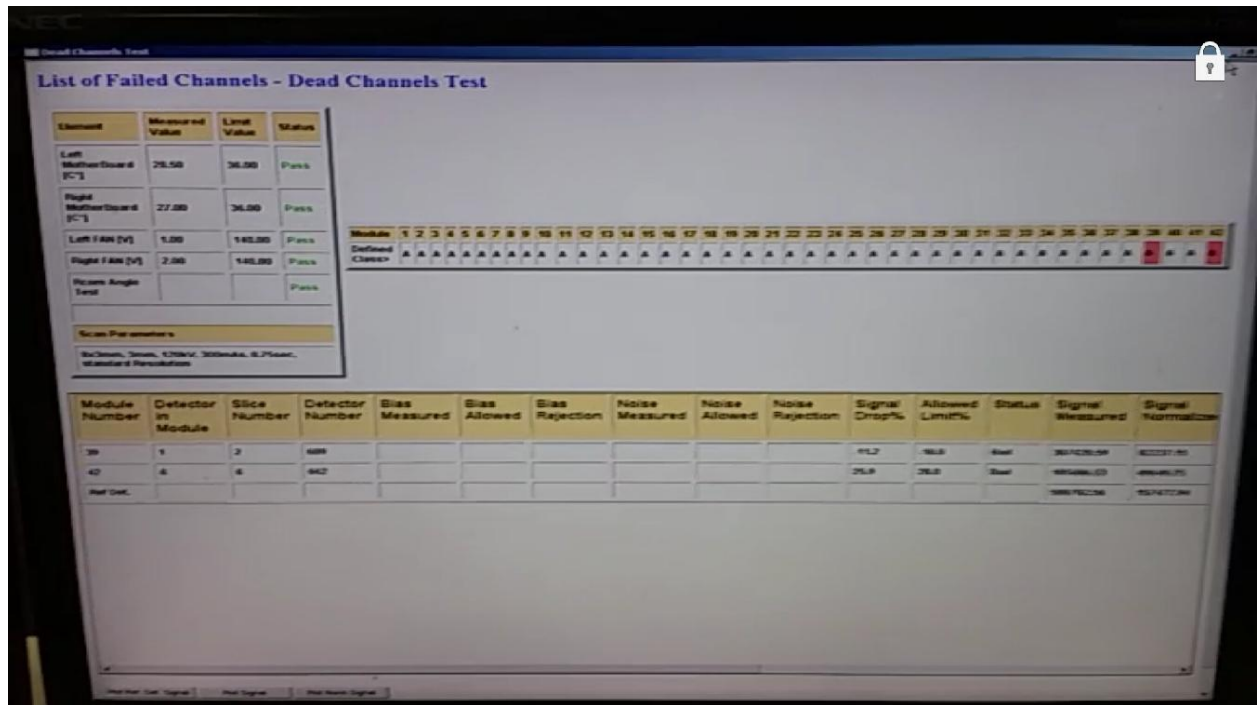


Example:

SLICE NUMBER	Detector Number
2	609
6	662

11. Repeat Dead Channel Test for the remaining collimations modes by clicking on start, and changing the collimation under the advanced tab.

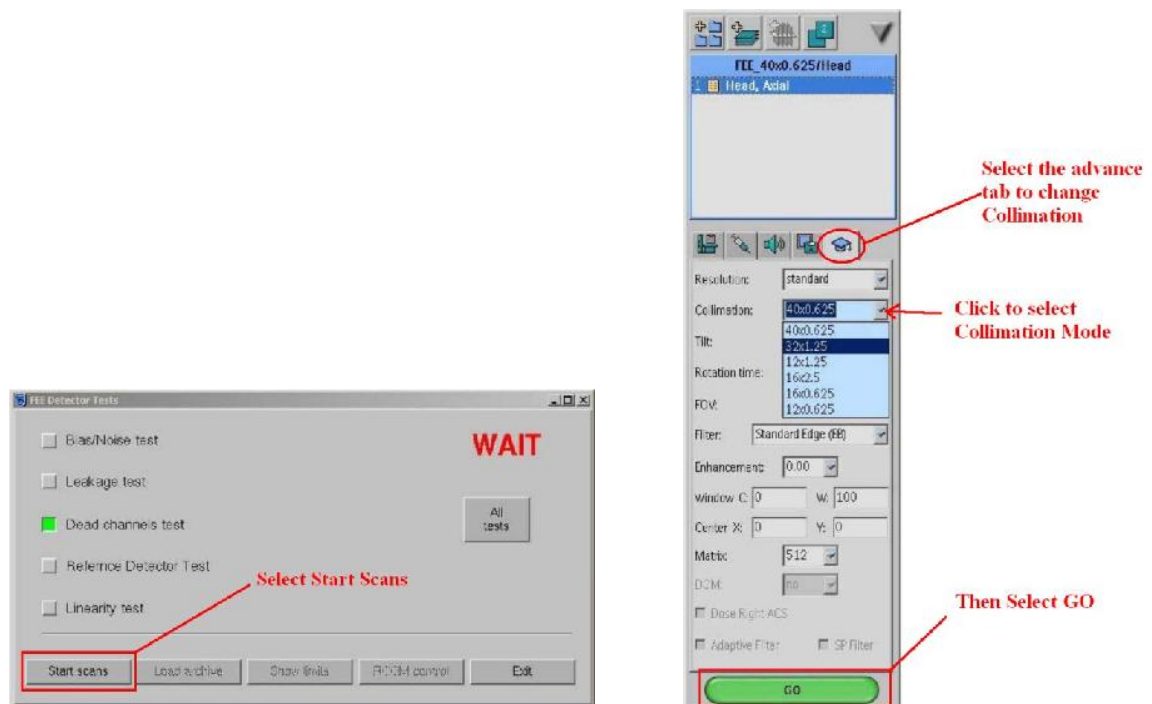


12. After all Collimation modes have been completed close off the FEE Detector Test window by selecting Exit.

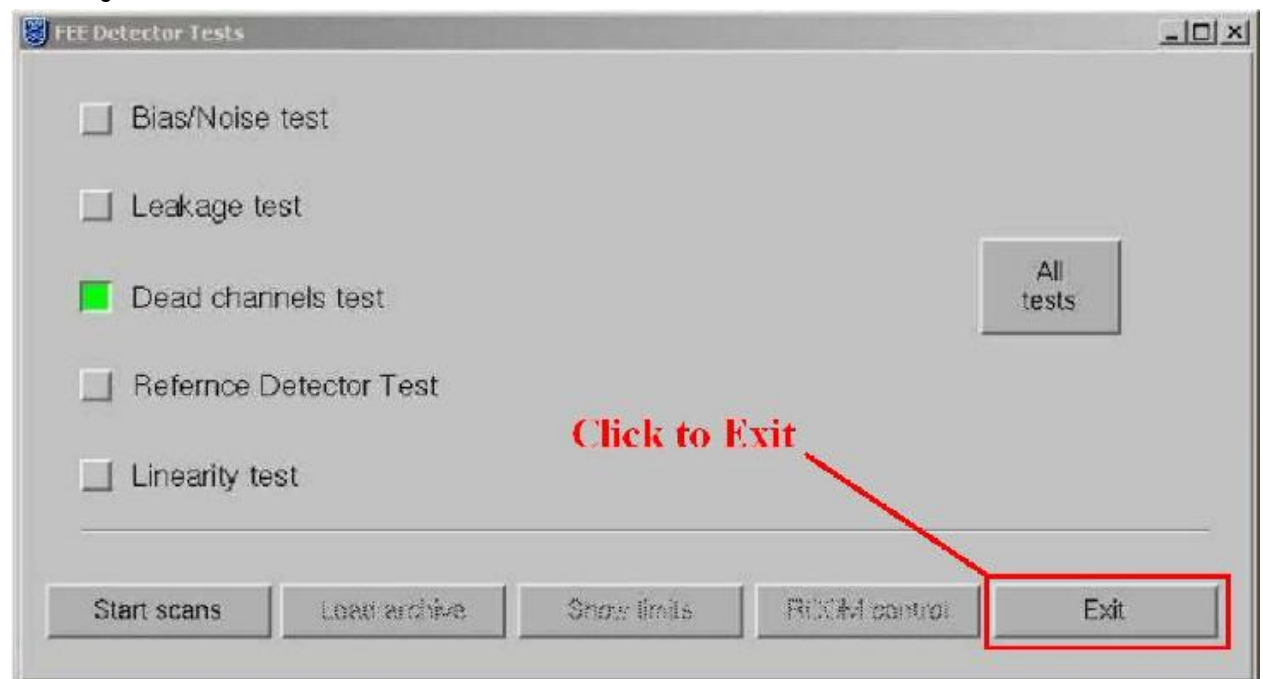


13. Select Bad Detector from underneath the Diagnostics Menu.



14. Select "Manual"

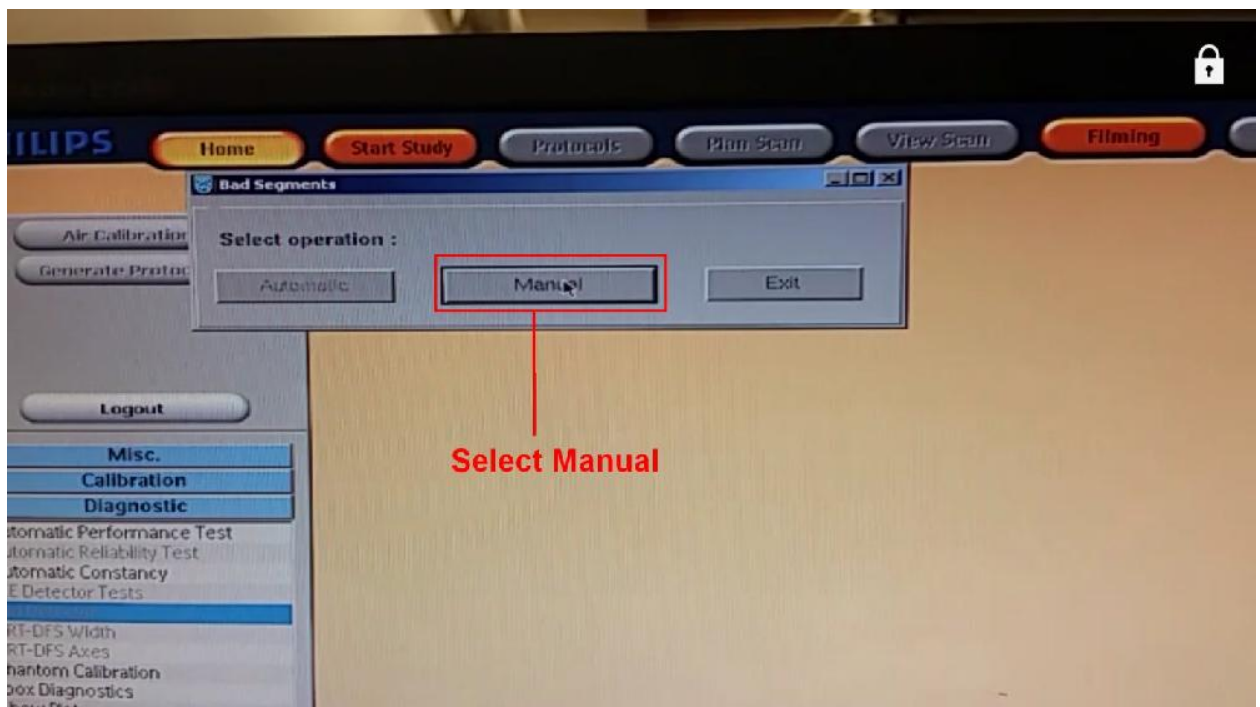

15. Select Add

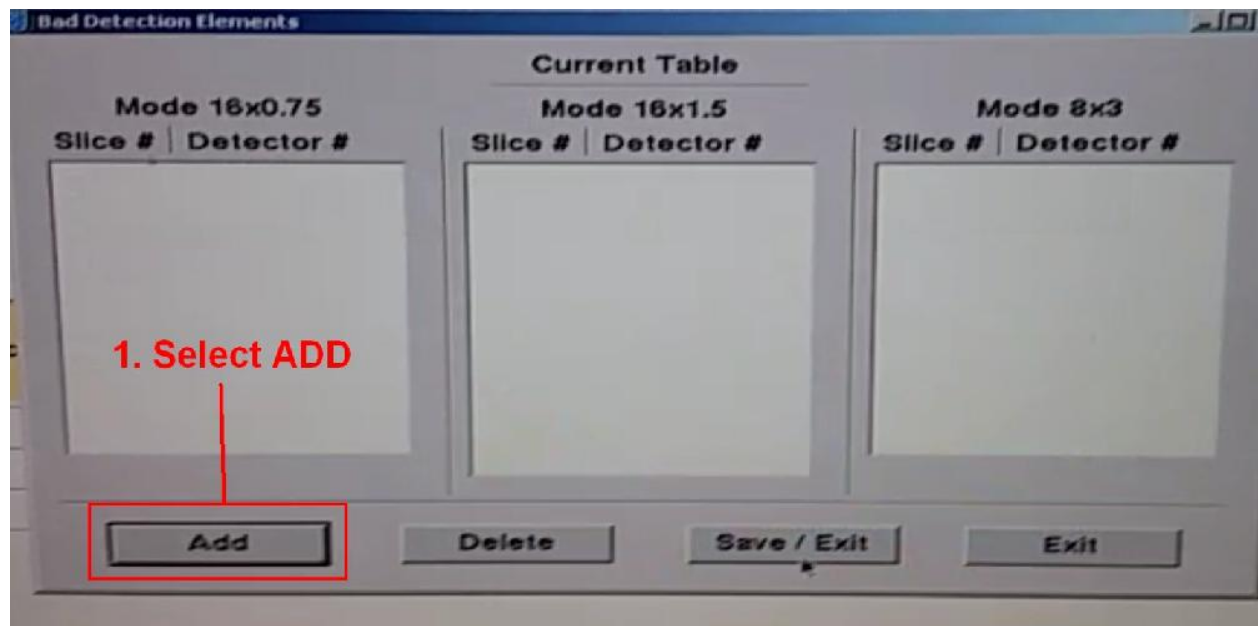


16. Select the corresponding Collimation Mode

Example 8x3, 16x0.75, 16x1.5


17. Enter the Slice Number and the Detector Number from step 10

- a. If a Slice Number and Detector Number are already listed then you do not need to add them again.


18. Select "OK"

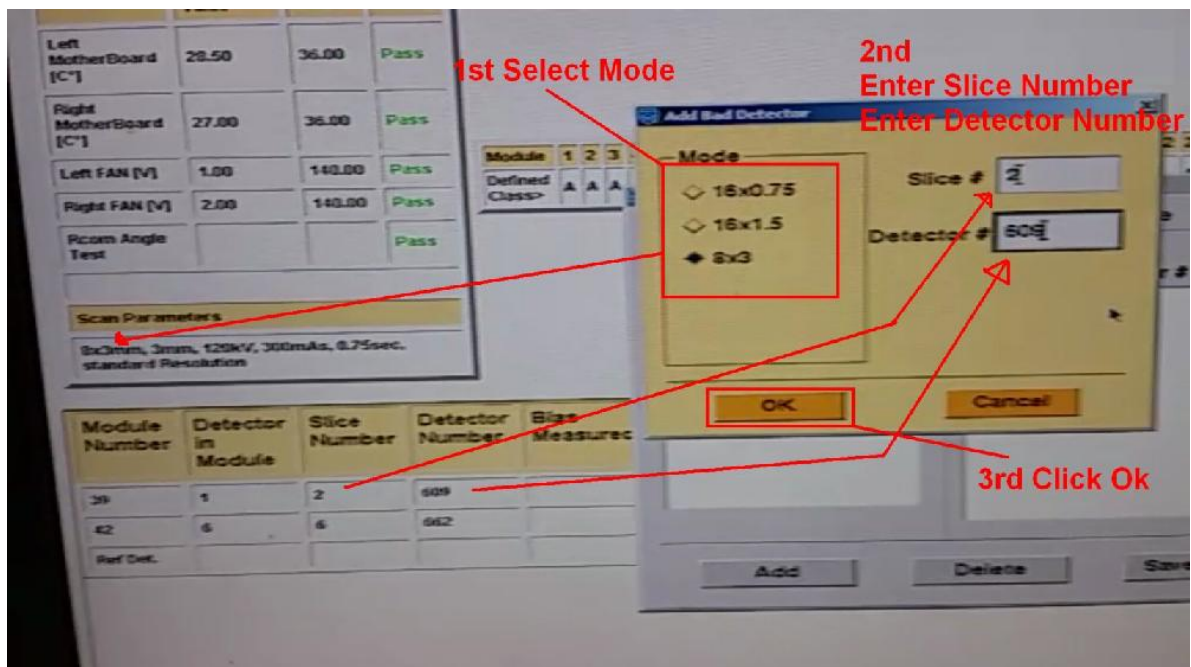


19. Repeat steps 15-18 for the remaining bad detectors and modes
20. Confirm all bad detectors are listed on the bad list, and When finished Select "Save / Exit"

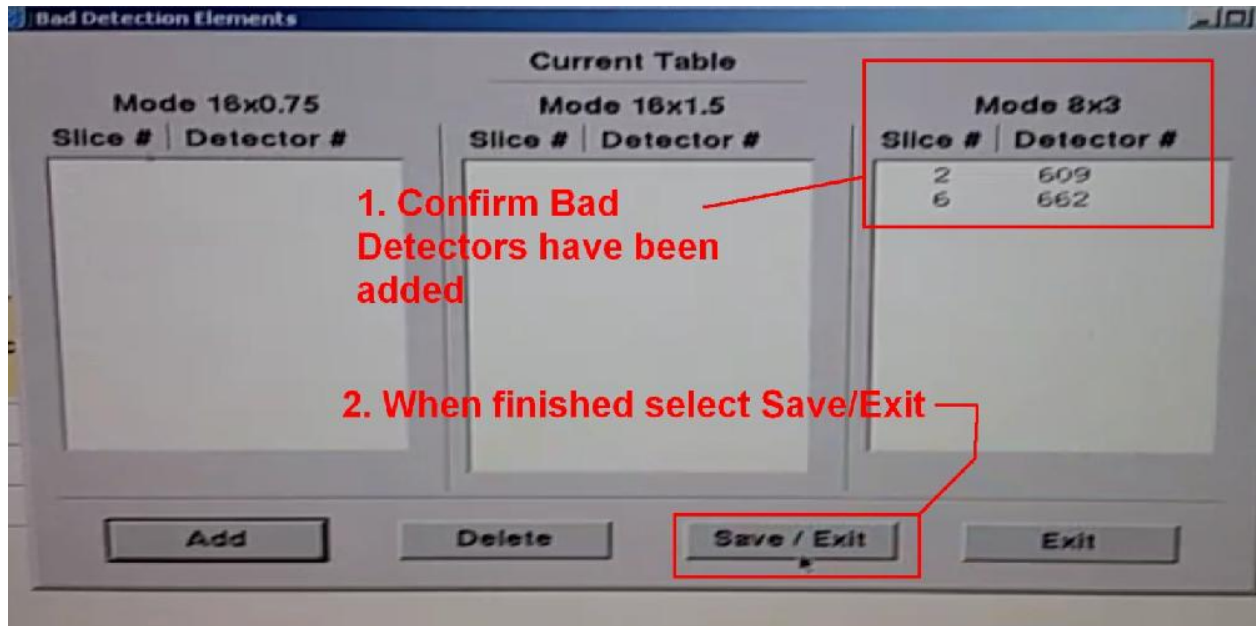

21. When prompted to Save new Tables select "Yes"

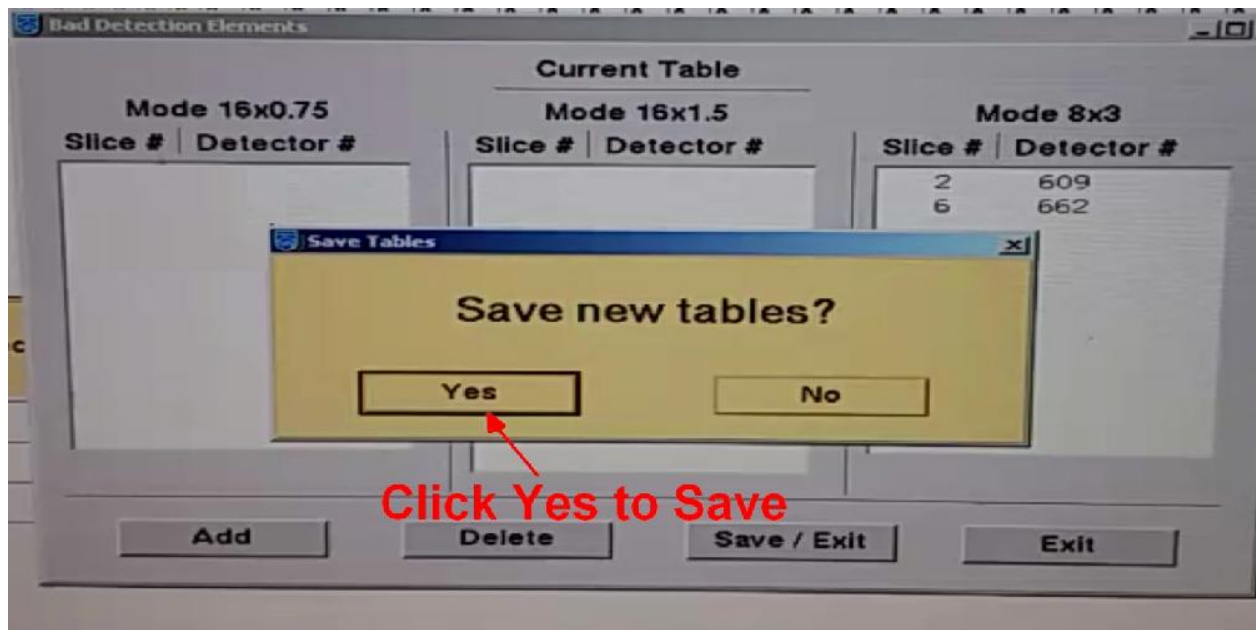

22. Close off all Dead Channel Test windows

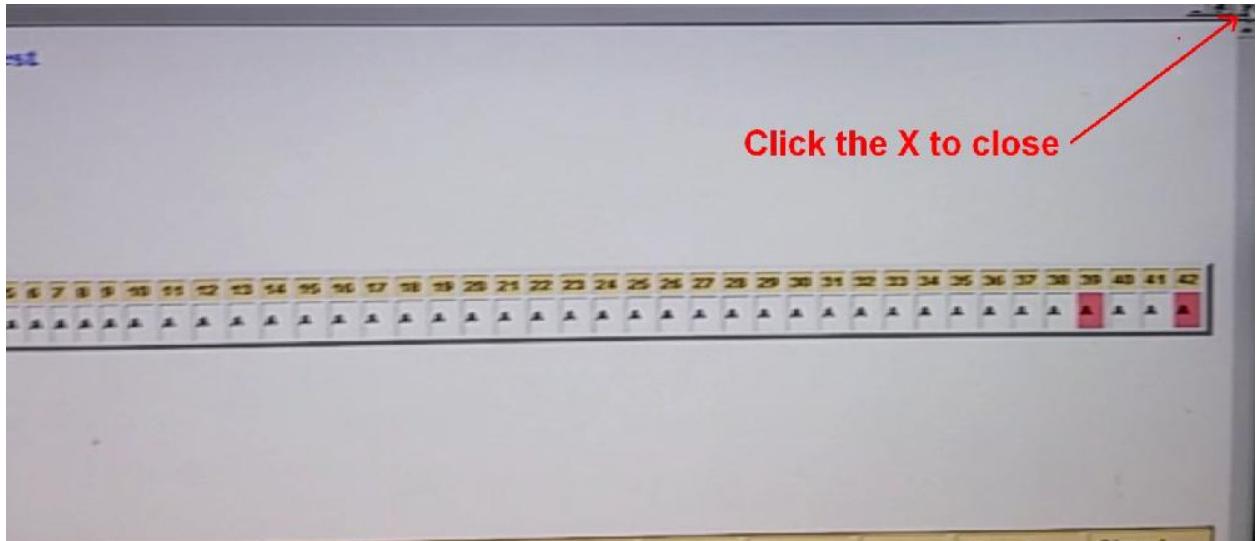

23. Logoff

24. Login using "CT"

25. Perform Air-calibrations

26. Run Test scans and verify there are no more rings.

The END!