

TECHNICAL BULLETIN



MODEL/DERIVATIVE:
Mini

No: **014**
Ref: **R0962bu**
Issue: **1**
Date: **30.10.96**


AFFECTED RANGE:
All versions

PROBLEM:
ENGINE NON START / FUEL PUMP NOISE - PIPE DAMAGE

Either of the following:-
Engine non-start or difficult to start.
Excessive noise from fuel pump.

CAUSE:
Bent under floor fuel feed pipe particularly in area illustrated. This may result in the flexible fuel feed hose being kinked causing local fuel pressure build-up.

ACTION:
Carefully re-shape fuel feed pipe so that flexible hose returns to correct position.

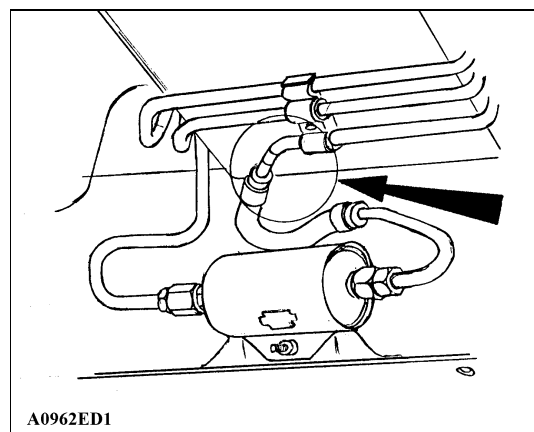

A0962ED1

PARTS INFORMATION:
Not applicable

WARRANTY CLAIMS:
Use complaint code: 2Q4C
Use S.R.O.: 19.40.88/40
Time allowed: 00.10 Hrs