

TECHNICAL BULLETIN



SRS



Bull. N°: 0008

CDS. ref: R3814bu

Issue: 1

Date: 8.02.95

MODEL/DERIVATIVE:

MINI, METRO, MONTEGO, 200, 400, 100

AFFECTED RANGE:

from the following Vins:-

Mini - 078248
Metro - 873074 and 527728
Montego - 656852
100 - 001001
200/400 - 791251

PROBLEM:

SEAT SQUAB 'CREEP BACK' - RECLINER NUT

Seat squab suffers regression or creep back and requires frequent adjustment.

CAUSE:


Torque relaxation of recliner mechanism nut.

ACTION:

Remove recliner hand wheel to expose the die casting and M4 nut (see illustration.

NOTE: take care not to damage recliner hand wheel, refer to 'Seat Overhaul Manual' for full removal information.

Hold die casting with an 8mm spanner across the flats and tighten the M4 nut a quarter of a turn (one and a half flats). check operation of recliner, if OK apply Loctite 924 or 638 to end of nut / thread. Refit hand wheel.

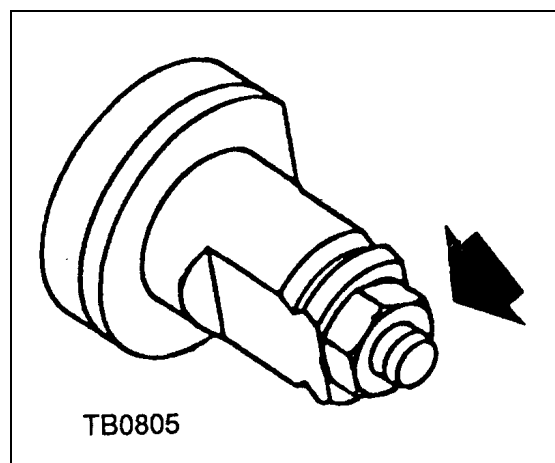

PARTS INFORMATION:

loctite 924 or 638

WARRANTY CLAIMS:

Use Complaint Code 8A4G

Use S.R.O. 78.10.88/37

Time allowed: 0.15 hour

(Time allowed is sufficient to cover both seats if required).