

TECHNICAL BULLETIN



MODEL/DERIVATIVE:
MINI

Bull. N°: **0004**
CDS. ref: **R5898bu**
Issue: **1**
Date: **25.05.94**


AFFECTED RANGE:
All versions

PROBLEM:
ENGINE SHUNT - WEAK STEADY BAR BUSHES

Engine shunt / kick, at light throttle. This condition may appear from approximately 6000 miles (9600 Kilometres) onwards.

CAUSE:
Upper engine steady bar bushes providing insufficient damping

ACTION:
Replace existing bushes with heavy duty bushes.

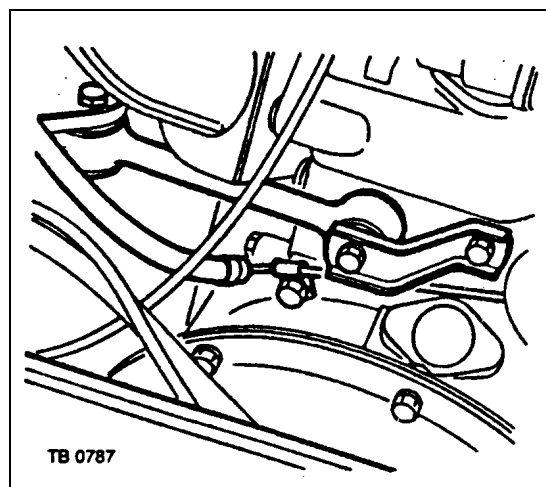

PARTS INFORMATION:
KKF100390 - Bush Engine Steady (heavy duty) - 4 off

WARRANTY CLAIMS:
Use complaint code: 5B2U
Use S.R.O.: 12.45.16
Time allowance: 0.35 hour - Non SPI
.....0.65 hour - SPI only.