

TECHNICAL BULLETIN



MODEL/DERIVATIVE:
100, New 200, New 400, Mini


Bull. No: 0024
CDS. Ref: R6707bu
Issue: 1
Date: 03.04.96

AFFECTED RANGE:
All vehicles with 5AS alarm systems

PROBLEM:
ALARM ECU CONNECTOR PINS DAMAGED BY TEST PROBES

Intermittent immobiliser and alarm problems caused by damage to the ECU connector pins, this condition may follow a previous repair where incorrect probes have been used.

CAUSE:
The connector uses 2 sizes of contacts pins, 040 and 070. Incorrect test probes will cause damage to the contact spring leaf (arrowed in illustration) and result in intermittent failure.

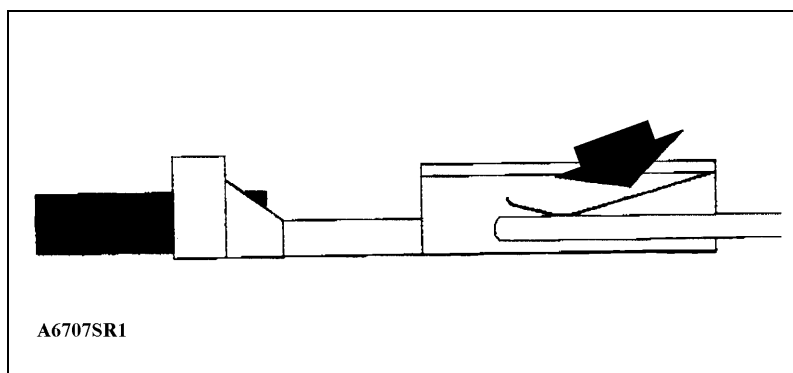

ACTION:
The only tools that should be used to probe the connectors on their mating faces are TestBook part numbers DTC0009A or DTC0036A, these contain a male orange probe which can be used for 070 size pins, however there is no probe for size 040 pins.

If size 040 pins require to be probed or if the Testbook tools are unavailable, the only satisfactory way is to snap up the anti-backout flange on either side of the connector and probe from the side where the wires enter.

PARTS INFORMATION:
Not applicable

WARRANTY CLAIMS:
Not applicable