

TECHNICAL BULLETIN



MODEL/DERIVATIVE:

Mini, 100, 200/400, New 200, New 400

Bull. No: 0028

CDS. Ref: R6957bu

Issue: 1

Date: 25.09.96

AFFECTED RANGE:

Mini - XN 117711 onwards

100 - XP 066946

200/400 - XW 235024

New 200 - All

New 400 - All

PROBLEM:

REMOTE HANDSET, BUTTON DAMAGE

CAUSE:

Either:

Buttons split (damage by finger nail).

Buttons stuck down (displaced and trapped under casing).


ACTION:

Remote handset service kit, part number YWX101010 introduced to enable button and casing replacement whilst retaining the original transmitter component. This improved housing is supplied with modified rubber buttons to prevent reoccurrence of the above problems.

Note: Anti-static precautions must be observed when performing the procedure.

Replacement procedure:

- Prise original handset apart, with a small screwdriver, inserted into the cut-out at the rear (key ring end) of the remote handset.
- Using finger pressure only, prise apart the two clips holding the printed circuit board and remove it from the remote handset.

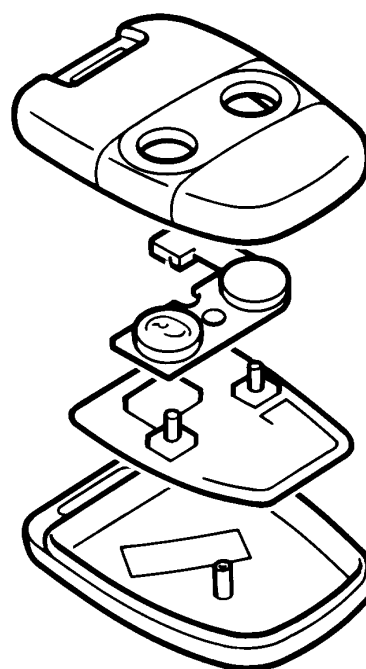

A6957TC1

Note: Handle printed circuit board by its edges only, therefore avoiding any form of contamination to electrical components.

- **Press the new button moulding into the new upper casing.**
- **Clip the original printed circuit board into the new upper housing assembly taking care to align it correctly.**

Note: Do not stress the thin circuit board material during fitment.

- **Transfer the week/year code label from the inside of the original lower case to the new lower case.**
- **Fit upper housing assembly to the new lower casing supplied in kit.**
- **Fix appropriate type approval label (supplied in kit).**

PARTS INFORMATION:

YWX101010 - Kit remote handset

Kit contents:

- **Upper casing half**
- **Lower casing half**
- **Button moulding**

WARRANTY CLAIMS:

Use Complaint Code: 8K1E

Use S.R.O. 86.77.88/26

Time allowed: 0.10 hour