

TECHNICAL BULLETIN



MODEL/DERIVATIVE:

Mini

Bull. N°: **0018**

CDS. ref: **R7303bu**

Issue: **1**

Date: **5/03/97**

AFFECTED RANGE:

All multi point injection vehicles up to engine number 12A2LK70 345346


PROBLEM:

ENGINE MISFIRE, HESITATION, ETC - CAM RELUCTOR

May also suffer reluctance to rev freely. Condition may be intermittent, i.e. may run normally on some journeys.

CAUSE:

Camshaft reluctor teeth not to specification resulting in irregular cam sensor pick-up. Since the cam sensor only requires synchronising on start-up, it is likely that some starts will not detect an error resulting in normal running for that journey.

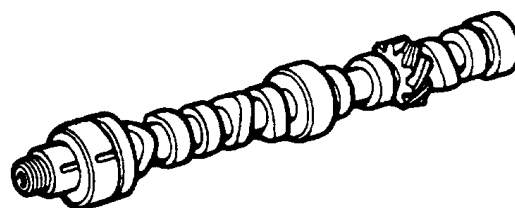

A7303RM1

ACTION:

Condition described above will be apparent from new even though condition may not occur on every journey. If no other faults are apparent, e.g. ignition or fuel related then replace camshaft. If symptoms develop after a period of time suspect causes other than cam reluctor.

PARTS INFORMATION:

LGC 105380.....Camshaft

WARRANTY CLAIMS:

Use complaint code: 1H8U

Use S.R.O.: 12.13.02

Time allowed: 11.60 Hrs