

TECHNICAL BULLETIN



MODEL/DERIVATIVE:

Mini

Bull. N°: **0019**

CDS. ref: **R7518bu**

Issue: **2**

Date: **4/06/97**

AFFECTED RANGE:

1997 model year vehicles only, with manual gearbox

**Engine number range 342982 to 349174 and with engine prefix's:
12A2LK70 (Mpi) and 12A2DK71 (Spi).**

RE-ISSUE INFORMATION:

Ammendment to warranty claims information.

PROBLEM:

OIL LEAK FROM PRIMARY DRIVE GEAR - GALLERY PLUG

Oil leaking from the end cover to flywheel housing joint or starter motor flanges/bolts.

If leakage is only from split pin in the flywheel housing, there is almost certainly another cause.

Leakage is more likely following repeated use of the clutch, i.e. urban type driving conditions.

CAUSE:

Oil leaking between primary drive gear and crankshaft.

Condition is caused by a recent modification to the relief valve drain exit drilling in the cylinder block.

ACTION:

- **Remove oil sealing plug from the relief valve drain drilling at the sump face.**
- **Plug existing 'angled' relief valve drilling at the block rear end face.**

Preparation:

Referring to the Repair manual 'Engine Repairs Section'

- **Remove engine.**
- **Separate engine from gearbox.**
- **Remove oil pressure relief valve assembly.**
- **Place engine on bench with oil filter facing down (engine on its side).**

Sealing Plug Removal Procedure:
Referring to illustration 1 and 2

- Locate the oil sealing plug (arrowed in illustration 1) situated adjacent to the rear main bearing cap. The plug outer is aluminium and the centre core made from steel.
- Using a suitable flat ended punch (illustration 2), gently tap the steel core of the plug until level with the aluminium plug body.
- Using a smaller punch (3 mm dia), tap the plug centre core completely through, it should drop clear from the relief valve hole and onto the bench, if it doesn't, lift the engine slightly and retrieve with a magnet.

IMPORTANT:



The centre core must be retrieved and discarded.

- Remove rear main bearing cap.

• **CLEANLINESS CARE POINT!**

Adequately protect the exposed main bearing journal and surrounding 'dirt sensitive' components to prevent debris contamination.

- Drill out plug with a 6.8 mm drill and tap hole with an M8 tap, load both with grease to reduce swarf contamination.
- Assemble an M8 nut bolt and washer/spacer and extract the remainder of the plug by tightening the nut against the spacer.
- Clean the surrounding area of swarf and flush out the relief valve hole.

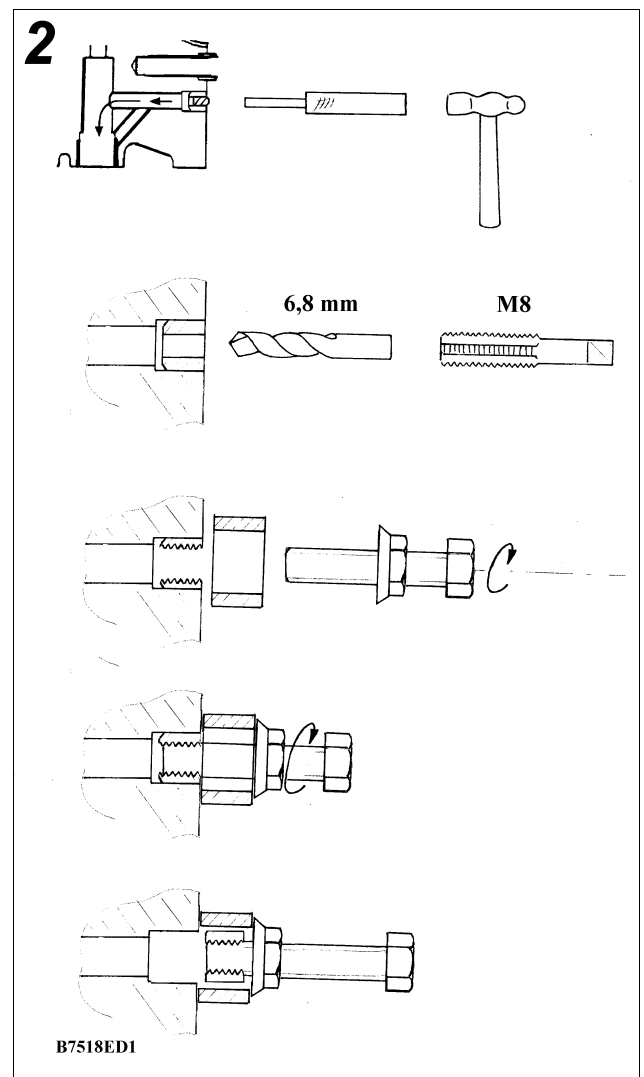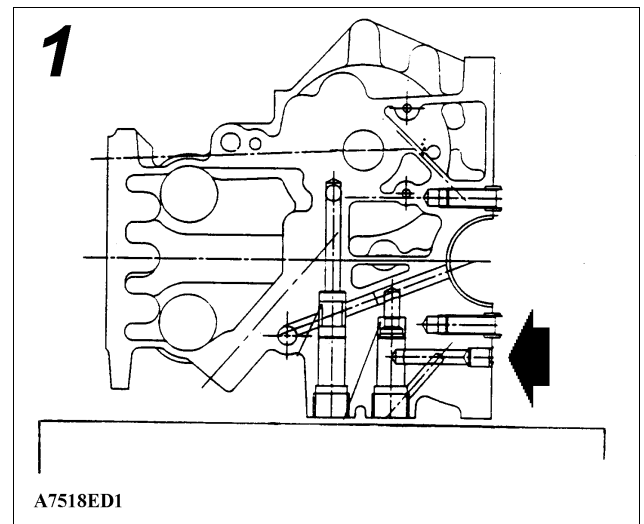


Insertion of tapered oilway plug:

Referring to illustration 3

- Locate the oil drilling in the end face of the cylinder block (arrowed), this is a large shallow countersunk drilling leading into a smaller hole.

IMPORTANT:

Carefully remove all traces of oil from oil drilling and tapered plug using a suitable degreaser.

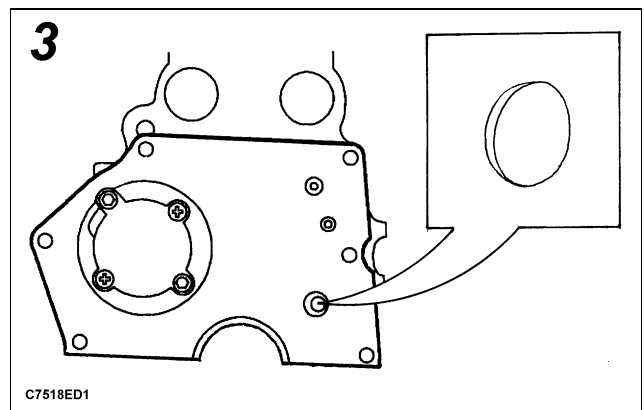

- Obtain tapered plug, part number LCM 100140. Apply a bead of Loctite 638 around the taper portion of plug and tap securely into the position shown.
- Wipe off any surplus Loctite and clean excessive oil from primary gear, flywheel and flywheel housing before re-assembly.
- Rebuild engine observing correct torque figures etc.

PARTS INFORMATION:

LCM 100140 - Plug oilway

LUF 10005 - Oil seal

AHU 1959 - Oil seal

2A 3606 - 'O' ring

GUG 703049 SG - Transmission gasket (pair)

GUG 705563 GM - Housing gasket

WARRANTY CLAIMS:

Use complaint code: 1A3S

Use S.R.O.: 37.20.02/99

Time allowed: 9.70 hrs (MPI - less air con)

Time allowed: 7.80 hrs (SPI - less air con)

Use S.R.O.: 37.20.02/99 (SPI - with air con)

Time allowed: 11.10 hrs

Above SRO represents scheduled time allowed for 'engine and gearbox assembly' remove for access and refit. This should be used with the following additional SRO for sealing plug removal and fitment of tapered plug (engine on bench).

Use S.R.O.: 12.37.88/26

Time allowed: 0.50 hrs