

TECHNICAL BULLETIN



MODEL/DERIVATIVE:
MINI

Bull. N°: 0031
CDS. ref: R7532bu
Issue: 1
Date: 19.11.97


AFFECTED RANGE:
Vin 134455 (97 MY) to 151917 only

PROBLEM:
SEAT CUSHION DAMAGED - UNRESTRAINED TIPPING

Seat cushion cover damaged by hinge escutcheon when seat squab is tipped fully forward.

CAUSE:
Unrestrained squab tipping resulting in hinge escutcheon fouling cushion cover.


ACTION:
The damaged seat cushion cover(s) will require replacement.
To prevent re-occurrence of seat cover damage, fit two check straps per seat part number HZU 100050.
This modification should be applied to both front seats even if opposite seat has not sustained damage requiring cover replacement.
All vehicles from Vin 151917 onwards have check straps fitted.

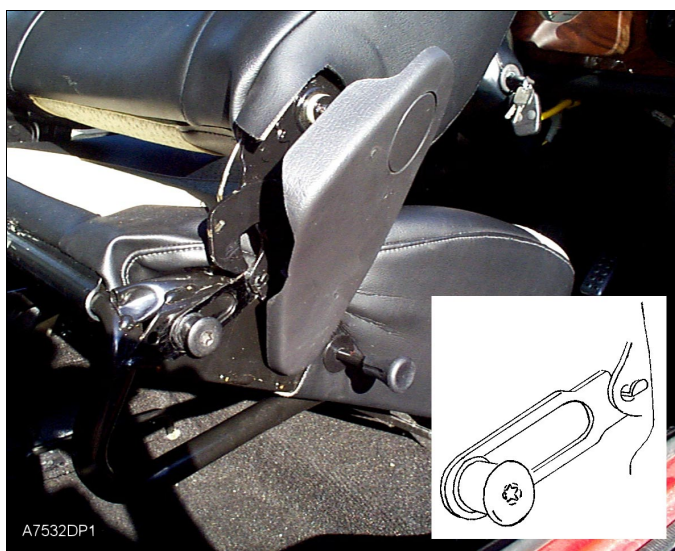

Fitting instructions:

1. Carefully disengage the rear escutcheon fixing from one seat side to expose hinge.
Note: try not to bend escutcheon excessively as this may break plastic fixings or bruise the outer escutcheon surface.
2. Remove the black Torx 50 squab striker and plastic sleeve. If a flat washer is also fitted retain this for re-fitment.
3. Reverse the sleeve position on striker so that sleeve flange is now adjacent to thread (illustration 'A').

4. View sleeve end in relation to striker shoulder. If flush with shoulder (illustration B), fit a suitable size spring washer to provide a shoulder extension, 'see parts information'. If shoulder protrudes slightly (illustration 'C'), no spring washer is required.
5. Fit check strap by hooking tab into redundant hole position in hinge (see photo inset).
6. Re-fit and tighten striker bolt so that the exposed striker shoulder or spring washer locates check strap slot. If a flat washer was originally fitted, refit between check strap and seat frame.
7. Re-fit escutcheon rear fixing.
8. Repeat modification for opposite side of seat.
9. Ensure that squab tips satisfactorily and that seat locks securely in upright position.

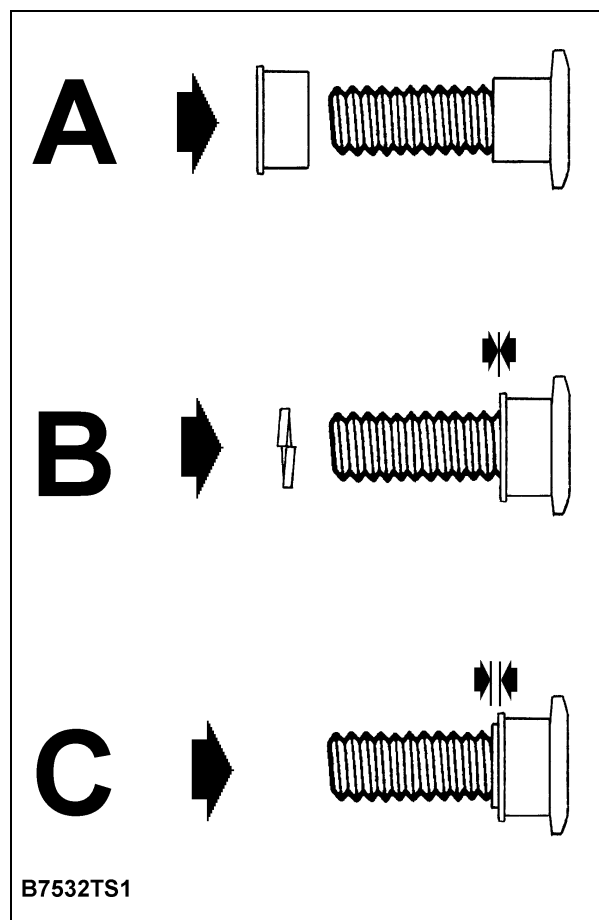

PARTS INFORMATION:

HZU 100050 - Buffer stop (check strap)...quantity required - 4

WM 110001 - Spring washer... quantity required - 4

Seat covers:

Refer to parts fiche for correct part dependent on vehicle model and colour.

WARRANTY CLAIMS:

Use Complaint code: 8B1J

Use S.R.O 78.30.88/31

Time allowance 0.40 Hrs (includes fit straps to both front seats)

Use S.R.O. 78.30.01

Time allowance 1.15 Hrs (single cushion cover renew)