

TECHNICAL BULLETIN



MODEL/DERIVATIVE:

100, 200, 400, Mini, 200 Cabriolet, Coupe, 400 Tourer,
(200/400 previous model)

Bull. N°: 0030

CDS. ref: R8101bu

Issue: 1

Date: 1.10.97

AFFECTED RANGE:

All vehicles fitted with Lucas 5AS security ECU's, introduction is as follows:

100 - All vehicles

200 - All vehicles

400 - All vehicles

Mini - From 95 model year onwards, start Vin 103113

200/400 including Cabriolet, Coupe and Tourer - From 94.5 MY onwards start
Vin 001001

PROBLEM:

SECURITY ECU PROGRAMMING - PARTS CHANGE

The introduction of a new non-programmed ECU may initially cause part ordering confusion. Technicians may also be unfamiliar with the correct programming technique.

CAUSE:

Previously, many pre-programmed ECU's were required to cover a variety of models and territories resulting in parts ordering and stocking problems.

ACTION:

Two new 'non-programmed' ECU's have been introduced allowing many model versions and territories to be programmed from the same ECU.

The new ECU can only be fitted to vehicles having the latest Lucas 5AS security ECU.

Identification of vehicles having Lucas 5AS is as follows:

- Check model has Lucas 5AS (see 'Affected Range').
- The latest 5AS ECU has two connectors, one grey 26 way and one white 12 way (the white connector is unused on some models).

Ordering correct part:

The replacement ECU will require to be the same radio remote frequency as the original, hence two ECU part numbers (see 'Parts Information').


As a general guide 433 MHz frequency remotes are fitted to UK and European vehicles and 315 MHz to the rest of the world. If the territory frequency is uncertain, confirmation may be established as follows:

The frequency of the original ECU can be identified by a single large letter printed on the ECU casing:

- Letter 'L' 'H' 'R' or 'A' indicates frequency is 433 MHz (replacement ECU has ID 'A').
- Letter 'M' 'K' 'S' 'T' or 'B' indicates frequency is 315 MHz (replacement ECU has ID 'B').

The frequency of the remote transmitter can be identified by carefully opening the casing and viewing the printed circuit board from the battery side. Look for a small silver cap (approximately 8 mm dia), the markings on this will indicate frequency.

- 1207 indicates 433 MHz
- 1239 indicates 315 MHz

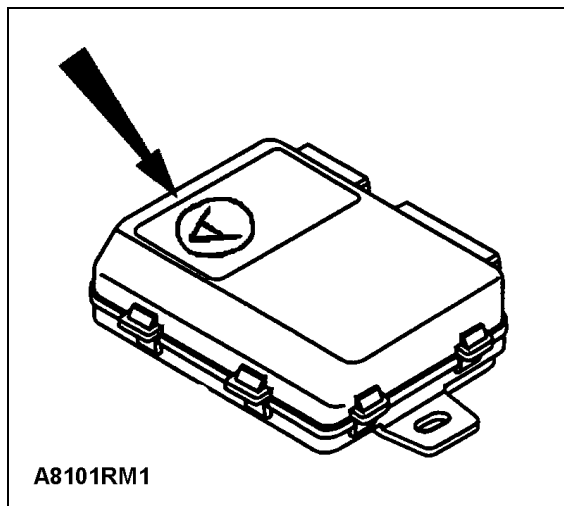

ECU location:

100 - Located on the facia rail behind the glove box.

200 - Located under right hand side of facia for right hand drive models and left hand side for left hand drive models.

400 - Located behind front of centre console.

Mini - Located behind the facia/instrument pack.

200/400 - As per new 200.

ECU programming:

The new 5AS ECU can only be programmed using TestBook CD - DRE0001 onwards. Use TestBook 'Diagnostics' to program ECU.

Select: 'Security' - 'Programming Options' - 'Market Program'.

This TestBook sequence will then allow ECU programming to the correct vehicle type and territory.

NOTE: 400 series 97.5 MY onwards (automatic and manual) and 96 MY (1.6 automatic) cannot be programmed with DRE0001, for these models use DRE0002.

Confirmation that ECU has been programmed (200 and 400):

Applies only to 200 and 400 series (not previous models).

If the ECU has **not** been successfully programmed, a 'Not Market Programmed' warning will sound when ignition is turned on. This consists of the following:

A few seconds of the usual engine immobilised 'two-tone' chime, followed by a few seconds of silence and then a repeat of the chime etc. This will sound regardless of immobiliser cancellation with remote.

When ECU has been programmed to the relevant market the warning sound will cease.

Re-programming:

If an error occurs during programming, the same ECU may be re-programmed more than once.

PARTS INFORMATION:

YWC105330 - ECU (433 MHz identification code 'A')

YWC105340 - ECU (315 MHz identification code 'B')

For vehicles prior to those quoted in affected range (prior to Lucas 5AS introduction), ECU part numbers are unchanged.

WARRANTY CLAIMS:

Refer to the original cause of ECU failure and apply warranty claim as appropriate.