

TECHNICAL BULLETIN



MODEL/DERIVATIVE:
Mini

No: **0046**
Ref: **X1885bu**
Issue: **1**
Date: **22.03.2000**

AFFECTED RANGE:
All

PROBLEM:
AUXILIARY DRIVE BELT RIB CRACKING



Cracked ribs, either noted by the customer, or identified during vehicle service.

CAUSE:
Cracks are entirely normal and a result of the belt ageing process.

ACTION:
Following a customer concern, examine belt around its entire length.
The illustrations show drive belts in 'acceptable' and 'unacceptable' conditions.

- *Illustration 1* shows a belt with typical rib cracking which must be regarded as acceptable.
- *Illustration 2* shows a belt with abnormal degradation, e.g. portions of ribs missing. A belt in this condition must be replaced.

Conclusion: No action should be taken providing ribs are still intact, i.e. they have no loose or missing portions.

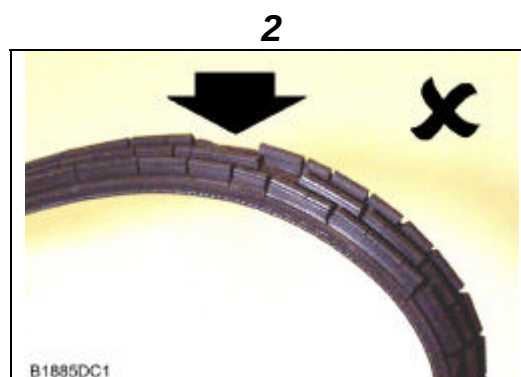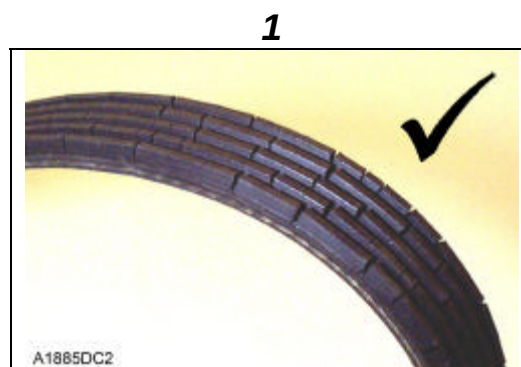

PARTS INFORMATION:
Not applicable

WARRANTY CLAIMS:
Not applicable