

# TECHNICAL BULLETIN



*MODEL/DERIVATIVE:*  
**Mini**


*Bulletin N°:* **0007**  
*CDS. ref:* **X8419bu**  
*Issue:* **1**  
*Date:* **17.03.99**

*AFFECTED RANGE:*  
**All vehicles**

*PROBLEM:*  
**BRAKE WHEEL CYLINDER SUSPECT LEAKAGE**

Wheel cylinders considered to be leaking when carrying out routine service inspection.

*CAUSE:*  
Incorrect diagnosis. In the majority of instances, fluid seen around a wheel cylinder boot is assembly fluid. Assembly fluid is used by the wheel cylinder manufacturer to assist the piston to cylinder assembly process. If excess amounts are used inadvertently, fluid may be forced past the cylinder boot and become visible.

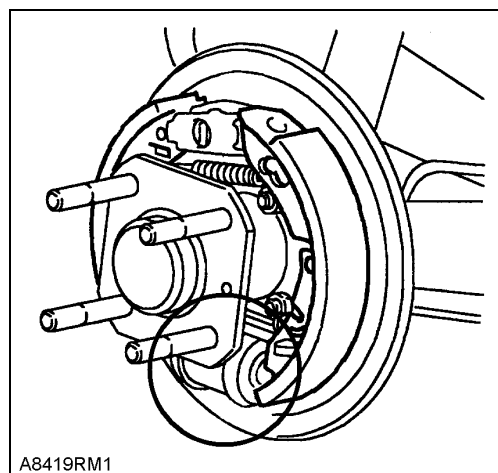

*ACTION:*  
**DO NOT** replace brake wheel cylinder if fluid signs are isolated to cylinder boot only and are showing no additional brake fluid loss or lining contamination signs.

*PARTS INFORMATION:*  
**Not applicable**

*WARRANTY CLAIMS:*  
**Not applicable**