

TECHNICAL BULLETIN



MODEL/DERIVATIVE:
Mini

Bulletin N°: 0025
CDS. ref: X8420bu
Issue: 1
Date: 2.06.99

AFFECTED RANGE:
All vehicles up to VIN XN 172842

PROBLEM:
ENGINE STEADY BUSHES WEAK - MODIFICATION

Knock from engine compartment when clutch is engaged or throttle is applied.


CAUSE:
Upper engine steady bushes not capable of withstanding increased engine torque*. Therefore bushes have become weak or worn prematurely.

*** Current engines i.e. 1298cc MPI produce considerably more torque than earlier 998 cc carb type engines for which the original bushes were designed.**

ACTION:
To increase upper engine steady bush durability, replace the 2 upper rubber bushes for single bush part number KKF101320.

NOTE: This bush cannot be used on the lower tie bar. This is due to the fixing bolt being a different size to the upper.

- 1. Remove upper engine steady from vehicle and remove worn bushes and spacer tube from steady.**
- 2. Press new single bush KKF101320 complete with bonded internal spacer tube into engine steady. To assist fitment, the new single bush assembly can be pushed into steady with the help of a vice and a suitable spacing tube such as a socket, (there is no special tool available for this purpose).**
- 3. Refit upper engine steady to vehicle.**

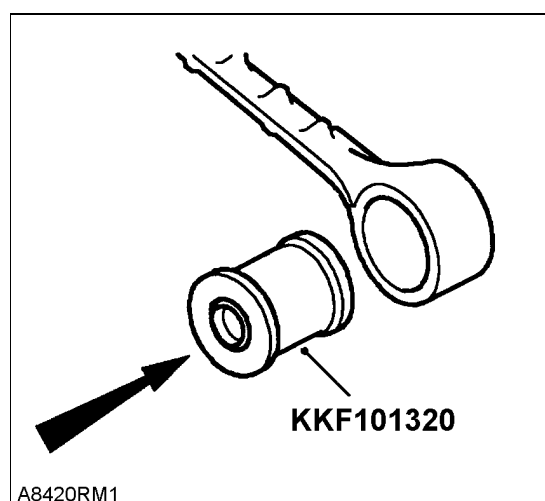

PARTS INFORMATION:
KKF101320 Bush - engine steady - upper

WARRANTY CLAIMS:
Use Complaint Code: 5B2J

Use S.R.O.: 12.45.16

Time allowance:

0.65 Hrs - SPi

0.50 Hrs - MPi