

Azul J6 zone harness · form fixture · v10 · 2026-07-16

Diagonal pegs, strictly horizontal wire runs, cut line at strip end (6 mm inside J6).

FIXTURE BUILD NOTES

Substrate: 6 mm plywood, ~200 × 220 mm.


Pegs (P1–P14, PC): finishing nails or #4 wood screws, ~10 mm above surface.

Pilot 1–1.5 mm for nails; 2 mm for screws.

Strain relief: 2 nails 8–10 mm apart, or a wood bar with a 9 mm slot screwed down.

HARNESS PROCEDURE

1. Clamp cable jacket at strain relief.
2. Cut jacket at "JACKET CUT" tick.
3. Route bundle up X=50, wrap CW around P14.
4. Follow diagonal P14 → P1, each peg's NW quadrant is tangent to the bundle.
5. Pull each conductor off at its peg: wrap CW ~90° from bundle to horizontal.
6. Wire runs strictly east to its K box.
7. Trim to reach J6 pin with 5–8 mm slack. Strip 6 mm, terminate. Torque per spec.

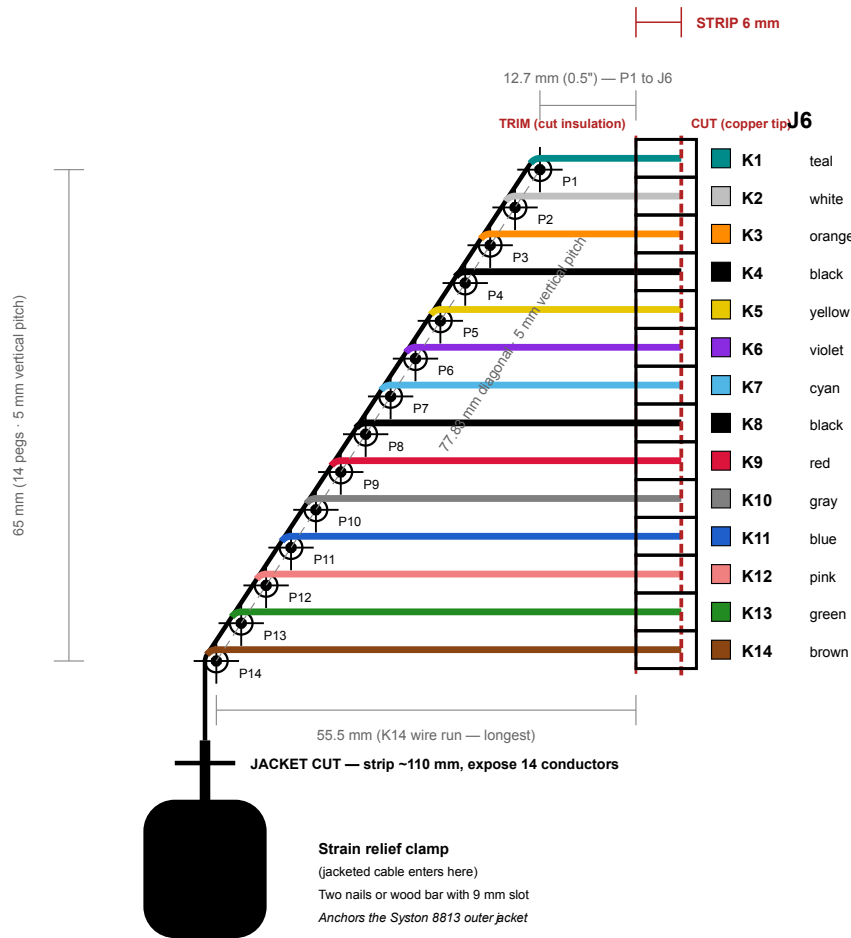

J2 (24VAC input, 2-pos)


No fixture needed. Pigtail from barrel jack is factory-made 150 mm, 2 conductors.

Cut jacket back ~15 mm at the terminal end. Strip each conductor 6 mm. Insert into J2 (barrel tip polarity depends on jack — VERIFY with meter before soldering). Then torque.

J2 pin pitch is also 5 mm (MX126-5.0-02P). Body 10.5 × 7.8 mm.

CALIBRATION

Verify this 100 mm line with calipers before cutting or drilling.

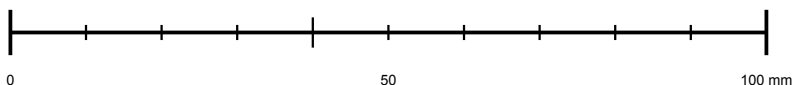

PRINT INSTRUCTIONS

Letter portrait · 100% scale · no fit-to-page
Uncheck all auto-scale options in print dialog.
rsvg-convert to PDF for best fidelity.

Dimensions verified against main-controller-v1.kicad_pcb 2026-07-16.